

SAFETY NEWS

From the
U.S. Consumer Product Safety Commission (CPSC)
4330 East West Highway
Bethesda, Md. 20814

This edition of Safety News is a compilation of recalls
announced by CPSC during the
2nd Quarter of 2017.



UNITED STATES OF AMERICA
CONSUMER PRODUCT
SAFETY COMMISSION



United States
CONSUMER PRODUCT SAFETY COMMISSION

Fred Meyer Recalls Children's Hooded Sweatshirts and Girls Bomber Jackets Due to Choking and Laceration Hazards



Recall Summary

Name of product:

Children's zipper hooded sweatshirts and girls bomber jackets

Hazard:

The zipper pull can detach from the sweatshirt, posing choking and laceration hazards to children.

Remedy:

Refund

Recall date:

April 4, 2017

Units:

About 48,000

Consumer Contact:

**Fred Meyer at 800-576-4377 from 8 a.m. to 9 p.m. ET
Monday through Friday or online at
<https://www.fredmeyer.com> and click on "Recall
Alert" located at the bottom of the page for more
information.**

Recall Details

Description:

This recall involves Kids Komer brand fleece hooded sweatshirts and girls bomber jackets with a front zipper, two front pockets, and knit ribbing around the wrists and waist. The sweatshirts were sold in 18 different prints and solid colors in infant, toddler, and children's sizes 9 months to youth size 7. Kids Komer is printed on the label at the back of the neck. A white label sewn into the lower left inside seam has the manufacture date of "11/16" and style numbers ending in 8701P, 8701YD, 8671P, 9019, or 9022P.

Remedy:

Consumers should immediately stop using the sweatshirt or jacket, and return it to the place of purchase for a full refund.

Incidents/Injuries:

None reported

Sold At:

Fred Meyer, Kroger, Smith's and Fry's Marketplace from February 2017 through March 2017 for between \$7 and \$10.

Importer(s):

Fred Meyer, Inc., of Portland, Ore

Manufactured In:

China

Recall number:

17-125



This recall was conducted, voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Marin Mountain Bikes Recalls Bicycles Due to Fall, Crash Hazards



Recall Summary

Name of product:

Pine Mountain bicycles

Hazard:

The rigid front forks on these recalled bikes can bend or break during use or while jumping, causing the rider to lose control, posing fall and crash hazards to the user.

Remedy:

Replace

Recall date:

April 6, 2017

Units:

About 370 (in addition, about 100 were sold in Canada)

Consumer Contact:

**Marin Bikes at 800-222-7557 from 8 a.m. to 5 p.m. PT
Monday through Friday or online at
www.marinbikes.com and click on the “recalls/safety”
link at the bottom of the page for more information.**

Recall Details

In Conjunction With:

Description:

This recall involves two Marin Mountain bicycle model years and model names: 2016 Pine Mountain 1 and 2017 Pine Mountain bicycles. The bicycles were sold in five frame sizes and in one basic color scheme (silver painted frame with orange painted fork.) The model name "Pine Mountain 1" (2016) or "Pine Mountain" (2017) is printed on the top tube of the frame and the downtube of the frame has a "MARIN" decal.

Remedy:

Consumers should immediately stop using the recalled mountain bikes and contact the firm for instructions on receiving a replacement bicycle fork and scheduling a free repair.

Incidents/Injuries:

The firm has received four reports of bent bicycle forks including one report in the United States and three in other countries. No injuries have been reported.

Sold At:

Independent bicycle stores nationwide from December 2015 through February 2017 for about \$1,000.

Importer(s):

Marin Mountain Bikes Inc., of Novato, Calif.

Distributor(s):

Marin Mountain Bikes Inc., of Novato, Calif.

Manufactured In:

Indonesia

Recall number:

17-126





This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Xootr Recalls Adult Kick Scooters Due to Fall Hazard

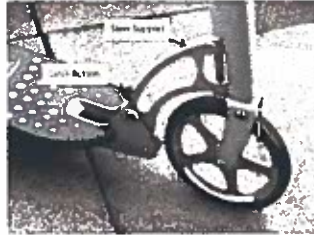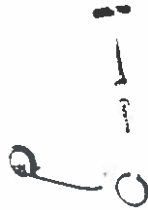

Recall Summary

Name of product:

Xootr adult kick scooters

Hazard:

The steer support can break during normal use, posing a fall hazard to the user.

Remedy:

Repair

Recall date:

April 6, 2017

Units:

About 3,000

Consumer Contact:

Xootr at 800-816-2724 from 9 a.m. to 5 p.m. ET Monday through Friday, by email at support@xootr.com or online at www.xootr.com and click on "Recall Information" for more information.

Recall Details

Description:

This recall involves all Xootr adult kick scooters with the QuickClick push-button latching mechanism. The silver scooters are 30 inches long by 10 inches wide, and have a handlebar height of 36 inches. The Xootr logo is on the deck and lower section of the handlebar. The scooters have a plastic, wood or metal deck, and can be identified by a black push button located on the steer support.

Remedy:

Consumers should immediately stop using the recalled scooters and contact the firm to receive the free repair.

Incidents/Injuries:

The firm has received six reports of breaks in steer supports, resulting in one report of scrapes and bruises from a fall.

Sold At:

Lajolla Swim and Sport, Nyce Wheels, San Francyclo and other sporting goods stores nationwide and online at Amazon.com and Xootr.com from November 2016 through January 2017 for about \$270.

Manufacturer(s):

Xootr of Old Forge, Pa.

Manufactured In:

U.S.

Recall number:

17-127



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Teavana Recalls Flip Tumblers Due to Burn Hazard



Recall Summary

Name of product:

Teavana Flip Tumblers

Hazard:

The flip tumblers can leak hot liquid, posing a burn hazard.

Remedy:

Refund

Recall date:

April 11, 2017

Units:

About 23,600 (in addition, 1,600 were sold in Canada)

Consumer Contact:

Teavana toll-free at 877-832-8262 from 5:30 a.m. to 5 p.m. PT Monday through Friday and 7 a.m. to 3 p.m. PT on Saturday or online at www.Teavana.com and click on "Recall Information" at the bottom of the page and then select "Teavana Flip Tumbler" for more information.

Recall Details

In Conjunction With:

Description:

This recall involves 14 oz. Teavana flip tumblers used for steeping hot tea. The recalled tumblers have a clear plastic cap with a welded black base that screws onto a stainless steel tumbler. The tumblers were sold in black and silver and measure about 10 inches tall by 3 inches in diameter. "Teavana®" is printed on the side of the tumbler.

Remedy:

Consumers should immediately stop using the recalled flip tumblers and return them to a Teavana store location (except for two stores, Columbia Mall, Columbia, Maryland and Dallas Fort-Worth Airport, Texas) or contact Teavana for a mailer label to get a refund in the form of \$45 Teavana store credit.

Incidents/Injuries:

Teavana has received 12 reports of the tumblers leaking, including one report of a burn injury to a consumer's abdomen.

Sold Exclusively At:

Teavana stores nationwide and online at Teavana.com from October 2016 through February 2017 for about \$40.

Importer(s):

Starbucks Corporation, dba Teavana, of Seattle, Wash.

Manufactured In:

China

Recall number:

17-128



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



Anaheim and Moen Recall Garbage Disposals Due to Impact Hazard



Recall Summary

Name of product:
Garbage disposals

Hazard:
A metal component inside the disposal can break off and come out of the disposal during use, posing an impact hazard.

Remedy:
Replace

Recall date:
April 11, 2017

Units:
About 146,000 (in addition, 2,700 were sold in Canada)

Consumer Contact:
Anaheim Manufacturing at 800-428-0797 from 8 a.m. to 5 p.m. ET
Monday through Friday or online at www.anaheimmfg.com and
click on "Product Recalls" for more information.

Recall Details
In Conjunction With:

Description:

The recall includes 3/4 and 1 HP disposer models. Related brand, model numbers and serial numbers are listed below. The disposal ratings were 1/2, 3/4, 1 HP, 1 1/2, 2 HP, 3 HP and 4 HP. Black and blue #11 have the brand name printed on them. The brand name, model number and serial number are printed on a label on the bottom of each of the disposals.

Brand	Model No.	Model No. Location	Description	Serial No. (starting with)
Darkside	6814001	Side	3/4 HP Disposer	1,5, 1M5 or 1A5
Frigidaire	FWD75DR	Bottom	3/4 HP Batch Feed Waste Disposer	1M5 or 1B in the third position
	FWD75R	Bottom	3/4 HP Waste Disposer	
	FWD100R	Bottom	1 HP Waste Disposer	
Frigidaire	FQD7530US	Side	Galaxy 3/4 HP Waste Disposer	2F or 3 in the second position
	FQD1030US	Side	Professional 1 HP Waste Disposer	
	FQD7500US	Side	Professional 3/4 HP Waste Disposer	
Gemline	GLCD300GS	Side	Elite 3/4 HP Disposer	1LS
Hamilton	58770351E	Bottom	3/4 HP Disposer	2F, AH, 31 or 3 in the second position
	58770361C	Bottom	3/4 HP Deluxe Garbage Disposer	
	58770412E	Bottom	1 HP Garbage Disposer	
KitchenAid	KR100RD	Side	1 HP Garbage Disposer	1A7 or 1B in the third position
	KR140RD	Side	3/4 HP Garbage Disposer	
Luxeit	LXP100C	Side	Final 1 HP Garbage Disposer	1M5, 1A7 or 1B in the third position
	LXP140C	Side	Final 3/4 HP Garbage Disposer	
Moen	OX150	Bottom	OX Series 3/4 HP Garbage Disposal	1M5 or 1B in the third position
	OX100	Bottom	OX Series 1 HP Garbage Disposal	
	OX1000	Bottom	OX Series Luxe 1 HP Garbage Disposal	
Overtop	533W019C	Side	1 HP Garbage Disposal	1LS
Waste King	996	Bottom	Legend Series 1 HP 3 Bolt Mount Garbage Disposer	1LS, 1M2, 1A7 or 1B in the third position
	9907C	Bottom	Legend Series 1 HP Batch Feed 3 Bolt Mount Garbage Disposer	
	L800	Bottom	Legend Series 1 HP EZ Mount Garbage Disposer	
	L4000C	Bottom	Legend Series 1 HP Batch Feed EZ Mount Garbage Disposer	
	935	Bottom	Legend Series 3/4 HP 3 Bolt Mount Garbage Disposer	
	9300C	Bottom	Legend Series 3/4 HP Batch Feed 3 Bolt Mount Garbage Disposer	
	L3300	Bottom	Legend Series 3/4 HP EZ Mount Garbage Disposer	
	L4000C	Bottom	Legend Series 3/4 HP Batch Feed EZ Mount Garbage Disposer	
	A10PC	Bottom	Knight Series 1 HP Garbage Disposer	
	RM43L 304T	Bottom	Plan 3/4 HP 3 Bolt Mount Garbage Disposer	
RM45L 304T	Bottom	Plan 1 HP 3 Bolt Mount Garbage Disposer		
FCL 300	Bottom	Legend Series 3/4 HP EZ Mount Garbage Disposer		
FCL 800	Bottom	Legend Series 1 HP EZ Mount Garbage Disposer		

Remedy:

Consumers should immediately stop using the recalled garbage disposals and contact Anshen Manufacturing to arrange for a free replacement disposal to be installed at no cost to the consumer.

Incidents/Injuries:

The firm has received 22 reports of a metal component coming out of a disposal, including three reports of a broken component hitting consumers. No injuries have been reported.

Sold At:

Best Buy, HD Supply, Menards, and plumbing supply stores nationwide and online at Amazon.com, Costco.com, HomeDepot.com, Walmart.com and other websites from December 2015 through March 2017 for between \$80 and \$170 for 1/2 horsepower models and \$100 and \$450 for 1 horsepower models.

Importer(s):

Anshen Manufacturing Co. and Moen, Inc. of Illinois (United States)

Manufactured In:

China

Recall number:

18-129





United States
CONSUMER PRODUCT SAFETY COMMISSION

Customatic Beds Recalls Adjustable Beds Due to Electric Shock Hazard



Recall Summary

Name of product:
Adjustable beds

Hazard:
The bed's side-mounted AC outlets can be incorrectly wired, posing an electric shock hazard to consumers.

Remedy:
Repair

Recall date:
April 12, 2017

Units:
About 50,000

Consumer Contact

Customatic Beds toll-free at 844-815-9023 from 9 a.m. through 9 p.m. ET Monday through Saturday or online at www.customaticbeds.com and click on Recall Notice for more information.

Recall Details

Description:

This recall involves the bases of Customatic adjustable beds. These power foundations were offered in all bed sizes and were sold with handheld remote controls, allowing the head and/or the foot of the bed mattress to be moved up and down. These bases also have a side mounted AC outlet. The model numbers can be found on the metal frame near the foot of the bed and are listed below.

Model Numbers

RI-AB52-A18-WWM-L-U-H-CCBH4-AC
RI-AB52-A18-WWM-L-U-H-CCBH2-AC
RI-ABF-A18-WWM-N6SL-106-L-U-AC-H-CC4B
RI-ABF-A18-WWM-ESF-107-L-U-AC-LM-CC4B
RI-ABC-A18-WWM-N8SL-107-L-U-AC-LM-CC4B
RI-ABC-A18-WWM-N8SL-107-L-U-AC-LM-CC2B
Reflexion 7
CM-ABDS-A18-WWM-U-S-AC-PLBS-DR-LM
PB-ABL-A18-WWM-DR-AC
CM-ABD-A18-WWM-AC
CM-ABF-A18-WWM-U-AC-W8-SR
CM-ABT-A18-WWM-U-AC-SR
CM-ABF-A18-WWM-U-AC-W-SR-H
F04-00004

Remedy:

Consumers should immediately stop using the AC plug on the side of the bed and contact Customatic Beds to arrange for a free inspection and repair.

Incidents/Injuries:

None reported.

Sold At:

Sleepy's and other mattress stores nationwide from June 2012 through January 2017 for about \$1,500.

Manufacturer(s):

PPJ, LLC, d b a Customatic Beds of Natick, Mass.

Importer(s):

PPJ, LLC d b a Customatic Beds of Natick, Mass.

Distributor(s):

PPJ, LLC d b a Customatic Beds of Natick, Mass.

Manufactured In:

Taiwan

Recall number:

17-130



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



Target Recalls Water Absorbing Toys Due to Serious Ingestion Hazard



Recall Summary

Name of product:

Water-absorbing Easter and Dino toys

Hazard:

If the small toy is ingested, it can expand inside a child's body and cause intestinal obstructions, resulting in severe discomfort, vomiting, dehydration and could be life threatening. Surgery is required to remove the toy from the body, if ingested. Medical professionals and parents should be aware that there is a possibility that the toys might not show up on an x-ray.

Remedy:

Refund

Recall date:

April 13, 2017

Units:

About 560,000

Consumer Contact:

Target at 800- 440-0680 between 7 a.m. to 8 p.m. CT Monday through Sunday, online at www.target.com and click on "Recalls" at the bottom of the page, then on "School/Stationery/Seasonal" for more information, or the "Product Recalls" tab on Target's Facebook page.

Recall Details

Description:

This recall involves Hatch & Grow Easter Eggs, Easter Grow Toys and Hatch Your Own Dino. Hatch & Grow Easter Eggs and Easter Grow Toys have model number 234-25-1200 on the back of the product's packaging. Hatch Your Own Dino Egg has model number 234-09-0016 on the label inserted in the product's packaging. The pink, blue, or purple Hatch & Grow Easter Eggs include a white bunny, brown bunny, or butterfly. The Easter Grow Toys include a yellow chick, brown bunny, or white bunny. The Hatch Your Own Dino Eggs are purple or yellow/green and contains one of eleven dinosaurs.

Remedy:

Consumers should immediately take this recalled toy away from children and return it to any Target store for a full refund.

Incidents/Injuries:

None reported.

Sold At:

Target stores nationwide from February 2017 through March 2017 for about \$1.

Importer(s):

Target Corp., of Minneapolis, Minn.

Manufactured In:

China

Recall number:

17-133



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Bosch Solar Services Recalls Solar Panels Due To Fire Hazard



Recall Summary

Name of product:

Roof-mounted Bosch solar panels

Hazard:

The solar panels can overheat, posing a risk of fire.

Remedy:

Replace

Recall date:

April 13, 2017

Units:

About 28,000

Consumer Contact:

**Bosch toll-free at 855-866-8470 from 7 a.m. to 7 p.m.
CT Monday through Friday, or email
boschsolar@us.bosch or online at www.bosch-solarenergy.com and click on "Recall Notice" at the
bottom of the page for more information and to
register for free replacement.**

Recall Details

Description:

This recall involves Roof-Mounted Bosch Photovoltaic Solar Modules with model number c-Si M 60 NA30119. Bosch solar modules are photovoltaic solar panels used to generate electricity. Each module measures approximately 65 inches by 39 inches by 1.65 inches, and weighs just less than 42 pounds. The solar cells are housed in a glass-foil laminate framed by an anodized aluminum profile. The output power of the panel is 245 watt peak.

Remedy:

Consumers should contact their installer to determine if their solar panels are the model being recalled. If it is, customers should contact Bosch to arrange for free replacement.

Incidents/Injuries:

None reported

Sold At:

Commercial installers nationwide from October 2011 through May 2013 for about \$300 per panel.

Distributor(s):

Bosch Solar Energy Corporation, San Mateo, Calif.

Manufactured In:

Korea

Recall number:

17-131



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



Polaris Recalls Ranger 900 Recreational Off-Highway Vehicles Due to Fire and Burn Hazards



Recall Summary

Name of product:

Polaris Ranger 900 recreational off-highway vehicles (ROVs)

Hazard:

A heat shield can fall off the vehicle posing fire and burn hazards to riders.

Remedy:

Repair

Recall date:

April 13, 2017

Units:

About 51,000

Consumer Contact:

Polaris at 800-765-2747 from 7 a.m. to 7 p.m. CT Monday and Friday, or online at www.polaris.com and click on "Off Road Safety Recalls" at the bottom of the page for more information.

Recall Details

Description:

This recall involves all model year 2015 Polaris Ranger XP 900, XP 900 EPS, and CREW 900 recreational off-highway vehicles (ROVs). The recalled ROVs were sold in a variety of colors and have either three or six seats and a rear box "Ranger" is printed on the rear box and "900" is printed on the hood of the ROVs. All 2015 Ranger 900 models and vehicle identification numbers (VINs) are included in this recall. The VIN is printed on the frame on the driver's side towards the rear of the vehicle. To check for recalled vehicles by VIN, visit www.polaris.com.

Model Year	Model Number	Model
2015	R15RTA87AA	RANGER 900 XP SAGE GREEN
2015	R15RTA87AR	RANGER 900 XP SOLAR RED
2015	R15RTA87AC	RANGER XP 900 POLARIS PURSUIT CAMO
2015	R15RTE87AA	RANGER XP 900 EPS SAGE GREEN
2015	R15RTE87AR	RANGER XP 900 EPS SOLAR RED
2015	R15RUA87AA	RANGER CREW 900 SAGE GREEN
2015	R15RUA87AR	RANGER CREW 900 SOLAR RED
2015	R15RUY87AA	RANGER CREW 900-6 SAGE GREEN
2015	R15RTE87AK	RANGER XP 900 EPS BLACK PEARL
2015	R15RTE87AM	RANGER XP 900 EPS SUPER STEEL GRAY
2015	R15RTE87AS	RANGER XP 900 EPS SUNSET RED
2015	R15RTE87AW	RANGER XP 900 EPS WHITE LIGHTNING
2015	R15RTE87AX	RANGER XP 900 EPS SANDSTONE METALLIC
2015	R15RTE87AZ	RANGER XP 900 EPS SUNSET RED SILVER
2015	R15RTE87AB	RANGER XP 900 EPS HUNTER EDITION
2015	R15RUE87AC	RANGER CREW 900 EPS POLARIS PURSUIT CAMO
2015	R15RUE87AM	RANGER CREW 900 EPS SUPER STEEL GRAY
2015	R15RUE87AS	RANGER CREW 900 EPS SUNSET RED
2015	R15RUE87AW	RANGER CREW 900 EPS WHITE LIGHTNING
2015	R15RUZ87AC	RANGER CREW 900-6 EPS POLARIS PURSUIT CAMO
2015	R15RUZ87AS	RANGER CREW 900-6 EPS SUNSET RED
2015	R15RUZ87AW	RANGER CREW 900-6 EPS WHITE LIGHTNING
2015	R15RTE87AV	RANGER XP 900 EPS VOGUE SILVER DELUXE
2015	R15RTE87A5	RANGER XP 900 EPS HUNTER DELUXE EDITION
2015	R15RTE87A2	RANGER XP 900 EPS NORTHSTAR DELUXE EDITION

Remedy:

Consumer should immediately stop using the recalled ROVs and contact Polaris to schedule a free repair. Polaris is contacting all known purchasers directly.

Incidents/Injuries:

Polaris has received 13 incident reports involving the recalled ROVs, including five reports of fires. No injuries have been reported.

Sold At:

Polaris dealers nationwide from April 2014 through March 2017 for between \$13,400 and \$21,300.

Manufacturer(s):

Polaris Industries Inc. of Medina, Minn.

Importer(s):

Polaris Industries Inc. of Medina, Minn.

Manufactured In:

U.S. and Mexico

Recall number:

17-132





United States
CONSUMER PRODUCT SAFETY COMMISSION

Cost Plus World Market Recalls Windsor-Style Dining Chairs Due to Fall Hazard



Recall Summary

Name of product:

Stafford Windsor-style dining chairs

Hazard:

The legs on the chairs can break, posing a fall hazard to consumers.

Remedy:

Replace

Recall date:

April 18, 2017

Units:

About 4,700

Consumer Contact:

Cost Plus toll-free at 877-967-5362 from 7 a.m. to midnight ET daily, or online at www.worldmarket.com and click on “Product Recalls” for more information.

Recall Details

Description:

This recall involves wooden Stafford Windsor-style dining chairs with four legs. The chairs have a walnut finish and are intended for indoor use. Purchase order number 200519526, 400519526, 200519525, 400519525, 200524057, 200536057, 200536058 or 400524058 is printed on the UPC label attached to the underside of the chair seat.

Remedy:

Consumers should immediately stop using the recalled chairs and return them to any Cost Plus World Market or World Market store for a free replacement chair.

Incidents/Injuries:

The firm has received three reports of in-store display chair legs breaking and one report of the chair leg bowing out. No injuries have been reported.

Sold Exclusively At:

Cost Plus World Market and World Market stores nationwide and online at www.worldmarket.com from June 2016 through December 2016 for about \$100.

Distributor(s):

Cost Plus Management Services Inc., of Alameda, Calif.

Manufactured In:

Malaysia

Recall number:

17-135



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Food Dehydrators Recalled by Greenfield World Trade Due to Fire and Burn Hazards



Recall Summary

Name of product:
EZDRY Food Dehydrators

Hazard:
The food dehydrator can overheat, posing fire and burn hazards.

Remedy:
Refund
Replace

Recall date:
April 20, 2017

Units:
About 14,000

Consumer Contact:
Greenfield toll-free at 877-881-0065 from 12 p.m. to 7 p.m. ET Monday through Friday, email at productrecall@thelegacycompanies.com or online at www.greenfieldworld.com and click on the "Product Recall" link at the bottom of the page for more information.

Recall Details

Description:

This recall involves white, EZDRY, six-tray food dehydrators. The dehydrator weighs about 4 pounds and measures 12 inches tall by about 8 inches deep by 10 inches wide. EZDRY is printed on the front of the dehydrators. EZDRY and the model number EPD60W are printed on a white label on the bottom of the unit. They were sold in a white box labeled "EZDRY by Excalibur" Home Dehydrator with a picture of the product. These products are marked "Date Code: 2116, 2416, or 3316" engraved at the bottom of the label located on the bottom of the unit.

Remedy:

Consumers should immediately stop using the recalled food dehydrators and contact Greenfield for instructions on returning the recalled food dehydrators with a prepaid shipping label for a free replacement or full refund.

Incidents/Injuries:

The firm has received 13 reports of the dehydrator overheating and the plastic unit melting, including six reports of fire and one report resulting in property damage to the counter top. No injuries have been reported.

Sold At:

Kohl's stores nationwide and online at Amazon.com from June 2016 through February 2017 for between \$40 and \$50.

Importer(s):

Greenfield World Trade Inc., of Fort Lauderdale, Fla.

Manufactured In:

China

Recall number:

17-136




This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Razor Recalls RipStik Motorized Caster Boards Due to Fall Hazard

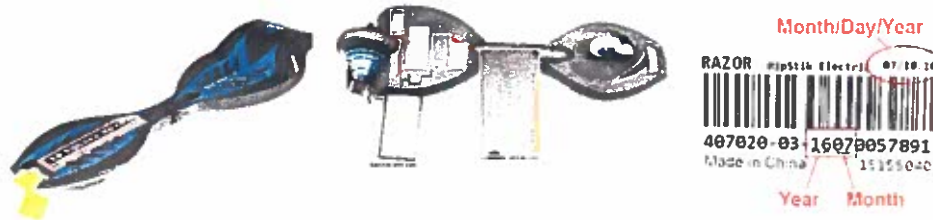

Recall Summary

Name of product:

RipStik electric motorized caster boards

Hazard:

The rear wheel can stop rotating and lock up while in use, posing a fall hazard.

Remedy:

Repair

Recall date:

April 20, 2017

Units:

About 158,000

Consumer Contact:

**Razor toll-free at 866-467-2967 from 8 a.m. to 5 p.m. PT
Monday through Friday or online at www.Razor.com
and click on "Recall Information" for more information.**

Recall Details

Description:

This recall involves Razor RipStik electric motorized caster boards. The boards have two wheels, a hub motor and a lithium ion battery. They have a wireless digital hand remote that controls the speed up to 10 mph. The manufacturing date is on the bar code label located on the bottom of the product and Razor USA LLC is embossed on the bottom. "RipStik" is printed on the top of the board. They are blue and black in color.

Remedy:

Consumers should immediately stop using the recalled caster boards and contact Razor to receive a free repair kit.

Incidents/Injuries:

Razor has received more than 700 reports of the rear wheel locking up, resulting in four injuries, including one loose tooth and three scrapes and bruises.

Sold At:

Target, Toys R Us, Walmart, and other stores nationwide and online at Amazon.com, Razor.com, Target.com, toysrus.com and Walmart.com and other websites from February 2016 through April 2017 for about \$180.

Importer(s):

Razor USA LLC, of Cerritos, Calif.

Manufactured In:

China

Recall number:

17-137




This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Horizon Hobby Recalls Remote-Controlled Model Vehicles Due to Fire Hazard

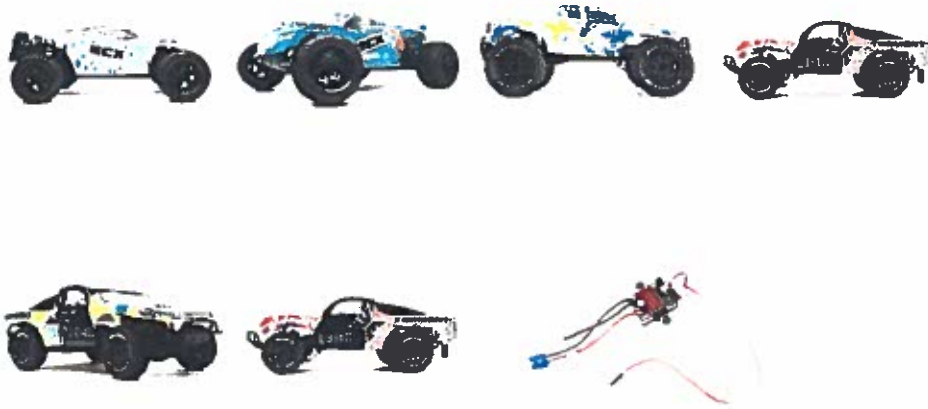

Recall Summary

Name of product:

ECX Circuit, Ruckus, and Torment remote-controlled model vehicles

Hazard:

The vehicle's electronic speed control (ESC) can fail and short circuit, posing a fire hazard.

Remedy:

Replace

Recall date:

April 25, 2017

Units:

About 18,600 (In addition, 540 were sold in Canada)

Consumer Contact:

**Horizon Hobby at 800-338-4639 from 8 a.m. to 7 p.m.
CT Monday through Friday, 8 a.m. to 5 P.M. CT on
Saturday, and 12 p.m. to 5 p.m. CT on Sunday or
online at www.horizonhobby.com and click on Product
Recalls at the bottom of the page for more information.**

Recall Details

In Conjunction With:

Description:

The recall involves the Dynamite 40-Amp FWD REV Brushed ESC – DYNS2201. It is the Electronic Speed Control (ESC) that comes in the remote controlled hobby model vehicles ECX 1/10 LiPo Circuit, Ruckus and Torment models with the following models numbers: ECX03130T1, ECX03130T2, ECX03131T1, ECX03131T2, ECX03133T1, ECX03133T2, ECX03154. The model numbers can be found on the product box or in the owner's manual for each vehicle. The model vehicles measure about 18 inches in length and 12 inches in width and are hobby grade remote control models for ages 14 and up.

Remedy:

Consumers should immediately stop using the recalled product and contact Horizon Hobby for instructions on receiving a free replacement ESC.

Incidents/Injuries:

Horizon Hobby has received 19 reports of the ESC in the model truck and cars catching fire. No injuries or property damage has been reported.

Sold At:

Horizon Hobby stores nationwide and online at www.horizonhobby.com from October 2016 through December 2016 for about \$180.

Importer(s):

Horizon Hobby LLC, of Champaign, Ill.

Manufactured In:

China

Recall number:

17-139



This recall was conducted, voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Zutano Recalls Infant Booties Due to Choking Hazard



Recall Summary

Name of product:
Infant Cozie booties

Hazard:
The non-slip rubber grips on the bottom of the booties can detach, posing a choking hazard.

Remedy:
Refund

Recall date:
April 25, 2017

Units:
About 38,000

Consumer Contact:
Zutano Global toll-free at 866-314-8688 from 9 a.m. to 5 p.m. ET Monday through Friday, email at recall@zutano.com or online at www.zutano.com and click on "Product Recall" at the bottom of the page or go directly to www.zrecall.com for more information.

Recall Details

Description:

This recall involves infant fleece gripper Cozie booties. They are 70 percent cotton and 30 percent polyester. The booties have rubber grippers in the shape of a "Z" on the bottom. These booties were sold in sizes 12 - 18 months in 13 solid colors: chocolate, gray, heather gray, hot pink, pool (aqua), apple (light green), cream, fuchsia, lime, mandarin, navy, pagoda (turquoise blue) and periwinkle and in multi-colors. Only booties with the following tracking labels sewn under the care label are included in this recall.

Tracking numbers:

FALL161-03/16

FALL166-03/16

FALL166-06/16

FALL167-06/16

FALL168-07/16

FALL169-07/16

FALL1610-08/16

FALL1611-09/16

FALL1612-07/16

Remedy:

Consumers should immediately stop using the recalled booties, take them away from children and contact the firm for a full refund in the form of a merchandise credit.

Incidents/Injuries:

The firm has received two reports of the detached rubber "Z" grips found in infant's mouths.

Sold At:

G Willikers (Portsmouth, N.H.), Kid Dynamo (Berkeley, Calif.), Magic Beans (Hyde Park, Mass.), Magpie Kids (Somerville, Mass.), Pacifier (Minneapolis, Minn.), The Animal Kingdom (State College, Penn.), The Pump Station (Santa Monica, Calif.), Tip Toes (Holland, Mich.), and other stores nationwide and online at www.amazon.com and www.zutano.com from May 2016 through March 2017 for between \$22 and \$24.

Importer(s):

Zutano Global Inc., of New Bedford, Mass.

Manufactured In:

China

Recall number:

17-138



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Women's Sweaters Recalled by FatFace Due to Violation of Federal Flammability Standard



Recall Summary

Name of product:

Women's overhead and zip-up sweaters

Hazard:

The recalled women's sweaters fail to meet federal flammability standards for clothing textiles, posing a risk of burn injuries.

Remedy:

Refund

Recall date:

April 26, 2017

Units:

About 400

Consumer Contact:

FatFace at 800-585-0178 from 4 a.m. to 12:30 p.m. ET Monday through Friday, 5 a.m. to 1 p.m. ET Saturday and 6 a.m. to 12 p.m. ET on Sunday, email at usproductqueries@fatface.com with "Product Recall" as the email subject or online at <http://us.fatface.com> and click on the "Important Notice" tab for more information.



Recall Details

Description:

This recall involves two styles of FatFace women's sweaters: overhead Cowes (style number 918043) and zip-up (style number 918044). The style numbers are printed on a care label on the inside seam of the sweaters.

The Overhead Cowes sweater is 97 percent cotton and 3 percent polyester sold in ivory. This sweater has a 3.5 inch cowl or funnel neckline that can be tightened or loosened by the drawstring located at the center front of the neckline. These sweaters also have a kangaroo-style pocket located at the bottom front of the sweater.

The zip-up sweater is 97 percent cotton and 3 percent polyester with a Yarmouth textured zip-up sweater. It sold in ivory, ocean surf (green) and lilac ice (lavender) colors. The sweater has a hood that can be tightened and loosened with a drawstring. The sweater has a silver metal zipper extending from the neckline to the bottom of the sweaters with two pockets on each side of the zipper.

Remedy:

Consumers should immediately stop using the recalled sweaters and contact the firm for instructions on returning the sweaters for a \$75 refund.

Incidents/Injuries:

The firm has received one report of a burn injury.

Sold Exclusively At:

FatFace stores in Maine, Massachusetts and Rhode Island and online at www.fatface.com from September 2016 through January 2017 for about \$60.

Importer(s):

FatFace Corp., of Wilmington, Del.

Manufactured In:

China

Recall number:

17-141



United States
CONSUMER PRODUCT SAFETY COMMISSION

Chromag Bicycle Stems Recalled by Riser Holdings Due to Fall and Injury Hazards



Recall Summary

Name of product:
Chromag bicycle stems

Hazard:
The clamping bolts that secure the stem to the fork steerer and/or the handlebars can break, posing fall and injury hazards to riders.

Remedy:
Replace

Recall date:
April 26, 2017

Units:
About 100

Consumer Contact:
**Chromag Bikes at 800-380-4102 from 9 a.m. to 5 p.m.
PT Monday through Thursday, email
info@chromagbikes.com or online at
www.chromagbikes.com and click on Stem Bolt Recall
at the top of the page for more information.**

Recall Details

In Conjunction With:

Description:

This recall involves Chromag bicycle stems used to clamp the fork steerer and/or handlebars. The recalled stems include models BZA, Director, HiFi and Ranger. Only stems with a "Z" marked inside the bolt head are included in this recall. "Chromag" and the model name are printed on the stems. The stems were sold separately from bicycles. Bolts used in the stems are 6 mm in diameter and 20 mm in length. The stems were sold in various colors including black, red, blue, gold, purple and silver.

Remedy:

Consumers should immediately stop using bicycles with the recalled stems and contact Chromag for free replacement bolts for the stem.

Incidents/Injuries:

The firm has received three reports of the clamping bolts breaking. No injuries have been reported.

Sold At:

Arts Cyclery, Beachwood Cycles, Beat Cycles, Breadwinner Cycles, Blazin Saddles, Harpers, Quality Bicycle Products, The Bike Hub and Squatch Cycles nationwide or online at www.chromagbikes.com from November 2016 through March 2017 for about \$120 for the stem.

Importer(s):

Riser Holdings Ltd., of Canada, dba Chromag Bikes

Manufactured In:

Taiwan and Canada

Recall number:

17-140



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Osprey Recalls Child Backpack Carriers Due to Fall Hazard



Recall Summary

Name of product:

Poco child carriers

Hazard:

A child seated in the carrier can slip through the leg openings, posing a fall hazard to children.

Remedy:

Repair

Recall date:

April 27, 2017

Units:

About 82,000 (in addition, about 5,732 were sold in Canada)

Consumer Contact:

Osprey toll-free at 866-951-5197 from 8 a.m. to 5 p.m.
MT Monday through Friday, email at
pocoseatpad@ospreypacks.com or online at
www.ospreypacks.com and click on "Poco Safety
Notices" on the navigation bar at the top right hand
corner of the page for more information.

Recall Details

In Conjunction With:

Description:

This recall involves all models of Poco, Poco Plus and Poco Premium child backpack carriers manufactured between January 2012 and December 2014. The nylon child carriers were sold in three colors: "Romper Red," "Koala Grey," and "Bouncing Blue." They have a metal frame and a gray padded child's seat inside. The production date is stamped on a black label sewn into the interior of the large lower zippered compartment on the back of the carrier. Recalled carriers have a production date code of S12SBPR1, S12SBPR1B, S12SBPR2, S12SBPR3, S12SBPR4, F12SBPR1, F12SBPR2, S13SB IPO, S13SBPR1, S13SBPR2, S13SBPR3, S13SBPR4, F13SBPR1, F13SBPR2, F13SBPR3, S14SBPR1, S14SBPR2, S14SBPR3, S14SBPR4, S14SBPR5. "Osprey" is printed on the fabric above the kick stand. The model name is printed on the back at the bottom.

Remedy:

Consumers should immediately stop using the recalled carriers and contact Osprey for a free Seat Pad Insert for use along with the existing safety straps to secure the child in the carrier. Consumers who previously received and installed the free Seat Pad Insert in their carriers are not required to take further action.

Incidents/Injuries:

Osprey has received four reports of children falling through the carrier leg openings, resulting in one report of a skull fracture and one report of scratches to the head.

Sold At:

REI and specialty outdoor stores nationwide and online at Amazon.com from January 2012 to December 2015 for between \$200 and \$300.

Importer(s):

Osprey Child Safety Products LLC and Osprey Packs Inc., of Cortez, Colo.

Manufactured In:

Vietnam

Recall number:

17-142



United States
CONSUMER PRODUCT SAFETY COMMISSION

HoMedics Recalls Massagers Due to Electric Shock and Burn Hazards



Recall Summary

Name of product:

HoMedics handheld massagers

Hazard:

The cord can break near the base of the massager and expose the wires, posing an electric shock and burn hazards.

Remedy:

Refund

Recall date:

May 2, 2017

Units:

About 400,000

Consumer Contact:

HoMedics toll-free at 888-803-0509 from 7 a.m. to 6 p.m. CT Monday through Friday or online at <http://www.homedics.com> and click on the Product Recall tab for more information.

Recall Details

Description:

This recall involves three models of handheld massagers, HHP-375H, HHP-250 and the PA-MH-THP. All models of the massagers have a 120 VAC, 60 HZ power cord. "HoMedics" is printed on the massagers.

The HHP-375H model Handheld Dual Node Percussion Massager with Heat is white with a gray handle or black with a gray handle. The massager has three sets of interchangeable nodes.

The HHP-250 model Handheld Hot and Cold Massager is white with a gray stripe or gray with a blue stripe. The massager has three, five or eight interchangeable nodes.

The PA-MH-THP model Handheld Compact Percussion Massager with Heat is white on the bottom of the base with gray on top. The massager has two sets of interchangeable nodes.

All manufacturing dates for all three models are included in the recall and the item date code can be found in either one of the cord prongs or in the rating label located on the underside of the product. Date codes can be identified as a 4-digit number *WWYY* where *WW* is the sequential week of the year and *YY* is the last two digits of the manufacturing year.

Remedy:

Consumers should immediately stop using the recalled massagers and contact HoMedics for instructions on removing the cord and to receive a refund in the form of a credit for any replacement product from the firm.

Incidents/Injuries:

HoMedics has received 140 reports of exposed wires, sparks, smoking and some shooting flames coming from the massagers. There have been 15 reports of burn injuries to consumer's fingers and other parts of the body.

Sold At:

Bed Bath & Beyond, Macy's, Rite-Aid, Walmart and other stores nationwide and HSN from August 2013 through February 2017 for between about \$30 and \$50.

Importer(s):

HoMedics USA LLC, of Commerce Township, Mich

Manufactured In:

China

Recall number:

17-144



This recall was conducted, voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Goodman Recalls Furnaces Due to Electrical Shock Hazard



Recall Summary

Name of product:
Gas-fired furnaces

Hazard:
The blower motor is not grounded, posing an electrical shock hazard to individuals servicing the units

Remedy:
Repair

Recall date:
May 2, 2017

Units:
About 4,100

Consumer Contact:
Goodman toll-free at 888-770-7126 from 7 a.m. to 6 p.m. CT Monday through Friday or online at www.goodmanmfg.com and click on "Product Recall" at the bottom right hand corner of the page for more information.

Recall Details

Description:

This recall involves 80% efficiency gas-fired furnaces sold under the Goodman, Amana and Daikin brand names used with home heating and cooling systems. The recalled products have model numbers beginning AMEH80, DM80HE, and GME8, and serial numbers beginning 1609, 1610, 1611 and 1612. The brand name is shown on the outside of the furnace, and the serial number is located on the label found by opening the furnace door.

Remedy:

Consumers should immediately contact Goodman for a free repair.

Incidents/Injuries:

None

Sold At:

Goodman, Amana and Daikin heating and cooling equipment dealers nationwide from September 2016 through January 2017 for between \$650 and \$1,150.

Manufacturer(s):

Goodman Manufacturing Company L P., of Houston, Texas

Manufactured In:

U S.

Recall number:

17-145



Combi USA Recalls Stroller and Car Seat Combos Due to Fall Hazard



Recall Summary

Name of product:

Combi Shuttle Travel System (stroller and car seat combos)

Hazard:

The car seat can disengage from the stroller's frame, posing a fall hazard to infants.

Remedy:

Repair

Recall date:

May 4, 2017

Units:

About 1,000

Consumer Contact:

Combi USA toll-free at 844-332-6730 from 8:30 a.m. to 4:30 p.m. ET Monday through Friday or online at www.combiusa.com and click on "Safety Notifications" at the bottom of the page for more information. Combi USA will contact consumers who registered their products.

Recall Details

Description:

This recall involves Combi Shuttle model strollers and car seats, which when used together are called a travel system. The strollers and car seats have model number 6100027 or 6100100 printed on a label on the base of the car seat and stroller's leg. The car seat and stroller were sold in titanium (silver) and red chili (red) colors. Combi is printed on the front of the stroller and the car seat. Shuttle is printed above the model number.

Remedy:

Consumers should stop using the recalled strollers with the car seats attached and contact Combi for a free repair, which consists of straps to secure the car seat to the stroller. Consumers can continue to use the strollers and car seats separately.

Incidents/Injuries:

None reported

Sold At:

Online at Amazon.com, Babies R Us.com, Target.com and other online retailers from June 2015 through September 2016 for between \$350 and \$400 for the stroller and the car seat when sold together.

Importer(s):

Combi USA, Charlotte, N.C.

Manufactured In:

China

Recall number:

17-146



United States
CONSUMER PRODUCT SAFETY COMMISSION

Profile Design Recalls Bicycle Handlebar Stems Due to Loss of Control and Crash Hazard



Recall Summary

Name of product:

Cobra S handlebar stems

Hazard:

The bicycle handlebar stems can corrode and break, causing the rider to lose control and crash.

Remedy:

Replace

Recall date:

May 9, 2017

Units:

About 9,700 in the U.S. (135 were sold in Canada)

Consumer Contact:

Profile Design toll-free at 888-800-5999 from 9 a.m. to 5 p.m. PT Monday through Friday or online at www.profile-design.com and click on "Recall Notices" for more information.

Recall Details

In Conjunction With:

Description:

This recall involves Profile Design Cobra S carbon-wrapped black handlebar stems sold individually and as original equipment on the following Kestrel, Fuji, Jamis and Scott bicycle models: 2009 Kestrel Talon SL Tri Ultegra, 2009 Kestrel Evoke SL, 2009 Kestrel Airfoil Pro SL, 2009 Kestrel Talon SL, 2010 Kestrel Talon SL Tri-Ultegra, 2010 Kestrel Talon Tri-Force, 2010 Kestrel Airfoil Pro SL / Airfoil Pro SL (650c), 2010 Kestrel Talon Road SL, 2010 Kestrel 4000 SL, Fuji 2009 D-6 Pro, Fuji 2010 D-6 Pro, Fuji 2010 D-6 Matt Reed, Jamis 2010 Xenith T2, Scott 2008 CR1 Plasma LTD (model# 209562), Scott 2009 Plasma Premium (model # 212052) and Scott 2010 Plasma Premium (model # 215722). The stems were sold in seven lengths or sizes including 60 mm, 70 mm, 80 mm, 90 mm, 100 mm, 110 mm and 120 mm. "Profile Design" and "Cobra S" are printed in white on the black handlebar stems. Only black stems are included in this recall.

Remedy:

Consumers should immediately stop using bicycles with the recalled handlebar stems and contact Profile Design for instructions to receive a free replacement stem.

Incidents/Injuries:

The firm has received at least 10 reports of the bicycle handlebar stems corroding and breaking, including one report of an injury to a rider when the bicycle stem broke causing the rider to lose control.

Sold At:

Independent bicycle stores nationwide from January 2007 through December 2013 for about \$200 for the stem sold individually and between \$2,000 and \$6,000 for bicycles sold with the stems as original equipment.

Importer(s):

Profile Design LLC, of Carson, Calif.

Distributor(s):

Profile Design LLC, of Carson, Calif.

Manufactured In:

Taiwan

Recall number:

17-147




This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Night Lights Recalled by AM Conservation Group Due to Fire Hazard

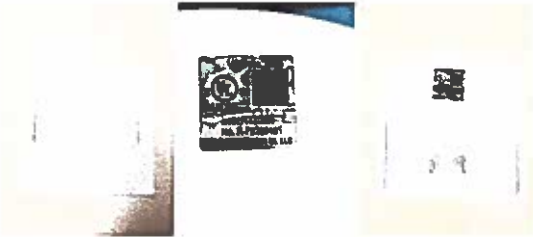

Recall Summary

Name of product:

Luminescent night lights

Hazard:

The night lights can overheat, posing a fire hazard.

Remedy:

Replace

Recall date:

May 10, 2017

Units:

About 37,000

Consumer Contact:

AM Conservation Group toll free at 866 878-1060 from 8 a.m. to 5 p.m. CT Monday through Friday or visit www.amconservationgroup.com and click on "Product Recall" for more information.

Recall Details

Description:

This recall involves luminescent night lights Model 2017-G, a square-shaped night light with a rounded top. The night light glows green when plugged into an electrical outlet. The back of the night light has a metallic sticker with the "UL" logo on it. If the UL label has a number on it beginning with the letter H or I followed by eight numbers, it is included in this recall. The night lights were given free to consumers, individually and in energy conservation kits.

Remedy:

Consumers should immediately stop using the recalled night lights and contact the firm for a free replacement.

Incidents/Injuries:

The firm is aware of 14 incidents of the night lights smoking or smoldering. No injuries have been reported.

Sold At:

The recalled night lights were distributed as free promotional products by various companies between November 2016 and March 2017.

Importer(s):

AM Conservation Group Inc. of Charleston, S.C.

Distributor(s):

AM Conservation Group Inc. of Charleston, S.C.

Manufactured In:

China

Recall number:

17-148



United States
CONSUMER PRODUCT SAFETY COMMISSION

Carrier and Bryant Recall Heat Pumps Due to Fire Hazard



Recall Summary

Name of product:

Carrier Greenspeed™ and Bryant Evolution Extreme™ Heat Pumps

Hazard:

The capacitors in the fuse boards in the heat pumps can stop working causing the unit to overheat, posing a fire hazard.

Remedy:

Repair

Recall date:

May 11, 2017

Units:

About 23,300 (In addition about 2,000 sold in Canada)

Consumer Contact:

Carrier toll-free at 844-864-8233 from 8 a.m. to 5 p.m. ET Monday through Friday, or online at www.carrier.com or www.bryant.com and click on “Product Safety Recall” for more information.

Recall Details

In Conjunction With:

Description:

This recall involves 2, 3, 4, and 5 ton size heat pump units sold under the Carrier Greenspeed and Bryant Evolution Extreme brand names. The units are used for cooling and heating homes. The Carrier Greenspeed model numbers are: 25VNA024, 25VNA036, 25VNA048, and 25VNA060. The Bryant Evolution Extreme model numbers are: 280ANV024, 280ANV036, 280ANV048, and 280ANV060. The model number can be found on the unit nameplate (or rating plate) located on one side of the unit's exterior. On the Bryant unit, there is a label on top of the unit that reads "Bryant Evolution System."

Remedy:

Consumers should contact Carrier or Bryant for instructions on receiving a free replacement fuse board installed by authorized Carrier or Bryant technicians.

Incidents/Injuries:

Carrier has received 41 reports of the heat pumps overheating. No injuries, fires or property damage have been reported.

Sold At:

Sears stores and HVAC dealers nationwide from June 2011 through August 2016 for between \$12,000 and \$18,000.

Manufacturer(s):

Carrier Corporation, of Jupiter, Fla.

Manufactured In:

U.S.

Recall number:

17-150



United States
CONSUMER PRODUCT SAFETY COMMISSION

Nature's Truth Recalls Iron Supplement Bottles Due to Failure to Meet Child-Resistant Closure Requirement



Recall Summary

Name of product:

Nature's Truth Slow Release Iron Supplements

Hazard:

The packaging is not child-resistant as required by the Poison Prevention Packaging Act. The tablets inside the bottle contain iron, which can cause serious injury or death to young children if multiple tablets are ingested at once.

Remedy:

Refund

Replace

Recall date:

May 11, 2017

Units:

About 520

Consumer Contact:

Nature's Truth toll-free at 844-544-1030 from 8 a.m. to midnight ET Monday through Saturday and 9 a.m. to 6 p.m. ET Sunday, by e-mail at customerservice@naturestruthproducts.com, or visit the firm's website at www.naturestruthproducts.com for more information.

Recall Details

Description:

This recall involves Nature's Truth Slow Release 45mg Iron Supplement bottles. The 60 count, coated tablets were sold in a green bottle with a green flip top cap. "Nature's Truth," "SLOW RELEASE IRON" and "45 mg" are printed on a yellow label on the bottle. Lot number 29672 and the January 2019 [EXP 01/2019] expiration date are printed on the right side of the bottle.

Remedy:

Consumers should immediately place recalled bottles out of the reach of children and return them to the place of purchase for a full refund or a replacement bottle.

Incidents/Injuries:

None reported

Sold At:

Quick Chek stores in New Jersey and independent pharmacies nationwide from February 2017 to March 2017 for about \$6.

Importer(s):

Nature's Truth LLC, of Ronkonkoma, N.Y.

Distributor(s):

Nature's Truth LLC, of Ronkonkoma, N.Y.

Manufactured In:

United States

Recall number:

17-149



United States
CONSUMER PRODUCT SAFETY COMMISSION

Honeywell International Recalls SWIFT® Wireless Gateway Sold with Fire Alarm Systems Due To Failure to Communicate in Fire



Recall Summary

Name of product:

SWIFT wireless gateway sold with fire alarm systems

Hazard:

The smoke detectors connected to the gateway can fail to activate properly when significant environmental contaminants are present, posing a risk that consumers will not be alerted to a fire.

Remedy:

Repair

Recall date:

May 12, 2017

Units:

About 900

Consumer Contact:

Contact Honeywell at 800-289-3473 from 8 a.m. to 5 p.m. ET Monday through Friday or online at <http://hwll.co/CPSCsafety> and click on Safety Recall for more information.

Recall Details

Description:

This recall involves the SWIFT wireless gateway sold with fire alarm systems. The gateways are round, white and measure eight inches in diameter. The gateways are the bridge between the fire alarm control panel and the detectors. These systems are used primarily for indoor or covered areas in commercial buildings, such as in office buildings, hotels, industrial facilities, and apartment complexes. The model number and date codes are printed on the back of the gateway on a white label on the circuit board. The gateways have the following brand names, model numbers and date codes.

Brand	Model	Date Code Range
NOTIFIER	FWSG	
Fire-Lite	W-GATE	10 13 14 through 12 15 16
Gamewell-FCI	VW-GATE	
Honeywell	XLS-WSG	
Johnson Controls	JFWSG	

Remedy:

Contact Honeywell for an update of the firmware on the SWIFT wireless gateway(s) installed on the system. Commercial building customers should continue using the recalled detectors until the firmware is updated.

Incidents/Injuries:

None reported

Sold At:

Honeywell distributors nationwide between October 2014 and December 2016 for about \$440 for the fire alarm system.

Manufacturer(s):

Honeywell International Inc., of Northford, Conn.

Manufactured In:

United States

Recall number:

17-151



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



VanMoof Recalls Bicycles Due to Fall and Impact Hazards



Recall Summary

Name of product:
VanMoof B and S series bicycles

Hazard:
The front fender bolts do not break when an object gets stuck between the front tire and the front fender/mud guard posing fall and impact hazards

Remedy:
Repair

Recall date:
May 15, 2017

Units:
375

Consumer Contact:
VanMoof toll-free at 866-623-6673 from 9 a.m. to 7 p.m. ET Monday through Friday, email fenderbolt@vanmoof.com, or online at www.vanmoof.com or support.vanmoof.com on the top-right of the homepage of the website next to the language menu.

M15E000731	M15E000769	M15E000807
M15E000833	M15E000770	M15E000808
M15E000833	M15E000771	M15E000819
M15E000834	M15E000772	M15E000813
M15E000735	M15E000773	M16G000321
M15E000736	M15E000774	M16G000322
M15E000737	M15E000775	M16G000323
M15E000738	M15E000776	M16G000324
M15E000739	M15E000777	M16G000325
M15E000740	M15E000778	M16G000326
M15E000741	M15E000779	M16G000327
M15E000742	M15E000780	M16G000328
M15E000743	M15E000781	M16G000329
M15E000744	M15E000782	M16G000330
M15E000745	M15E000783	M16G000331
M15E000746	M15E000784	M16G000332
M15E000747	M15E000785	M16G000333
M15E000748	M15E000786	M16G000334
M15E000749	M15E000787	M16G000335
M15E000750	M15E000788	M16G000336
M15E000751	M15E000789	M16G000337
M15E000752	M15E000790	M16G000338
M15E000753	M15E000791	M16G000339
M15E000754	M15E000792	M16G000340

Remedy:

Consumers who wish immediately stop using the recalled bicycles and contact Yard of Life for a free replacement nylon bolts for the front fender and chain stay on that model.

The recall can be completed by the consumer without assistance.

Incidental injuries:

The firm has received two reports of injuries which occurred when the recalled bicycle created an obstruction between the bike fender and the front wheel. In both instances, the fender remained intact, because the stamped steel fender bolts did not break off. One instance resulted in a laceration to the hand and a broken arm in the second instance, the fender, fender bolts and chain stay.

Sold At:

AAA Trading Company, Inc. Orange Peel, The Garage CTR, Seattle Bike and coffee cycle stores nationwide and on line from January 2014 through December 2016 for about \$800.

Importer(s):

Yard of Life LLC, 100 East Broadway, NY

Distributor(s):

USA Bike Partners, LLC, New York

Manufactured in:

Taiwan

Recall number:

17-152



United States
CONSUMER PRODUCT SAFETY COMMISSION

Bradshaw International Recalls Coffee Presses Due to Laceration Hazard



Recall Summary

Name of product:
Coffee presses

Hazard:
The glass beakers can break during normal use, posing a laceration hazard to users.

Remedy:
Replace

Recall date:
May 16, 2017

Units:
About 85,000 (in addition, 300 were sold in Canada)

Consumer Contact:

Bradshaw International toll-free at 877-614-9571 from 8 a.m. to 5 p.m. PT Monday through Friday or online at www.bradshawintl.com and click on "Recalls" for more information.

Recall Details

In Conjunction With:

Description:

This recall involves Bialetti coffee presses with a glass beaker in a plastic frame with a stainless steel metal plunger. The coffee presses were sold in blue, green, black and red and hold eight cups of water. The plunger is stainless steel metal and mesh with a polypropylene lid and handle in matching color to the frame. The coffee press exterior measures 6.5 inches by 9.5 inches and the interior of the glass beaker measures 7 inches by 3.75 inches. The polypropylene lid has 14 vents in the bottom of the rim to strain fluids, while pouring. The Bialetti icon and logo are printed on each side of the frame and "Bialetti" is printed on the top of the plunger. The date stamp of March 2017 or earlier is printed on the underside of the plunger in a dial date code. (Dial date codes are read from the center of the circle outward. The two numbers in the center of the circle represent the year of production. The arrow in the circle points to the month of production on the outer circle.)

Remedy:

Consumers should immediately stop using the recalled coffee presses and contact Bradshaw International for a free replacement coffee press.

Incidents/Injuries:

The firm has received three reports of the glass beakers breaking and cutting fingers, resulting in two consumers needing stitches.

Sold At:

Fred Meyer, Kroger, Ross, Target, HomeGoods and other specialty and grocery stores nationwide and online at Amazon.com from July 2016 through March 2017 for between \$15 and \$20.

Importer(s):

Bradshaw International Inc., of Rancho Cucamonga, Calif.

Manufactured In:

China

Recall number:

17-153




This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Cabrinha Recalls Kiteboard Control Systems Due to Injury and Fall Hazards

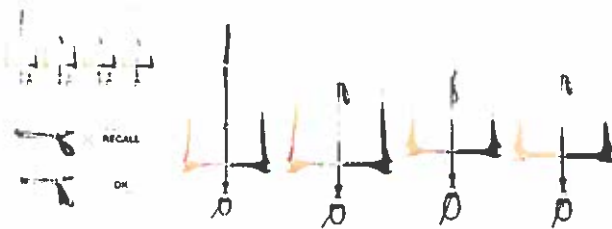

Recall Summary

Name of product:

Cabrinha Kiteboard control systems

Hazard:

The point of connection between the lower front line with the landing line can break, causing a loss of kite control, posing injury and fall hazards.

Remedy:

Replace

Recall date:

May 17, 2017

Units:

About 2,900

Consumer Contact:

Cabrinha at 808-893-0286 from 9 a.m. to 4 p.m. HT (Hawaii Time) Monday through Friday or online at www.cabrinhakites.com and click on the "Safety Alert" at the top of the page for more information.

Recall Details

Description:

The component subject to recall is the stainless steel POWER BRACKET SEAT (PBS) and the lower front line that connects with the landing line on the Overdrive 1X Recoil with Fireball or Quickloop, Overdrive 1X Trimlite with Fireball or Quickloop, 1X Trimlite with Fireball or Quickloop and the Chaos 1X Control system models. The stainless steel PBS is mounted on the top of the depower mainline between one of the lower front lines and the landing line. The PBS is used as a stopping point for one of the flying lines while allowing the activation of the 1X security landing line. Model numbers included in the recall are KS7CSODFR, KS7CSODQR, KS7CSODFC, KS7CSODQC, KS7CSFXFC, KS7CSFXQC and KS7CSCHFX. Only models with "2017 1X" printed on a cloth tab attached to the bungee line restrainers at the end of the bars are included in this recall.

Remedy:

Consumers should immediately stop using the recalled kiteboard control systems and return them to the place of purchase to receive a free replacement kit with instructional guide. A video on how to install the replacement plastic power-bracket is available here: <https://www.youtube.com/watch?v=vZasOj9v6Yw>.

Incidents/Injuries:

The firm has received six reports of the stainless steel PBS component breaking. No injuries have been reported.

Sold Exclusively At:

Watersports stores nationwide from July 2016 through March 2017 for about \$550.

Manufacturer(s):

Cabrinha Kites, a subsidiary of Pryde Group Americas, of Doral, Fla.

Manufactured In:

China

Recall number:

17-154



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Douglas Recalls Plush Toys Due to Choking Hazard



Recall Summary

Name of product:
Plush toys

Hazard:
The plastic eyes on the plush toys can detach, posing a choking hazard.

Remedy:
Refund
Replace

Recall date:
May 17, 2017

Units:
About 25,000

Consumer Contact:

Douglas at 800-276-4029 from 9 a.m. to 7 p.m. ET Monday through Friday or online at www.douglastoys.com and click on Product Recall for more information.

Recall Details

Description:

This recall involves the Oliver™ the Bear, Chewie™ the English Bulldog, and Charlotte™ the Fox model plush toys. Oliver the Bear is a brown and tan stuffed bear, with a blue t-shirt that reads "Oliver the Bear" and a red, removable cape. Chewie is a stuffed, brown and white English Bulldog with a blue patch sewn on the chest that reads "Chewie." Charlotte is a stuffed, brown, black and white Fox with removable blue cape. Each of these toys has a sewn-in label with the words "DOUGLAS® the cuddle toy."

Remedy:

Consumers should immediately take the recalled plush toys away from young children and contact the firm to receive a free replacement product or a full refund.

Incidents/Injuries:

Douglas has received two reports of the plastic eyes detaching or loosening. No injuries have been reported.

Sold At:

Specialty toy and gift stores nationwide from July 2014 to April 2017 for about \$20. Also distributed by UnitedHealthcare Children's Foundation (UHCCF) to various individuals and organizations.

Manufacturer(s):

Douglas Company Inc., of Keene, N.H.

Importer(s):

Douglas Company Inc., of Keene, N.H.

Manufactured In:

China

Recall number:

17-155



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Pier 1 Imports Recalls Chalk Note Mugs Due to Burn Hazard



Recall Summary

Name of product:
Chalk Note Mugs

Hazard:
The mugs can crack when filled with hot liquid, posing a burn hazard to users.

Remedy:
Refund

Recall date:
May 18, 2017

Units:
About 15,300 (in addition, about 900 were sold in Canada)

Consumer Contact:

Pier 1 Imports toll-free at 855-513-5140 from 8 a.m. to 7 p.m. CT Monday through Friday, 9 a.m. to 5 p.m. CT Saturday or 10 a.m. to 6 p.m. CT Sunday or online at www.pier1.com and click on "Product Notes & Recalls" at the bottom of the page for more information.

Recall Details

In Conjunction With:

Description:

This recall involves the Pier 1 Imports Chalk Note Mugs that can be written on with chalk. The stoneware mugs were sold in black and measure 5.25 inches tall by 5 inches in diameter. "Stoneware" and "Pier 1 Imports" are printed on the bottom of the mug.

Remedy:

Consumers should immediately stop using the recalled mugs and contact Pier 1 Imports for a full refund or merchandise credit.

Incidents/Injuries:

The firm has received reports of eight mugs cracking when filled with a hot liquid. No injuries have been reported.

Sold Exclusively At:

Pier 1 Imports stores nationwide and online at Pier1.com from March 2016 through April 2017 for about \$8.

Importer(s):

Pier 1 Imports Inc., of Fort Worth, Texas

Manufactured In:

China

Recall number:

17-156



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Michaels Recalls Ceramic Travel Mugs Due to Burn Hazard



Recall Summary

Name of product:
Ceramic travel mugs

Hazard:
The mug's lid does not fit securely and can cause liquids to leak from the bottom of the lid when tilted, posing a burn hazard. Also, the mug does not have a silicone hand wrap so the consumer could burn their hand on the side walls of the mug.

Remedy:
Refund

Recall date:
May 18, 2017

Units:
About 27,000

Consumer Contact:
**Michaels at 800-642-4235 from 9 a.m. to 7 p.m. CT
Monday through Friday or online at
www.michaels.com and click on "Product Recalls" at
the bottom of the page for more information.**

Recall Details

Description:

This recall involves Michaels private brand Celebrate It™ ceramic travel mugs with a silicone lid. The mugs measure about 6.5 inches tall and hold about 16 ounces of liquid. The travel mugs have four designs.

- Motherhood the greatest adventure (lime green lid)
- MOM (lime green lid)
- Blue floral (turquoise lid)
- Pink floral (pink lid)

Only ceramic mugs with SKU number 508992 and UPC code 886946619458 printed on a label on the bottom of the mugs are included in the recall.

Remedy:

Consumers should immediately stop using the recalled mugs and return them to any Michaels store for a full refund.

Incidents/Injuries:

The firm has received one report of the lid leaking. No injuries have been reported.

Sold At:

Michael's stores nationwide from March 2017 through April 2017 for about \$8.

Distributor(s):

Michaels Stores Procurement Co. Inc. (MSPCI), a subsidiary of The Michaels Companies Inc., of Irving, Texas

Manufactured In:

China

Recall number:

17-157



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Following Plumber's Death, Electric Ranges Recalled by Arçelik A.S. Due to Shock and Electrocutation Hazards



Recall Summary

Name of product:

Blomberg and Summit electric ranges

Hazard:

The electric ranges can become energized, posing electric shock and electrocution hazards to a consumer who touches the range

Remedy:

Repair

Recall date:

May 19, 2017

Consumer Contact:

**Arçelik toll-free at 877-271-1489 from 8 a.m. to 5 p.m.
ET Monday through Friday, or online at
www.blombergappliances.us and click on Recall
Information at the bottom of the page for more
information.**

Recall Details

Description:

WASHINGTON, D.C. – The U.S. Consumer Product Safety Commission (CPSC), Arçelik A.S. of Turkey and Beko US, of Bolingbrook, Ill. are announcing the voluntary recall of about 6,300 Blomberg and Summit brand freestanding electric ranges. The electric ranges can become energized because a screw was not installed to secure the grounding strap during manufacturing, posing electric shock and electrocution hazards.

In August 2016, a 52-year-old professional plumber from Portsmouth, New Hampshire died from electrocution when he came in contact with an energized range and a grounded object.

This recall involves Blomberg BERU 24200 SS, BERU 24100 SS and Summit CLRE24 24-inch wide freestanding glass top electric ranges. The ranges were sold in stainless steel and black. A label on the lower frame of the range inside the over door has the brand name "Blomberg" or "Summit," the model name and number BERU 24200 SS, BERU 24100 SS or CLRE24 and a 10-digit serial number. Serial numbers included in the recall are

12 XXXXXX XX	15 XXXXXX XX	16 XXXXXX 03	16 XXXXXX 06
13 XXXXXX XX	16 XXXXXX 01	16 XXXXXX 04	16 XXXXXX 07
14 XXXXXX XX	16 XXXXXX 02	16 XXXXXX 05	16 XXXXXX 08

The ranges were sold by AJ Madison, State Street Discount and other stores nationwide and online at Amazon.com from October 2012 through March 2017 for between \$1,000 and \$1,500.

They were manufactured by Arçelik A.S. in Turkey.

Consumers should immediately stop using the recalled ranges and avoid all direct contact with the product until the electricity supply is shut off. Consumers should contact Arçelik A.S. to schedule a free on-site inspection and repair.

Contact Arçelik toll-free at 877-271-1489 from 8 a.m. to 5 p.m. ET Monday through Friday, or online at www.blombergappliances.us and click on Recall Information at the bottom of the page.

Remedy:

Consumers should immediately stop using the recalled ranges and avoid touching the range until electricity to the range is turned off at the fuse box. Consumers should contact the firm to schedule a free on-site inspection and repair.

Recall number:

17-159



United States
CONSUMER PRODUCT SAFETY COMMISSION

Pulse Performance Products Recalls Krusher Scooters Due to Fall Hazard



Recall Summary

Name of product:

Krusher Push scooters

Hazard:

The down tube can break, posing a fall hazard to the rider.

Remedy:

Refund

Recall date:

May 19, 2017

Units:

About 18,700

Consumer Contact:

Pulse Performance Products toll-free at 844-728-9957 from 7:30 a.m. to 4 p.m. PT Monday through Friday, or online at www.pulsescooters.com and click on "CPSC Safety Recall" for more information.

Recall Details

Description:

This recall involves Pulse Krusher Pro Freestyle scooters with factory code 083WY, item number 164257 and date code 10-8-2016 or earlier. The factory code, item number and date code can be found on a label printed on the underside of the scooter deck. The 30-inch high scooters were sold in blue and have the words "PULSE PERFORMANCE PRODUCTS" printed on the down tube.

Remedy:

Consumers should immediately stop using the recalled scooters and contact Pulse Performance Products for a full refund.

Incidents/Injuries:

The firm has received 15 reports of the down tube breaking, including two reports of scrapes from falls.

Sold At:

Walmart and Westminster Trading stores nationwide and online at Walmart.com from June 2016 through May 2017 for about \$40.

Manufacturer(s):

Pulse Performance Products, a division of Bravo Sports, of Santa Fe Springs, Calif.

Importer(s):

Bravo Sports, of Santa Fe Springs, Calif.

Distributor(s):

Bravo Sports, of Santa Fe Springs, Calif.

Manufactured In:

China

Recall number:

17-160



Dynacraft Recalls Ride-On Toys Due to Fall and Crash Hazards



Recall Summary

Name of product:
Surge and Tonka battery operated ride-on toys

Hazard:
The acceleration pedal on the ride-on toys can stick, posing fall and crash hazards.

Remedy:
Repair

Recall date:
May 23, 2017

Units:
About 20 000

Consumer Contact
Dynacraft at 800-551-0032 from 7 a.m. to 4 p.m. PT Monday
through Friday or online at www.dynacraftwheels.com and click on
"Product Recalls" for more information.

Recall Details

Description:

This recall involves three models of 12V battery-operated ride-on toys, including Surge 12V Camo 4X4, Surge 12V XL Quad and Tonka 12V Mighty Dump trucks. The recalled ride-on toys have model numbers and date codes listed in the table below. The model number, batch number, serial number and the date code, formatted as "MMDDYYYY," are printed on a label on the bottom of the ride-on toy.

Product Name and Color	Model Number	Date Codes	Batch Number	Serial Numbers
Surge 12V Camo 4X4 Color: Camouflage and black with orange Surge graphic and accents	8803-31	06082016	302119	DA0331F00001-
		06152016	302247	DA0331F01650
		06302016	302248	DA0331G00001-
		07142016	302249	DA0331G03450
		07192016	302255	DA0331H01201-
		07202016	302256	DA0331H02200
		07262016	302257	DA0331H05001-
		07282016	302292	DA0331H05200
		08032016	302296	DA0331H05501-
		08092016	302298	DA0331H06200
Surge 12V XL Quad Color: Camouflage and black with neon green Surge graphic and accents	8803-38	07222016	3101735	DA0338G00001-
08192016		3101741	DA0338G01250	
08242016		3101743	DA0338H00001-	
		3101748	DA0338H02200	
		3101750		
Tonka 12V Mighty Dump Truck Color: yellow and black with red and white Tonka graphic	8801-96U	05182016	302203	DA0196E00141-
		06022016	302205	DA0196E05500
		06162016	302207	DA0196F00001-
		06302016	302209	DA0196F07400
		07132016	302211	DA0196G00001-

Remedy:

Consumers should immediately take the recalled ride-on toys away from children and contact Dynacraft to receive a free replacement foot pedal with installation instructions. Consumers in need of assistance with the repair, can bring the ride-on toy to an authorized service center for a free repair.

Incidents/Injuries:

Dynacraft has received 19 reports of pedals sticking, including seven reports of minor injuries, abrasions, cuts and bruises.

Sold At:

The Surge 12V Camo 4X4 was sold at Walmart nationwide between June 2016 and March 2017 for about \$300. The Surge 12V XL Quad sold at Academy Sports + Outdoors stores nationwide from September 2016 through March 2017 for between \$150 and \$200. The Tonka 12V Mighty Dump Truck was sold at Toys R Us stores nationwide and online at ToysRU.com from July 2016 through November 2016 for about \$350.

Importer(s):

Dynacraft BSC Inc., of American Canyon, Calif.

Distributor(s):

Dynacraft BSC Inc., of American Canyon, Calif.

Manufactured In:

China

Recall number:

17-162



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Sportex Recalls Salt Rock Lamps Due to Shock and Fire Hazards



Recall Summary

Name of product:

Lumiere Salt Rock lamps

Hazard:

The dimmer switch and/or outlet plug can overheat and ignite, posing shock and fire hazards.

Remedy:

Refund

Repair

Recall date:

May 23, 2017

Units:

About 3,900 (80,000 lamps were previously recalled in January 2017)

Consumer Contact:

**Sportex at 800-652-3490 from 9 a.m. to 5 p.m. ET
Monday through Thursday or online at
www.sportexus.com and click on "Salt Rock Lamps"
at the bottom of the page for more information.**

Recall Details

Description:

This recall involves Lumière brand Rock Salt Lamps in three styles: Basket of Rocks, Carnival of Lights and Rock of Gibraltar. The lamps are pink in color and are mounted on a wooden base or in a black metal basket. The lamps were sold in black cardboard boxes with a photo of the lamp on the front of the box and the UPC bar code number on the bottom of the box. Lamps with the following UPC numbers are included in the recall.

Description	UPC
Rock of Gibraltar Lamp	00886946056253
Carnival of Lights	00886946058325
Basket of Rocks	00886946056277

Remedy:

Consumers should immediately stop using the lamps and return them to the store where purchased to receive a full refund or a replacement kit.

Incidents/Injuries:

None reported

Sold At:

At Home, Christmas tree shops, Michaels and other stores nationwide from July 2016 through December 2016 for between \$15 and \$30.

Importer(s):

Sportex US, of New York

Manufactured In:

Pakistan

Recall number:

17-163



Hobby Lobby Recalls Easter and July 4th Light-Up Spinner Toys Due to Choking and Ingestion Hazards



Recall Summary

Name of product:

Easter and July 4th-themed Light-Up Spinner Toys

Hazard:

The battery cover can detach and expose the small coin cell batteries, posing choking and ingestion hazards to young children.

Remedy:

Refund

Recall date:

May 23, 2017

Units:

About 43,400

Consumer Contact:

Hobby Lobby Stores at 800-326-7931 between 9 a.m. and 6 p.m. ET Monday through Friday, or online at www.hobbylobby.com and click on the Recall tab for more information.

Recall Details

Description:

This recall involves children's battery-powered, light-up spinner toys sold in two themes: Easter and July 4th. The Easter-themed toys were sold in blue with a pink bunny on the dome and yellow with a yellow and orange chicken on the dome. The July 4th spinners are red with white stars painted on the blue dome. "Hobby Lobby" and item number 9130033 or 9130082 is printed on the spinner handle. The spinners are powered by three LR44 coin cell batteries.

Remedy:

Consumers should immediately take the recalled spinners away from children and return them to the nearest Hobby Lobby or Mardel store. Consumers with a receipt will receive a full refund and consumers without a receipt will receive a store credit.

Incidents/Injuries:

Hobby Lobby has received one report of a 14-month-old child who ingested the battery. An x-ray was conducted and the battery passed through.

Sold At:

Hobby Lobby and Mardel stores nationwide from February 2017 to April 2017 for about \$5.

Importer(s):

Hobby Lobby Stores Inc., of Oklahoma City, Okla.

Manufactured In:

China

Recall number:

17-166



This recall was conducted, voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Pier 1 Imports Recalls Temani Wicker Furniture Due to Violation of Federal Lead Paint Standard



Recall Summary

Name of product:

Temani ivory wicker chair, settee and ottoman

Hazard:

The paint used on the wicker furniture can contain excessive levels of lead, which is a violation of the federal lead paint standard.

Remedy:

Refund

Recall date:

May 23, 2017

Units:

About 2,500 (in addition, about 75 units sold in Canada)

Consumer Contact:

Pier 1 Imports toll-free at 855-513-5140 from 8 a.m. to 7 p.m. CT Monday through Friday, 9 a.m. to 5 p.m. CT Saturday, or 10 a.m. to 6 p.m. CT Sunday or online at www.Pier1.com and click on "Product Notes & Recalls" at the bottom of the page for more information.

Recall Details

In Conjunction With:

Description:

This recall involves the Pier 1 Imports Temani collection, which includes a chair, settee and ottoman. They are ivory colored, made of rattan wicker, and were sold without a cushion. The chair measures 29 inches wide, 29.5 inches deep and 35.5 inches high, the settee measures 51.5 inches wide, 29.5 inches deep and 35.5 inches high, and the ottoman measures 27 inches wide, 18 inches deep and 16 inches high. The furniture has a Pier 1 Imports logo on the underside of each chair, settee and ottoman. The recall involves only the ivory-colored Temani collection.

Item	SKU Number
Chair	2769765
Settee	2860548
Ottoman	2769778

Remedy:

Consumers should stop using the recalled furniture immediately and return it to any Pier 1 Imports store for a full refund or a merchandise credit.

Incidents/Injuries:

None reported

Sold Exclusively At:

Pier 1 Imports stores nationwide and online at www.Pier1.com from March 2014 to April 2017 for between \$140 and \$560.

Manufacturer(s):

PT Gimex Furniture Manufacturing Co., of Indonesia

Importer(s):

Pier 1 Imports, of Fort Worth, Texas

Manufactured In:

Indonesia

Recall number:

17-164



Office Chairs Recalled by Leggett & Platt Office Components Due to Fall Hazard



Recall Summary

Name of product:
Office chairs

Hazard:
Seat slider bolts and push nuts can disconnect and fall from the chair, which could cause the seat to detach from the chair, posing a fall hazard to consumers.

Remedy:
Repair

Recall date:
May 24, 2017


Units:
About 47,900 in the U.S. (in addition, about 1,000 in Canada)

Consumer Contact:
Leggett & Platt toll-free at 844-616-3616 from 9 a.m. to 6 p.m. ET
Monday through Friday, email at LP01service@leggett.com or
online at www.lpworkfurniture.com and click on "Product Recall"
at the top of the page for more information.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Extech Recalls Digital Clamp Meters Due to Electrocution Hazard

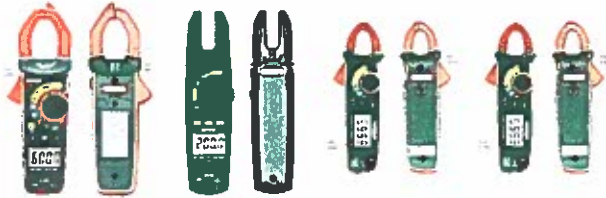

Recall Summary

Name of product:
Digital clamp meters

Hazard:
The meters can fail to give an accurate voltage reading, resulting in the operator falsely believing the electrical power is low or off, posing an electrocution hazard.

Remedy:
Replace

Recall date:
May 25, 2017

Units:
1,700 (in addition, about 20 were sold in Canada)

Consumer Contact:
**Extech toll-free at 855-239-8324 from 9 a.m. to 5 p.m.
ET Monday through Friday, by email at
meter.recall@extech.com, or online at
www.extech.com and click on Safety Notices at the
bottom of the page for more information.**

Recall Details

In Conjunction With:

Description:

This recall involves Extech digital clamp meters with model numbers EX650, EX655, MA160, MA61, and MA63. These models are all AC/DC clamp meters, which are electrical testing devices that measure AC/DC voltage, resistance, capacitance, frequency, temperature, continuity, and diode. Serial numbers in the following format are included in the recall: R15XXXXXXX to R17XXXXXXX. Only serial numbers in this range are included in the recall. The "EXTECH" logo and the model number are printed on the front of the unit and the serial number on the back. The digital clamp meters are green and orange.

Remedy:

Consumers should immediately stop using the recalled digital clamp meters and contact Extech for a free replacement meter.

Incidents/Injuries:

Extech received two reports of clamp meters displaying an incorrect voltage reading. No injuries have been reported.

Sold At:

Grainger, Platt Electric Supply stores and industrial and electrical distributors and wholesalers nationwide and online at Amazon.com and other websites from January 2016 through April 2017 for between \$110 and \$230.

Importer(s):

FLIR Commercial Systems Inc., of Goleta, Calif., owner of Extech

Manufactured In:

China

Recall number:

17-167



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Cordless Electric Lawn Mowers Recalled Due to Fire Hazard; Made by Hongkong Sun Rise Trading



Recall Summary

Name of product:
Cordless electric lawn mowers

Hazard:
The circuit board in the lawn mower can short circuit and catch fire, posing a fire hazard to users.

Remedy:
Repair

Recall date:
May 26, 2017

Units:
About 28,000

Consumer Contact:
**Hongkong Sun Rise Trading toll-free at 888-266-7096
from 9 a.m. to 5 p.m. ET any day or online at
www.greenworkstools.com and click on "Important
Safety Notice" at the bottom of the page for more
information.**

Recall Details

Description:

This recall involves Kobalt and Greenworks brands of cordless electric walk-behind lawn mowers. The recalled lawn mowers have four wheels (two smaller ones in the front and two larger ones in the back), a 40-volt max lithium ion battery and a deck width of 20 inches. Both models have a large label on the rear bag door area with a serial number, model number and date code. The Kobalt brand mowers also have an item number on the label. "Kobalt" or "Greenworks" is printed on the side of the bag. The following models are included in the recall

Brand	Product	Colors	Model Number	Item Number	Date Codes
Kobalt	40-volt max cordless dual-blade push lawn mower	Blue and black	KM2040X-06	506586	04/14/14 to 05/14/15
Greenworks G-MAX	40-volt twin force cordless electric push lawn mower	Green and black	25302	N/A	04/10/14 to 07/17/15

Remedy:

Consumers should immediately stop using the recalled lawn mowers, remove the battery and contact Hongkong Sun Rise Trading for a free repair.

Incidents/Injuries:

The firm has received 12 reported incidents with the recalled lawn mowers including 5 reports of fires. No injuries have been reported.

Sold At:

Lowe's and other retailers nationwide and online at Amazon.com, Lowes.com and other websites from May 2014 through July 2016 for about \$350.

Manufacturer(s):

Hongkong Sun Rise Trading Ltd, of China

Distributor(s):

Sunrise Global Marketing, of Mooresville, N.C.

Manufactured In:

China

Recall number:

17-168



Kreative Kids Recalls Children's Robes Due to Violation of Federal Flammability Standard



Recall Summary

Name of product:
Children's robes

Hazard:
The children's robes fail to meet flammability standards for children's sleepwear, posing a risk of burn injuries to children.

Remedy:
Refund

Recall date:
June 1, 2017

Units:
About 7,600

Consumer Contact:
Kreative Kids at 800-786-2919 from 9 a.m. to 5 p.m. PT Monday through Friday, email at sales@kreativekids.net or online at www.kreativekids.net and click on "Recall Information" at the bottom of the page for more information.

Recall Details

Description:

This recall includes eight styles of children's 100-percent polyester, hooded robes. The robes were sold in sizes 4-6 and 7-9 in the following styles: purple elephant, lion, pink bear, lady bug, blue puppy, duck, monkey, and princess cat. A label sewn in the robes has item number 2013NW081 and "Kreative Kids" printed on it. The robes also have a hood, long-sleeves, a belt, cinched back and two front pockets

Remedy:

Consumers should immediately take the recalled robes away from children and contact Kreative Kids for a full refund.

Incidents/Injuries:

None reported

Sold At:

Online at Amazon.com and at gift and specialty stores in California, Iowa, New York, Ohio and Texas from September 2013 through April 2017 for between \$15 and \$17

Importer(s):

Kreative Kids Inc., of Pomona, Calif

Distributor(s):

Kreative Kids Inc., of Pomona, Calif

Manufactured In:

China

Recall number:

17-169



United States
CONSUMER PRODUCT SAFETY COMMISSION

Lila + Hayes Recalls Children's Playwear Due to Choking Hazard



Recall Summary

Name of product:

Eloise and Benton Bubble children's playwear

Hazard:

The buttons can detach from the garment, posing a choking hazard to young children.

Remedy:

Refund

Recall date:

June 6, 2017

Units:

About 600

Consumer Contact:

**Lila + Hayes at 855-850-1308 from 10 a.m. to 6 p.m. CT
Monday through Friday or online at
www.lilaandhayes.com and click on "Recall" located at
the bottom of the page.**

Recall Details

Description:

The recall includes Benton and Eloise pima cotton, sleeveless, bubble playwear. The Benton style was sold in navy, white, light blue and blue and green ticking stripes. The Eloise style was sold in navy, white, pink and blue and green floral. The garment has a snap closure at the bottom and crisscross straps that button over the shoulders on the front of the garment. The Benton style was sold in boys sizes NB, 0-24 months, 2T and 3T. The Eloise was sold in girls sizes NB, 0-24 months, 2T and 3T. The manufacture dates codes for December 2016 (DEC16) and February 2016 (FEB16) are printed on the inside garment tag located inside the seam. "Lila + Hayes" and the garment size are printed on the inside of the back of the garment.

Remedy:

Consumers should immediately stop using the playwear and contact Lila + Hayes to receive a pre-paid mailer envelope to return the garment for a full refund.

Incidents/Injuries:

The firm has received eight reports of the button detaching from the straps while in use. No injuries have been reported.

Sold At:

Layette (Dallas, Texas), Hip Hip Hip Hooray (Dallas, Texas) and Born Children's (Montgomery, Alabama) stores and on-line at www.lilaandhayes.com from February 2017 through April 2017 for between \$45 and \$65.

Importer(s):

Lila + Hayes LLC, of Fort Worth, Texas

Manufactured In:

Peru

Recall number:

17-171



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



Lithonia Lighting Recalls to Repair Ceiling Light Fixtures Due to Impact Hazard



Recall Summary

Name of product:
LED light fixtures

Hazard:
The plastic diffuser lens can detach and fall unexpectedly, posing a risk of injury from impact.

Remedy:
Repair

Recall date:
June 7, 2017

Units:
About 5,600

Consumer Contact:
Lithonia Lighting toll-free at 888-876-4181 from 8 a.m. to 5 p.m. ET
Monday through Friday or online at www.lithonia.com and click on
"LBL4W LED Recall" on the left side of the page for more
information.

Recall Details

Description:

This recall involves Lithonia Lighting LBL4W model ceiling light fixtures which are used indoors in commercial applications such as offices, schools, closets, hallways and stairwells. The fixtures are painted white metal and measure about four feet long with a low profile, curved plastic diffuser lens (cover). The plastic diffuser lens measures 4 feet long by 15 inches wide. Only fixtures manufactured between February 2016 and March 2017 are included in this recall. Lithonia Lighting, the model number and the date of manufacture are printed on a label attached to the fixture's housing. The date code is in the MM/DD/YY format on the fixture's housing.

Remedy:

Consumers should remove the lens and contact Lithonia Lighting to receive a free lens to repair the unit. Consumers should prevent people from going into the immediate area under the fixtures until the lenses are repaired. A video showing proper lens removal and repair is available at www.lithonia.com/LBL4Wvideo

Incidents/Injuries:

The firm has received six reports of loose or falling diffuser lenses. No injuries have been reported.

Sold At:

Electrical distributors nationwide and online through the commercial desk at 1000Bulbs.com, Amazon.com, ATGStores.com, Build.com, HD.com, ShineRetrofits.com, and Wayfair.com from February 2016 through March 2017 for between \$150 and \$200.

Manufacturer(s):

Lithonia Lighting, a division of Acuity Brands Lighting Inc., of Conyers, Ga.

Importer(s):

Lithonia Lighting, a division of Acuity Brands Lighting Inc., of Conyers, Ga.

Manufactured in:

U.S. and Mexico

Recall number:

17-172



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Nidec Motor Recalls Swimming Pool Motors Due to Electrical Shock Hazard



Recall Summary

Name of product:
Swimming pool motors

Hazard:
The pump control cover can be improperly grounded, posing an electrical shock hazard.

Remedy:
Repair

Recall date:
June 7, 2017

Units:
About 16,000 (in addition, about 22 were sold in Canada)

Consumer Contact:
NMC toll-free at 877-282-0223 from 8 a.m. to 5 p.m. EST Monday through Friday or online at www.nidec-motor.com and click on "RECALL" for more information.

Recall Details

In Conjunction With:

Description:

This recall involves variable speed swimming pool motors with a programmable user interface on the top. "Emerson" or "EcoTech EZ" is printed on top of the control box and the model number is printed on the rating plate located on the side of the pump. The model numbers included in this recall are listed below.

Model Numbers

M63PWBLE-0121
M63PWBLM-0128
M63PWBLR-0131
M63PWBLV-0132
M63PWBLW-0135
M63PWBLX-0136
M63XZBMA-0139
M63PWBMB-0140
M63PWBMC-0141
M63PWBMD-0142
M63PWBME-0143
M63PWBMF-0144
M63PWBMG-0145
M63PWBSC-0229

Remedy:

Consumers should immediately stop using the recalled swimming pool motors and contact Nidec Motor Corp. (NMC) to schedule a free repair by a qualified technician to install an external ground lead.

Incidents/Injuries:

None reported.

Sold At:

Leslie's Pool Supply and other retail stores, wholesale pool suppliers including Pool Builders Supply, Pool Corp., Pool & Electrical Products, and United Aqua Group from September 2010 through October 2016 for between \$400 and \$500.

Manufacturer(s):

Nidec Motor Corp., of St. Louis, Mo.

Manufactured In:

Mexico

Recall number:

17-174



United States
CONSUMER PRODUCT SAFETY COMMISSION

Madison Mill Recalls Safety Gates Due to Entrapment and Strangulation Hazards



Recall Summary

Name of product:

Foldaway expandable safety gates

Hazard:

A young child's neck can fit into the "V" shaped opening along the top edge of the gate, posing entrapment and strangulation hazards to young children. Also, young children can pass under the gate allowing access to restricted areas, such as stairs.

Remedy:

Refund

Recall date:

June 7, 2017

Units:

About 25,180 (In addition about 68,400 were sold in Canada)

Consumer Contact:

**Madison Mill at 877-220-4705 from 7:30 a.m. to 5 p.m.
CT Monday through Friday, email at
tom.mckelvey@madisonmill.com or online at
www.madison mill.com and click on "Product Recalls"
for more information.**

Recall Details

In Conjunction With:

Description:

This recall involves Madison Mill 23 and 25 foldaway expandable safety gates. Item number 23 extends to three feet and item number 25 extends to five feet. The expandable gates are made of hardwood and are used to secure children or small pets in certain areas of the home. The model and item number can be found on the original packaging

Model	Item number	Dimensions
Madison Mill 23 Foldaway Gate	23	Extends to 3 ft. (36 inches)
Madison Mill 25 Foldaway Gate	25	Extends to 5 ft. (60 inches)

Remedy:

Consumers should immediately stop using the recalled gates and contact Madison Mill for instructions on receiving a full refund.

Incidents/Injuries:

None reported

Sold At:

Do It Best stores and other independent hardware stores nationwide from January 2013 through May 2017 for between \$20 and \$35.

Manufacturer(s):

Madison Mill Inc., of Ashland City, Tenn.

Manufactured In:

United States

Recall number:

17-173



Cycling Sports Group Recalls GT Mountain Bicycles Due to Fall Hazard



Recall Summary

Name of product:
GT mountain bicycles

Hazard:
The handlebars can crack, posing a fall hazard to the consumer.

Remedy:
Repair

Recall date:
June 8, 2017

Units:
About 1,000 (in addition, about 240 were sold in Canada)

Consumer Contact:
Cycling Sports Group at 800-726-2453 from 9 a.m. to 6 p.m. ET
Monday through Friday, email at
custserve@cyclingsportsgroup.com or online at
www.gtbicycles.com and click on Recalls &
Safety tab at the bottom of the page for more information.

Recall Details

In Conjunction With:

Description:

This recall involves 2017 GT mountain bicycle models, Karakoram Sport, Karakoram Comp, Aggressor Sport, Aggressor Comp and Aggressor Expert. The bikes were sold in a variety of colors including black, blue, gunmetal grey and neon yellow. Only models with 1) a solid black GT logo on the downtube and 2) a stem marked "Ø31.8 9-10N m" are included in the recall. For a complete list of GT Mountain bicycles included in this recall, visit the firm's website at http://www.gt bicycles.com/usa_en/recalls/.

Remedy:

Consumers should immediately stop using the recalled bicycles and contact an authorized GT dealer or Cycling Sports Group to schedule a free repair of the handlebar and stem.

Incidents/Injuries:

None reported

Sold At:

Bicycle stores nationwide from June 2016 to August 2017 for between \$440 and \$600.

Importer(s):

Cycling Sports Group Inc., of Wilton, Conn.

Manufactured In:

Taiwan

Recall number:


17-175



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



Noble House Recalls Chairs Due to Fall Hazard

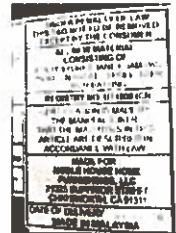

Recall Summary

Name of product:

Dining chairs

Hazard:

The legs of the chairs can break, posing a fall hazard to consumers.

Remedy:

Repair

Recall date:

June 13, 2017

Units:

About 3,300

Consumer Contact:

Noble House toll-free at 888-600-6376 from 8 a.m. to 5 p.m. PT Monday through Friday or online at www.noblehousefurniture.com and click on the Safety Recall Link located under the Contact Us tab at the bottom of the page.

Recall Details

Description:

This recall involves Noble House's Kaius, Henrietta, and Fauna dining chairs which have solid wood legs and an upholstered seat. The Kaius Fabric chairs have a curved, wood back and fabric cushion and measure 21 inches deep by 23 inches wide by 30 inches high. The Henrietta Fabric chairs have a cushioned seat and back and measure 21 inches deep by 22 inches wide by 32 inches high. The Fauna Dining chairs have a cushioned seat and back and measures 20 inches deep by 20 inches wide by 32 inches high. The recalled chairs have a label underneath the seat that reads "MADE FOR: NOBLE HOUSE HOME FURNISHINGS LLC, 21325 Superior St., Chatsworth CA 91311."

Remedy:

Consumers should immediately stop using the recalled chairs and contact Noble House for a free repair kit including shipping.

Incidents/Injuries:

The firm has received six reports of the chairs breaking, with four incidents resulting in consumers receiving bruises from falls.

Sold At:

Online at Amazon, Overstock and Wayfair, and from September 2016 through March 2017 for about \$130.

Importer(s):

Noble House Home Furnishings LLC, of Chatsworth, Calif.

Distributor(s):

Noble House Home Furnishings LLC, of Chatsworth, Calif.

Manufactured In:

Malaysia

Recall number:

17-177



This recall was conducted voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

GTHI Recalls Climbing Belay Devices Due to Fall and Injury Hazards



Recall Summary

Name of product:

Vergo belay devices (climbing tool)

Hazard:

The handle on the Vergo belay device can loosen and cause the device's assisted braking capacity to malfunction, posing fall and injury hazards to climbers.

Remedy:

Replace

Recall date:

June 13, 2017

Units:

About 2,600 (in addition, about 100 were sold in Canada)

Consumer Contact:

Trango email at vergorecall@trango.com, or call 800-860-3653 from 8 a.m. to 4 p.m. MT, Monday through Friday, or online at www.trango.com and click on "Product Alerts" for more information.

Recall Details

Description:

This recall involves Trango Vergo belay devices with batch numbers 16159 and 16195 printed on the side of the unit. The devices were sold in blue, gold, or purple and feature the word "VERGO" on the front plate of the unit. Belay devices are used with climbing ropes to protect the climber while climbing, to arrest a fall or while being lowered on the rope.

Remedy:

Consumers should immediately stop using the recalled devices and contact Trango for instructions on receiving a free replacement.

Incidents/Injuries:

The firm has received three reports of the belay device's handle over-rotating and braking malfunction. No injuries have been reported.

Sold At:

Authorized GTHI dealers and outdoor specialty stores nationwide and online at www.trango.com from October 2016 through April 2017 for about \$90.

Distributor(s):

Great Trango Holdings Inc. (GTHI), of Lafayette, Colo.

Manufactured In:

United States

Recall number:

17-176



United States
CONSUMER PRODUCT SAFETY COMMISSION

Little Giraffe Recalls Children's Robes Due to Violation of Federal Flammability Standard



Recall Summary

Name of product:

Luxe Satin children's robes

Hazard:

The children's robes fail to meet the federal flammability standards for children's sleepwear, posing a risk of burn injuries to children.

Remedy:

Refund

Recall date:

June 15, 2017

Units:

About 2,000

Consumer Contact:

Little Giraffe toll-free at 866-201-6613 from 10 a.m. to 4 p.m. PT Monday through Friday or online at www.littlegiraffe.com and click on "Recall Information" at the bottom of the page for more information.

Recall Details

Description:

This recall involves Luxe Satin children's long-sleeve robes. The robes are 43 percent acetate with 57 percent rayon, satin outer shell and a 100 percent polyester microfiber inside. The robes were sold in pink, blue and cream in sizes 1 (XS-S/4-6 years), 2 (MD-LG/6-8 years) and 3 (XL-XXL/8-10 years). The robes have two belt loops on each side and an unattached belt. Lot number "21706-DFR001" and "Not Intended for Sleepwear" are printed on the robes inside seam label.

Remedy:

Consumers should immediately take the recalled robes away from children and contact Little Giraffe for a full refund.

Incidents/Injuries:

None reported

Sold At:

Children's specialty stores nationwide and online at www.littlegiraffe.com from November 2012 through March 2017 for about \$100.

Importer(s):

Little Giraffe, of Van Nuys, Calif.

Distributor(s):

Little Giraffe, of Van Nuys, Calif.

Manufactured In:

China

Recall number:

17-178



United States
CONSUMER PRODUCT SAFETY COMMISSION

Staples Recalls Hazen Mesh Office Chairs Due to Fall Hazard



Recall Summary

Name of product:

Hazen Mesh Task chairs

Hazard:

The legs on the base of the chair can break, posing a fall hazard.

Remedy:

Repair

Recall date:

June 20, 2017

Units:

About 124,000

Consumer Contact:

Staples toll-free at 866-755-1321 from 8 a.m. to 8 p.m. ET Monday through Friday, or register online at www.seatingrecall123.com, or go to www.staples.com and click on the Warranty & Recall link under the Customer Service tab at the bottom of the page for more information.

Recall Details

Description:

This recall involves Staples and Quill Hazen Mesh Task chairs. The chair has a five-wheel base, black fabric seat cushion, and black mesh seat back. The chairs have SKU number 1058246 and item number 26680 printed on a white label on the underside of the seat cushion.

Remedy:

Consumers should immediately stop using the recalled chairs and contact Staples to receive a free replacement base and instructions for replacing the original base.

Incidents/Injuries:

Staples has received 20 reports of the legs breaking on the chairs, including three reports of injuries resulting in minor cuts and bruises.

Sold At:

Staples' stores nationwide and online at staples.com, staplesadvantage.com, and quill.com from October 2014 through April 2017 for between \$100 and \$180.

Importer(s):

Staples the Office Superstore LLC, of Framingham, Mass.

Manufactured In:

China

Retailers :

Staples the Office Superstore LLC and Quill Lincolnshire, Inc. LLC, of Framingham, Mass.

Recall number:

17-180



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Fireworks Recalled By American Promotional Events Due to Burn and Injury Hazards



Recall Summary

Name of product:

TNT Red, White, & Blue Smoke fireworks

Hazard:

The fireworks can explode unexpectedly after being lit, posing burn and injury hazards to consumers.

Remedy:

Refund

Recall date:

June 27, 2017

Units:

36,100

Consumer Contact:

American Promotional Events at 800-243-1189 from 8 a.m. to 5 p.m. CT Monday through Friday; email at info@tntfireworks.com or online at www.tntfireworks.com and click on Product Recall at the bottom right-hand corner of the page.

Recall Details

Description:

This recall involves TNT Red, White, & Blue Smoke fireworks. The recalled fireworks are pyrotechnic devices that make smoke when lit. They were sold in a bag containing three canisters: one red, one blue and one white. Each colored smoke firework is a cardboard cylinder tube that measures about 1 inch in diameter and 5 inches long. The TNT logo, "Red, White & Blue Smoke" and UPC number 027736036561 appear on the packaging.

Remedy:

Consumers should immediately stop using the recalled fireworks and contact America Promotional Events for a full refund.

Incidents/Injuries:

American Promotional Events has received three incident reports, resulting in three people suffering burn injuries. No property damage has been reported.

Sold At:

Albertsons, Kroger, Meijer, Target, Wal-Mart and other retailers in Illinois, Ohio, Vermont and Wisconsin from May 2017 through June 2017 about \$5.

Manufactured In:

China

Recall number:

17-181



South Shore Expands Recall of Chest of Drawers Due to Serious Tip-Over and Entrapment Hazards



Recall Summary

Name of product:
5-drawer chests

Hazard:

The recalled chests are unstable if they are not anchored to the wall, posing serious tip-over and entrapment hazards that can result in death or injuries to children. The chests do not comply with the performance requirements of the U.S. voluntary industry standard (ASTM F2057-14).

Remedy:

Refund
Repair

Recall date:

June 28, 2017

Units:

About 68,300 (This includes the 3,500 recalled in January 2017.)

Consumer Contact:

South Shore at 800-290-0465 from 8:30 a.m. to 7 p.m. ET Monday through Friday, 9 a.m. to 5 p.m. Saturday, and 10 a.m. to 5 p.m. Sunday, by email at service@southshore.ca or online at www.SouthShoreFurniture.com and click on "Recall Information" for more information.

Recall Details

Description:

This recall involves Summer Breeze style 5-drawer chests of drawers sold in four colors. Each drawer has two round knobs. The model number is printed on a label on the back of the chest. The chests measure 44-inches high by 31-inches wide and 16-inches deep and weigh 88 pounds. The model numbers and colors included:

Model Number	Color
3746035 or 3746035A	Royal Cherry
3294035 or 3294035A	Blueberry
3219035 or 3219035A	Chocolate
3210035 or 3210035A	White

Remedy:

Consumers should immediately stop using any recalled chest that is not properly anchored to the wall and place it into an area that children cannot access. Contact South Shore for a full refund or a free tip-over restraint kit. Consumers who are unable or unwilling to install the tip restraint kit should contact South Shore for a free one-time in-home installation of the kit.

Incidents/Injuries:

None reported

Sold At:

Online at Amazon.com, Walmart.com, Wayfair.com and other online retailers from February 2005 through December 2016 for about \$160.

Importer(s):

South Shore Industries Ltd., of Canada

Distributor(s):

South Shore Industries Ltd., of Canada

Manufactured In:

Canada

Recall number:

17-182



This recall was conducted, voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Design Solutions International with Home Depot Recalls Light Fixtures Due to Laceration and Burn Hazards



Recall Summary

Name of product:

Home Decorators Collection 3-Light and 4-Light Comotti Vanity Fixtures

Hazard:

The light shades can detach and fall, posing laceration and burn hazards.

Remedy:

Repair

Recall date:

June 29, 2017

Units:

About 64,200

Consumer Contact:

Design Solutions International at 800-388-6141 from 8 a.m. to 4 p.m. ET, email at customersupport@dsilighting.com or register online at <http://dsilighting.com> and click on Recall Information at the bottom of the page for more information.

Recall Details

In Conjunction With:

Description:

This recall involves Home Decorators Collection 3-Light and 4-Light Comotti Vanity Fixtures. The light fixture styles have 3 or 4 chrome-colored glass shades with clear acrylic ball strands that surround a halogen light. The wall plate is made of reflective stainless steel.

Remedy:

Consumers should immediately contact Design Solutions International to receive free replacement light shades and replacement instructions.

Incidents/Injuries:

The firm has received 108 reports of shades falling, including one report of a laceration to the head that also involved a laceration and burn to the arm and one report of a laceration to the leg.

Sold Exclusively At:

Home Depot stores nationwide and online at www.homedepot.com from December 2014 through March 2017 for between \$95 and \$110.

Importer(s):

Home Depot Product Authority, LLC of Atlanta, Ga

Manufactured In:

China

Recall number:

17-179



This recall was conducted voluntarily by the company under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.



United States
CONSUMER PRODUCT SAFETY COMMISSION

Burt's Bees Baby Recalls Infant Coveralls Due to Choking Hazard

Recall Summary

Name of product:

Infant coveralls

Hazard:

The snap at the crotch of the coveralls can detach, posing a choking hazard to infants.

Remedy:

Refund

Recall date:

June 29, 2017

Units:

About 8,500 (in addition about 44 were sold in Canada)

Consumer Contact:

Burt's Bees Baby toll-free at 877-907-7511 from 8 a.m. to 5 p.m. ET Monday through Friday or online at www.burtsbeesbaby.com and click on "Recall" located at the top of the page for more information.

Recall Details

In Conjunction With:

Description:

This recall involves infant Butterfly Garden Coverall & Hat Sets. The coveralls are 100% organic cotton, and were sold in blossom pink with white butterflies. There is a white ruffle around the neck that runs down the front of the garment. It has snaps in the crotch and was sold in infant sizes NB, 3M, 6M, and 9M. The manufacture date code of August 2016 (08/2016) is printed on the inside garment tag located inside the seam of the garment. "Burt's Bees Baby" and the garment sizes are printed on the inside back of the garment. Only coverall sets with style number LY24195 on the hangtag are included in the recall.

Remedy:

Consumers should immediately stop using the recalled coveralls and contact Burt's Bees Baby to receive a pre-paid envelope to return the garment for a \$20 e-gift card to be used at www.burtsbeesbaby.com.

Incidents/Injuries:

The firm has received 11 reports of the snaps detaching from the coveralls. No injuries have been reported.

Sold At:

Babies R Us, BuyBuy Baby, and online at babiesrus.com, buybuybaby.com, amazon.com, kohls.com, target.com, zulily.com, diapers.com, hautelook.com, and burtsbeesbaby.com from December 2016 through May 2017 for about \$18.

Importer(s):

Ayablu Inc., DBA Burt's Bees Baby, of Fairfield, Conn.

Manufactured In:

India

Recall number:

17-183



This recall was conducted, voluntarily by the company, under CPSC's Fast Track Recall process. Fast Track recalls are initiated by firms, who commit to work with CPSC to quickly announce the recall and remedy to protect consumers.

**U.S. CONSUMER PRODUCT SAFETY COMMISSION
4330 EAST WEST HIGHWAY
BETHESDA, MD. 20814**

**OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE, \$300**

CPSC HOTLINE 1-800-638-2772