



400 Seventh Street, S.W.
Washington, D.C. 20590

U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** **



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123



CASE SUMMARY

PSU 13 CASE NO. 1494 TYPE OF ACCIDENT Van/Truck/Car/obstacle

A. DESCRIPTION OF THE ACCIDENT SEQUENCE AND ACCIDENT PECULIARITIES

(Provide a summary of the accident sequence as well as any particular event of the accident that is noteworthy. Injury mechanism and vehicle crashworthiness is the focus, not driver culpability. Do not include any personal identifiers.)

Vehicle #1 was North bound on a 2 lane Dry bituminous 55 MPH Rural Road and contacted a large pickup with its front in the Trucks Right side which was East bound on a 2 lane Dry bituminous Rural Road - Vehicle #3 was west bound on a 2 lane bituminous Road stopped and was hit with stone which the truck was carrying.

B. VEHICLE PROFILE(S)

Vehicle No.	Class of Vehicle	Year/Make/Model	Most Severe Damage Based on Vehicle Inspection		Component Failure
			Damage Plane	Severity Description	
1	Van	1997/Dodge/Caravan	Front	Severe	None
2	Pickup	1995/Ford/F-350	Right	Severe	None
3	Compact	1993/Mercury/Topaz	Front	Moderate	None

C. PERSON PROFILE(S)

Vehicle No.	Person Role	Seat Position	Restraint Use	Most Severe Injury (TO BE COMPLETED BY ZONE CENTER)			
				Body Region	Injury Type	AIS	Injury Source
1	Driver	L Front	L.S.S + Air bag				
	Passenger	R Front	None				
	Passenger	L Rear	None				
2	Driver	L Front	L.S.S				
3	Driver	L Front	L.S.S				

PSU13

1995 Case Summary Form

CASE 149A

TYPE OF ACCIDENT: VAN/TRUCK/CAR/OBTUSE

A. DESCRIPTION OF THE ACCIDENT SEQUENCE AND ACCIDENT PECULIARITIES

VEHICLE#1 WAS NORTH BOUND ON A 2LANE DRYBITUMINOUS 55MPH RURAL ROAD AND CONTACTED A LARGE PICKUP WITH ITS FRONT IN THE TRUCKS RIGHT SIDE WHICH WAS EAST BOUND ON A 2LANE DRY BITUMINOUS RURAL ROAD - VEHICLE #3 WAS WEST BOUND ON A 2 LANE BITUMINOUS ROAD STOPPED AND WAS HIT WITH STONE WHICH THE TRUCK WAS CARRING

01

PSU13

1995 Case Summary Form

CASE 149A

TYPE OF ACCIDENT: VAN/TRUCK/CAR/OBTUSE

B. VEHICLE PROFILE(S)

V e h. No	Class of Vehicle	Year/Make/ Model	Damage Plane	Severity Descr.	Component Failure
1	VAN	1992/DODGE/CARAVAN	FRONT	SEVERE	NONE
2	PICKUP	1995/FORD/F350	RIGHT	SEVERE	NONE
3	COMPACT	1993/MERCURY/TOPAZ	FRONT	MODERATE	NONE

01

PSU13

1995 Case Summary Form

CASE 149A

TYPE OF ACCIDENT: VAN/TRUCK/CAR/OBTUSE

C. PERSON PROFILE(S)

V e h. No	Person Role	Seat Position	Restraint Use	Body Region	Injury Type	A	
						I	Injury Source
1	DRIVER	LFRONT	L&S-AIRBAG	skull	fracture	4	if other - other vehicle
	PASSENGER	RFRONT	NONE	abdomen	laceration	5	steering rim
	PASSENGER	CREAR	NONE	brain	edema	4	seat back
2	DRIVER	LFRONT	L&S	face	lacerations	1	flying glass
3	DRIVER	LFRONT	L&S	no injury			

0



ACCIDENT COLLISION DIAGRAM


PSU No. 13

Case Number—Stratum 149A

Indicate North



No. 13

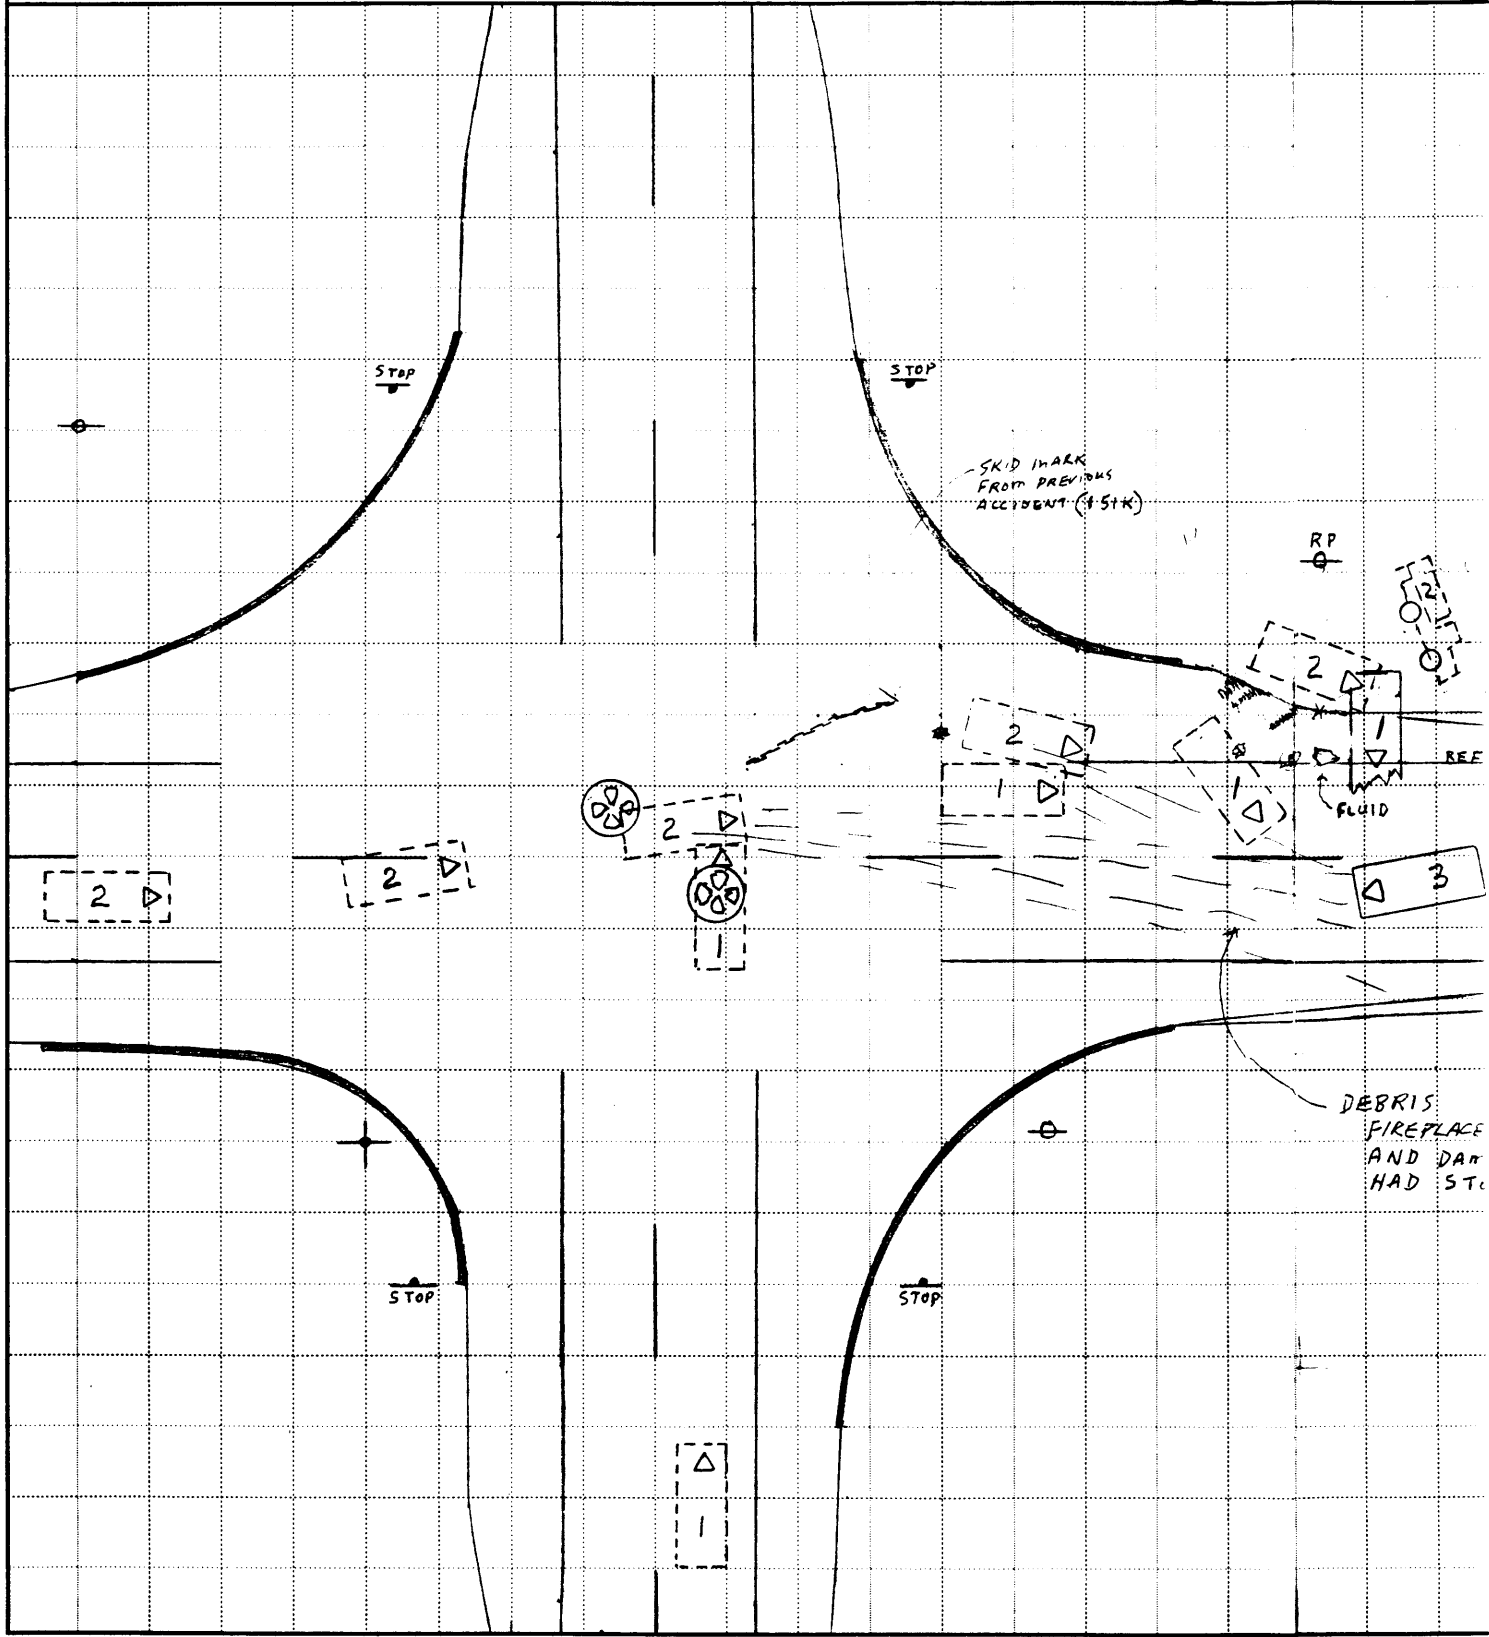

Department of Transportation

ACCIDENT COLLISION DIAGRAM

SAMPLING SYSTEM Highway Traffic Safety
VESS DATA SYSTEM

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM


9



No. 13

Case Number—Stratum 149A

Indicate North

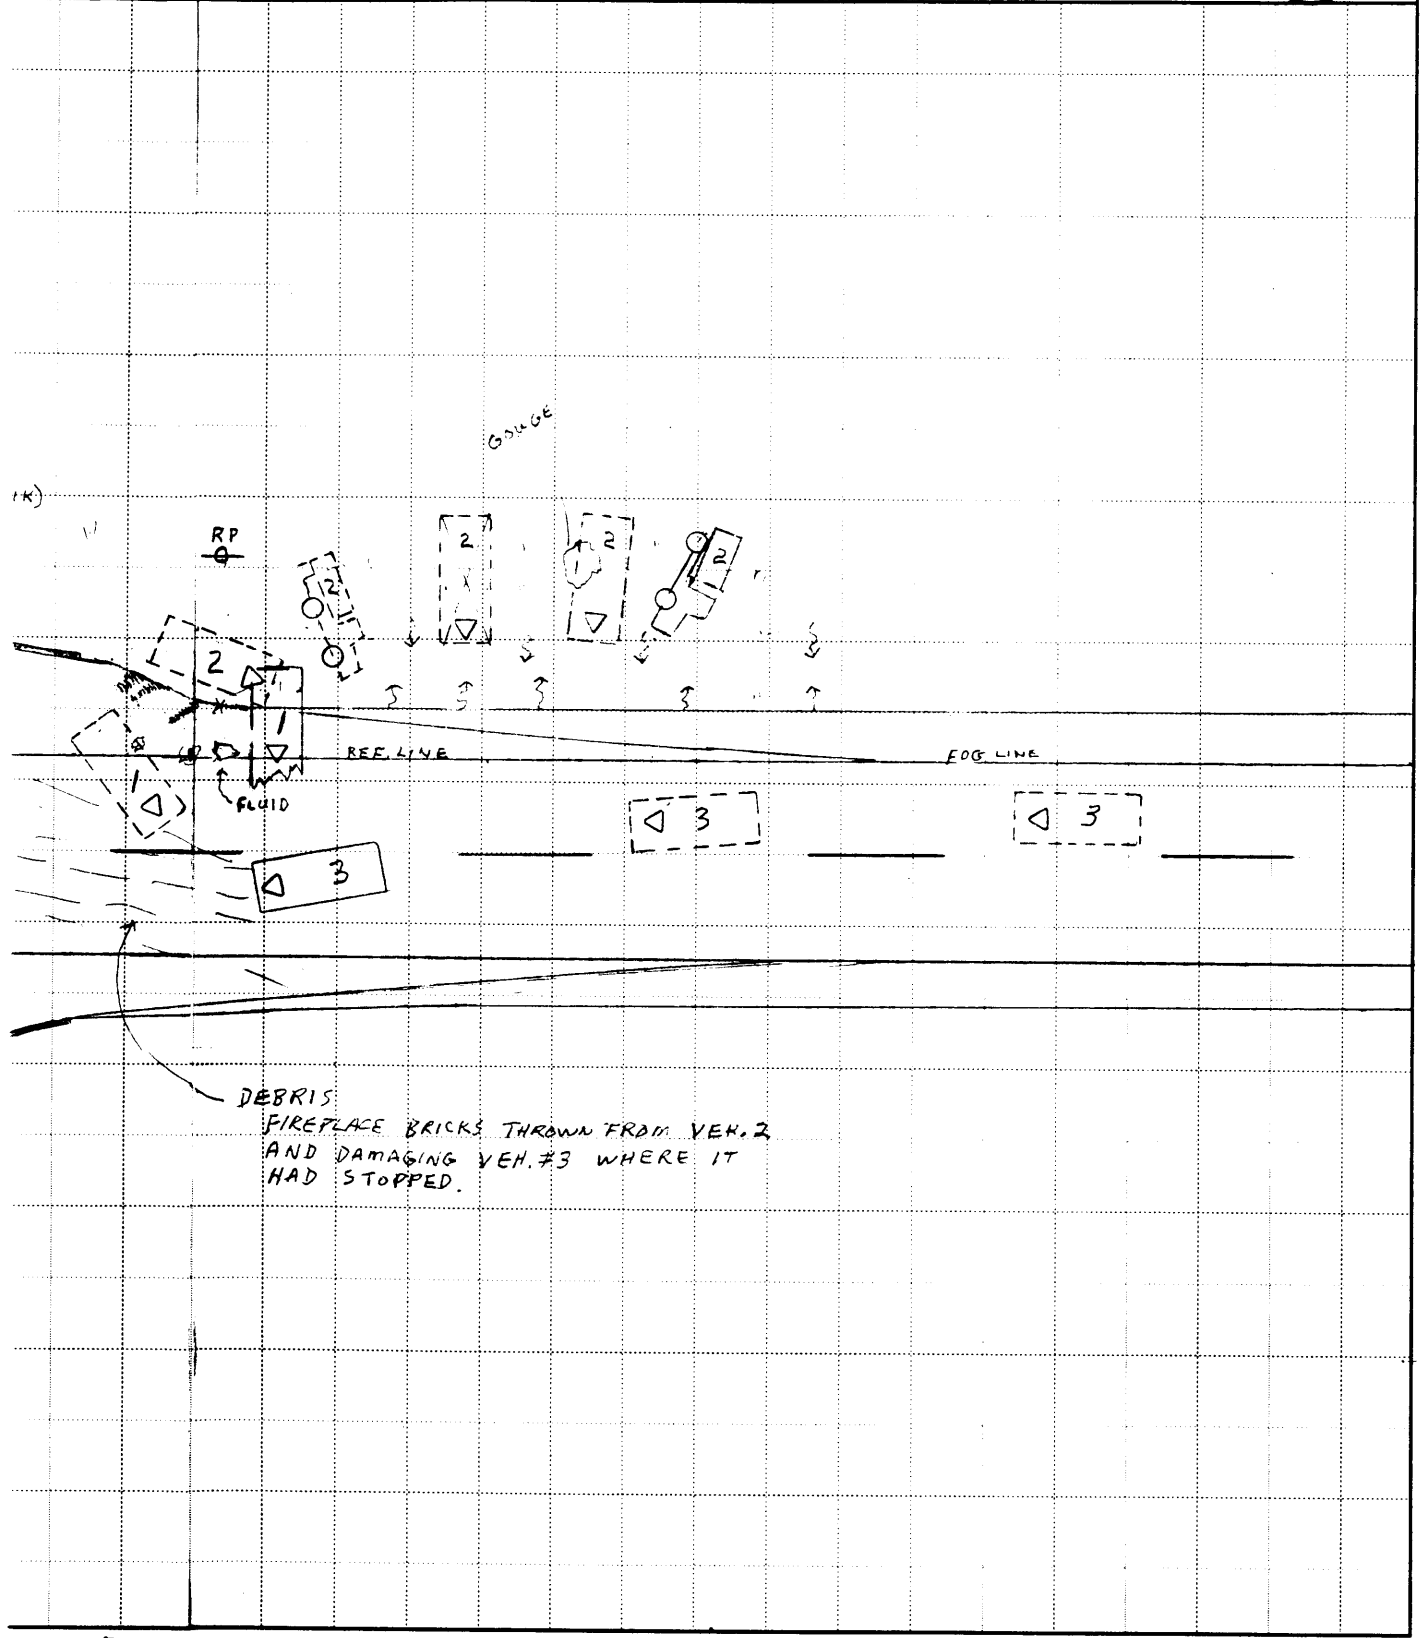

2.5 meters (1/95)

Scale: 1 centimeter = 2.5 meters




ACCIDENT COLLISION DIAGRAM

PSU No. 13

Case Number—Stratum 149A Field

Indicate
North

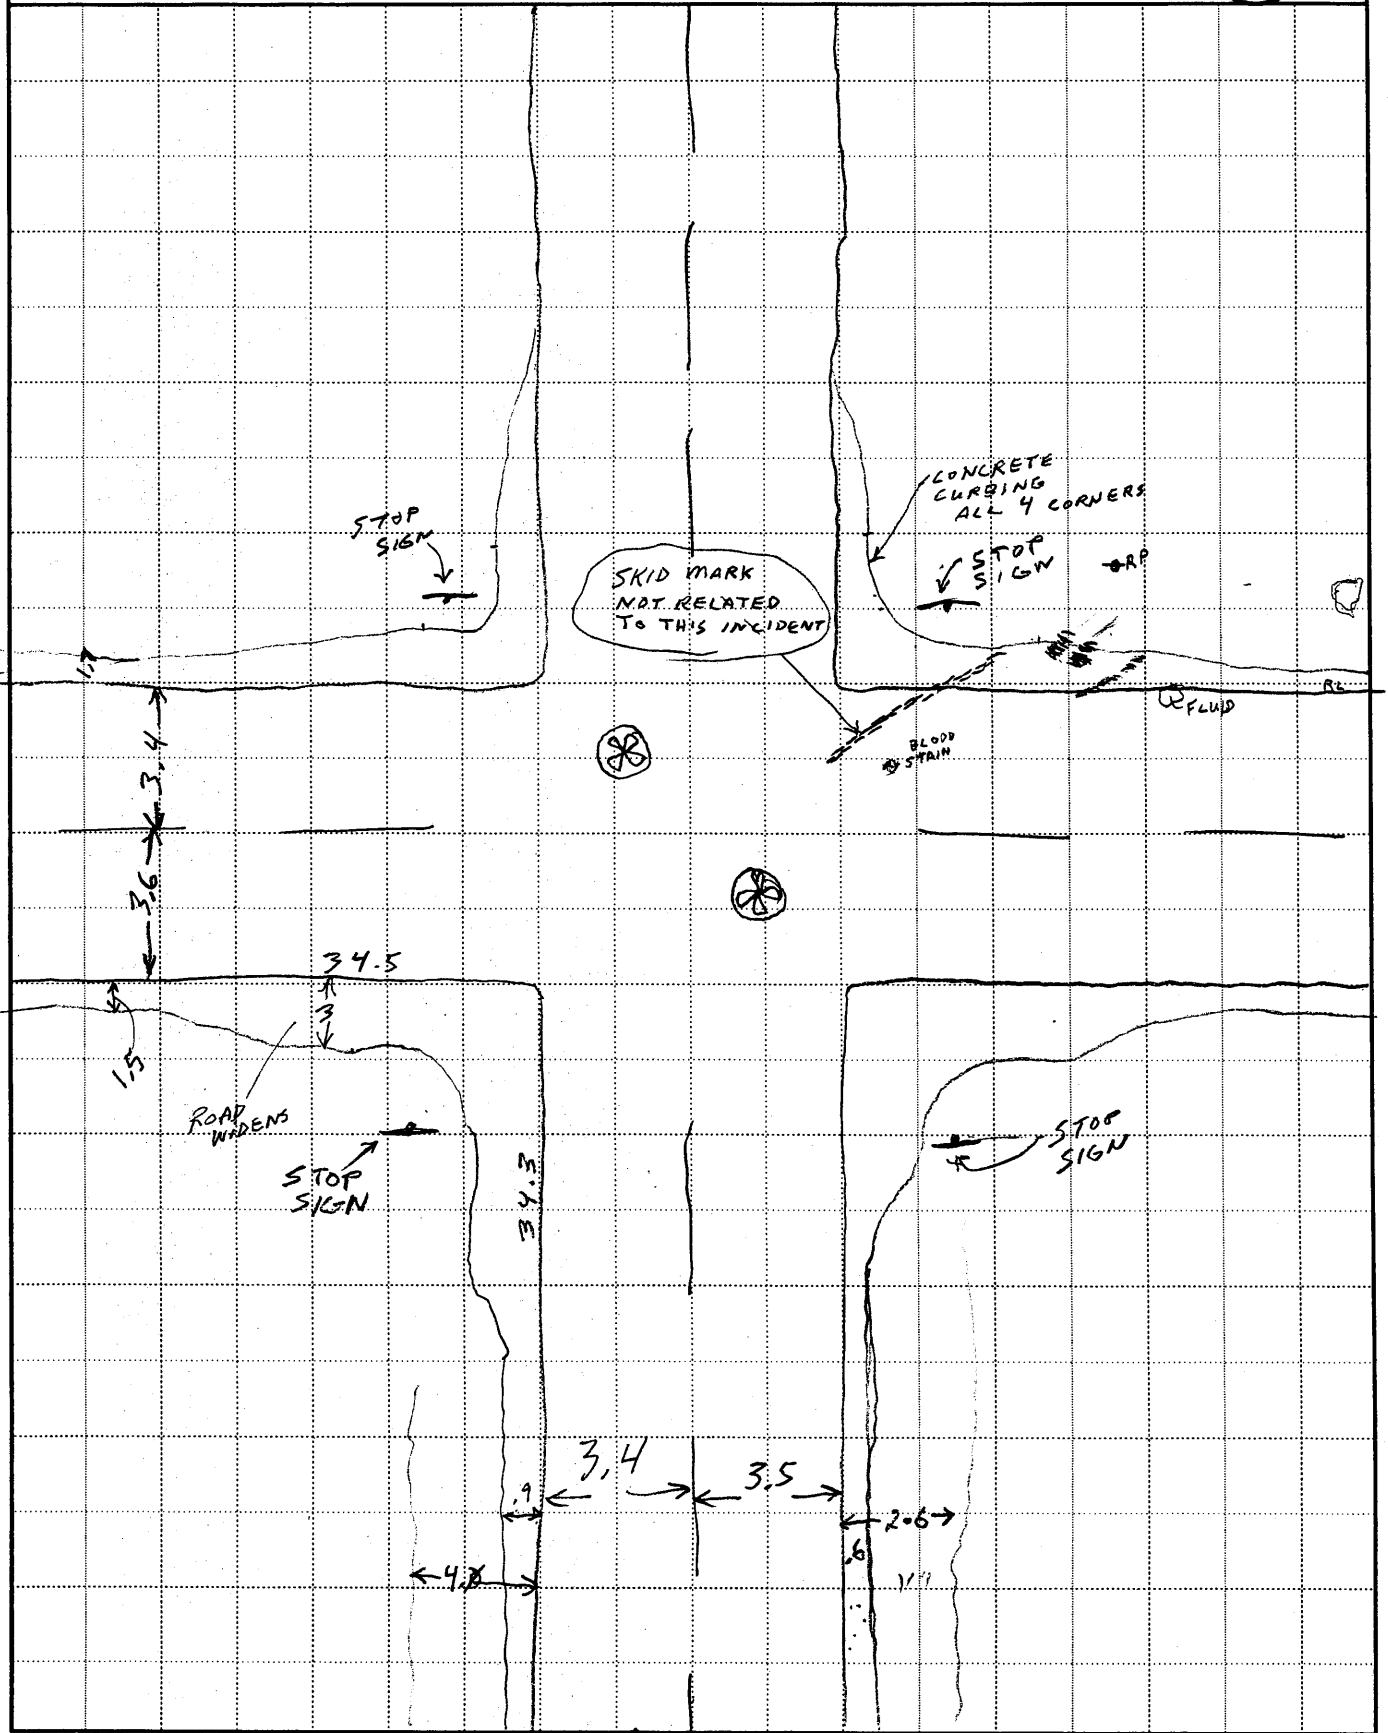



ACCIDENT COLLISION MEASUREMENT TABLE

Primary Sampling Unit Number 13

Case Number—Stratum 1494

ACCIDENT COLLISION DIAGRAM

Document the physical plant:

- * all road/roadway delineation (e.g., curbs/edge lines, lane markings, median markings, pavement markings, parked vehicles, poles, signs, etc.)
- * all traffic controls (e.g., speed limit)
- * north arrow placed on diagram
- * roadway surface type and condition of applicable roadways
- * grade measurements for all applicable roadways and at location of rollover initiation
- * roadway curvature

Document vehicle dynamics including:

- * reference point and reference line relative to physical features present at the scene
- * scaled documentation of all accident induced physical evidence
- * scaled documentation of all roadside objects contacted
- * scaled representations of the vehicle(s) at pre-impact, impact, and final rest based upon either:
 - a) physical evidence, or
 - b) reconstructed accident dynamics

CRASH DATA

	VEH. #1	VEH. #2	VEH. #3
Heading Angle	00 90	270	
Surface Type	Bituminous		
Surface Condition	Dry		
Coefficient of Friction	.71		
Grade (v/h) Measurement (between impact and final rest)	0		
Grade (v/h) Measurement (at location of rollover initiation)	-16/36		

Reference Point: Utility Pole Reference line: North Fog line
Square off North Fog line

Item	Distance and Direction from Reference Point	Distance and Direction from Reference Line
RP	0	7.2 N
ERR U-1	1.0 E	2.5 N
ELR U-1	2.6 E	2.5 N
ELR U-2 Trippoint	3.0 E	4.7 N
LR Side	5.3 E	5.0 N
EFT	7.5 E	8.9 N
Box corner	7.7 E	6.0 N
Box corner	9.3 E	6.1 N
Gouge	12.1 E	5.8 N
F FRP U-2	15.2 E	2.5 N
B FRP U-2	18.1 E	6.5 N
Fluid U-1	1.0 E	.2 N
Rear Track U-1	1.1 W	1.7 N

ACCIDENT FORM

1. Primary Sampling Unit Number 13
2. Case Number - Stratum 1494

IDENTIFICATION

3. Number of General Vehicle Forms Submitted 03
4. Date of Accident (Month, Day, Year) [redacted] / [redacted] / 9 5
5. Time of Accident 1700
Code reported military time of accident.
NOTE: Midnight = 2400
Unknown = 9999

SPECIAL STUDIES - INDICATORS

Check (✓) each special study (SS15-SS18 below) that has been completed; code 1 for the checked special studies and 0 for the special studies not checked.

6. SS15 Administrative Use 0
7. SS16 Pedestrian Crash Data Study 0
(Data for this special study available in a separate file.)
8. SS17 Impact Fires 0
9. SS18 Unsafe Driver Actions 0
10. SS19 _____ 0

NUMBER OF EVENTS

11. Number of Recorded Events in This Accident 04
03
Code the number of events which occurred in this accident.

ACCIDENT EVENTS

For each event that occurred in the accident, code the lowest numbered vehicle in the left columns and the other involved vehicle or object in the right columns.

Accident Event Sequence Number	Vehicle Number	Class Of Vehicle	General Area of Damage	Vehicle Number or Object Contacted	Class Of Vehicle	General Area of Damage
12. <u>0 1</u>	13. <u>01</u>	14. <u>20</u>	15. <u>F</u>	16. <u>02</u>	17. <u>45</u>	18. <u>R</u>
19. <u>03</u> 02	20. <u>03</u>	21. <u>02</u>	22. <u>F</u>	23. <u>79</u>	24. 00	25. 0
26. <u>04</u> 03	27. <u>02</u>	28. <u>45</u>	29. <u>T</u>	30. <u>31</u>	31. 00	32. <u>N</u>
33. <u>02</u> 04	34. <u>01</u>	35. <u>20</u>	36. <u>L</u>	37. <u>02</u>	38. <u>45</u>	39. <u>R</u>
40. <u>0 5</u>	41. _____	42. _____	43. _____	44. _____	45. _____	46. _____

IF GREATER THAN FIVE EVENTS, CONTINUE CODING ON THE ACCIDENT EVENT SUPPLEMENT

CODES FOR CLASS OF VEHICLE

- | | |
|--|---|
| (00) Not a motor vehicle
(01) Subcompact/mini (wheelbase < 254 cm)
(02) Compact (wheelbase ≥ 254 but < 265 cm)
(03) Intermediate (wheelbase ≥ 265 but < 278 cm)
(04) Full size (wheelbase ≥ 278 but < 291 cm)
(05) Largest (wheelbase ≥ 291 cm)
(09) Unknown passenger car size
(14) Compact utility vehicle
(15) Large utility vehicle (≤ 4,500 kgs GVWR)
(16) Utility station wagon (≤ 4,500 kgs GVWR)
(19) Unknown utility type
(20) Minivan (≤ 4,500 kgs GVWR)
(21) Large van (≤ 4,500 kgs GVWR)
(24) Van Based school bus (≤ 4,500 kgs GVWR)
(28) Other van type (≤ 4,500 kgs GVWR)
(29) Unknown van type (≤ 4,500 kgs GVWR)
(30) Compact pickup truck (≤ 4,500 kgs GVWR) | (31) Large pickup truck (≤ 4,500 kgs GVWR)
(38) Other pickup truck (≤ 4,500 kgs GVWR)
(39) Unknown pickup truck type (≤ 4,500 kgs GVWR)
(45) Other light truck (≤ 4,500 kgs GVWR)
(48) Unknown light truck type (≤ 4,500 kgs GVWR)
(49) Unknown light vehicle type
(50) School bus (excludes van based)(> 4,500 kgs GVWR)
(58) Other bus (> 4,500 kgs GVWR)
(59) Unknown bus type
(60) Truck (> 4,500 kgs GVWR)
(67) Tractor without trailer
(68) Tractor-trailer(s)
(78) Unknown medium/heavy truck type
(79) Unknown light/medium/heavy truck type
(80) Motored cycle
(90) Other vehicle
(99) Unknown |
|--|---|

CODES FOR GENERAL AREA OF DAMAGE (GAD)

- | | | | |
|---|--|--|---|
| CDS APPLICABLE
AND OTHER
VEHICLES | (O) Not a motor vehicle
(N) Noncollision
(F) Front | (R) Right side
(L) Left side
(B) Back | (T) Top
(U) Undercarriage
(9) Unknown |
| TDC
APPLICABLE
VEHICLES | (O) Not a motor vehicle
(N) Noncollision
(F) Front
(R) Right side | (L) Left side
(B) Back of unit with cargo area
(rear of trailer or straight truck)
(D) Back (rear of tractor) | (C) Rear of cab
(V) Front of cargo area
(T) Top
(U) Undercarriage
(9) Unknown |

CODES FOR VEHICLE NUMBER OR OBJECT CONTACTED

- | | |
|---|---|
| (01-30) — Vehicle Number

Noncollision
(31) Overturn — rollover (excludes end-over-end)
(32) Rollover — end-over-end
(33) Fire or explosion
(34) Jackknife
(35) Other intraunit damage (specify):

(36) Noncollision injury
(38) Other noncollision (specify):

(39) Noncollision — details unknown

Collision With Fixed Object
(41) Tree (≤ 10 cm in diameter)
(42) Tree (> 10 cm in diameter)
(43) Shrubbery or bush
(44) Embankment
(45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post
(50) Pole or post (≤ 10 cm in diameter)
(51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
(52) Pole or post (> 30 cm in diameter)
(53) Pole or post (diameter unknown)

(54) Concrete traffic barrier
(55) Impact attenuator
(56) Other traffic barrier (includes guardrail)
(specify): _____ | (57) Fence
(58) Wall
(59) Building
(60) Ditch or culvert
(61) Ground
(62) Fire hydrant
(63) Curb
(64) Bridge
(68) Other fixed object (specify):

(69) Unknown fixed object

Collision with Nonfixed Object
(70) Passenger car, light truck, van, or other vehicle
not in-transport
(71) Medium/heavy truck or bus not in-transport
(72) Pedestrian
(73) Cyclist or cycle
(74) Other nonmotorist or conveyance

(75) Vehicle occupant
(76) Animal
(77) Train
(78) Trailer, disconnected in transport
(79) Object fell from vehicle in-transport
(88) Other nonfixed object (specify):
<u>Flying Rocks</u>
(89) Unknown nonfixed object

(98) Other event (specify):

(99) Unknown event or object |
|---|---|

PRECRASH ENVIRONMENTAL DATA

19. Relation To Interchange Or Junction 2
- (0) Non-interchange area and non-junction
(1) Interchange area related

Non-Interchange junctions

- (2) Intersection related
(3) Driveway, alley access related
(4) Other junction (specify) _____
(5) Unknown type of junction
(9) Unknown

20. Trafficway Flow 0
- (0) Not physically divided (two way traffic)
(1) Divided trafficway-median strip without positive barrier
(2) Divided trafficway-median strip with positive barrier
(3) One way traffic
(9) Unknown

21. Number Of Travel Lanes 2
- (1) One
(2) Two
(3) Three
(4) Four
(5) Five
(6) Six
(7) Seven or more
(9) Unknown

22. Roadway Alignment 1
- (1) Straight
(2) Curve right
(3) Curve left
(9) Unknown

23. Roadway Profile 1
- (1) Level
(2) Uphill grade (>2%)
(3) Hill crest
(4) Downhill grade (>2%)
(5) Sag
(9) Unknown

24. Roadway Surface Type 2
- (1) Concrete
(2) Bituminous (asphalt)
(3) Brick or block
(4) Slag, gravel, or stone
(5) Dirt
(8) Other (specify): _____
(9) Unknown

25. Roadway Surface Condition 1
- (1) Dry
(2) Wet
(3) Snow or slush
(4) Ice
(5) Sand, dirt, or oil
(8) Other (specify): _____
(9) Unknown

26. Light Conditions 1
- (1) Daylight
(2) Dark
(3) Dark, but lighted
(4) Dawn
(5) Dusk
(9) Unknown

27. Atmospheric Conditions 0
- (0) No adverse atmospheric-related driving conditions
(1) Rain
(2) Sleet/hail
(3) Snow
(4) Fog
(5) Rain and fog
(6) Sleet and fog
(7) Other (e.g., smog, smoke, blowing sand or dust, etc.) (specify): _____
(9) Unknown

28. Traffic Control Device 2
- (0) No traffic control(s)
(1) Traffic control signal (not RR crossing)

Regulatory

- (2) Stop sign
(3) Yield sign
(4) School zone sign
(5) Other regulatory sign (specify): _____

- (6) Warning sign (not RR crossing)
(7) Unknown sign
(8) Miscellaneous/other controls including RR controls (specify): _____

- (9) Unknown

29. Traffic Control Device Functioning 2
- (0) No traffic control device
(1) Traffic control device not functioning (specify): _____
(2) Traffic control device functioning properly
(9) Unknown

OCCUPANT RELATED

37. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
38. Number of Occupants This Vehicle 03
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
39. Number of Occupant Forms Submitted 03

AIR BAG RELATED

40. Is this an AOPS Vehicle? 1
 (0) No (includes unknown)
 (1) Yes - researcher determined
 (2) VIN determined air bag system
 (3) VIN determined automatic (passive) belts
 (4) VIN determined air bag and automatic (passive) belts
41. Air Bag(s) Deployment, First Seat Frontal 2
 (0) Not equipped or not available
 (1) No air bags deployed
Single Air Bag Vehicle
 (2) Driver air bag deployed
 (3) Driver air bag, unknown if deployed
Multiple Air Bag Vehicle
 (4) Driver side only deployed
 (5) Passenger side only deployed
 (6) Driver and passenger side deployed
 (7) Driver and passenger side unknown if deployed
 (8) Air bag(s) deployed, details unknown
 (9) Unknown
42. Air Bag(s) Deployment, Other Than First Seat Frontal 0
 (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

Specify type of "other" air bag present: _____

VEHICLE WEIGHT ITEMS

43. Vehicle Curb Weight 1,550
 Code weight to nearest 10 kilograms.
 (045) Less than 450 kilograms
 (610) 6,100 kilograms or more
 (999) Unknown
3,410 lbs X .4536 = 1,547 kgs

Source: _____

44. Vehicle Cargo Weight 0,000
 Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (450) 4,500 kilograms or more
 (999) Unknown

lbs X .4536 = _____ kgs

Source: _____

ROLLOVER DATA

45. Rollover 00
 (00) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
 (01-16) Code the number of quarter turns
 (17) Rollover, 17 or more quarter turns (specify): _____
 (98) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (99) Rollover (overturn), details unknown
46. Rollover Initiation Type 00
 (00) No rollover
 (01) Trip-over
 (02) Flip-over
 (03) Turn-over
 (04) Climb-over
 (05) Fall-over
 (06) Bounce-over
 (07) Collision with another vehicle
 (08) Other rollover initiation type specify): _____
 (98) Rollover--end-over-end
 (99) Unknown rollover initiation type
47. Location of Rollover Initiation 0
 (0) No rollover
 (1) On roadway
 (2) On shoulder--paved
 (3) On shoulder--unpaved
 (4) On roadside or divided trafficway median
 (8) Rollover--end-over-end
 (9) Unknown
48. Rollover Initiation Object Contacted 00
 (Note: Applicable codes on back of page)
49. Location on Vehicle Where Initial Principal Tripping Force Is Applied 0
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (6) Non-contact rollover forces (specify): _____
 (8) Rollover--end-over-end
 (9) Unknown
50. Direction of Initial Roll 0
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (8) Rollover--end-over-end
 (9) Unknown roll direction

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

- (00) No rollover
- (01-30) – Vehicle Number

Noncollision

- (31) Turn-over – fall-over
- (32) No rollover impact initiation (end-over-end)
- (34) Jackknife

Collision With Fixed Object

- (41) Tree (\leq 10 cm in diameter)
- (42) Tree ($>$ 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

- (45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (\leq 10 cm in diameter)
- (51) Pole or post ($>$ 10 cm but \leq 30 cm in diameter)
- (52) Pole or post ($>$ 30 cm in diameter)
- (53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail)
(specify): _____

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify): _____

- (69) Unknown fixed object _____

Collision with Nonfixed Object

- (70) Passenger car, light truck, van, or other vehicle not in-transport
- (71) Medium/heavy truck or bus not in-transport
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify): _____

- (89) Unknown nonfixed object _____

- (98) Other event (specify): _____

- (99) Unknown event or object _____

7400

EXTERIOR VEHICLE FORM

1. Primary Sampling Unit Number <u>13</u>	3. Vehicle Number <u>01</u>
2. Case Number - Stratum <u>149A</u>	

VEHICLE IDENTIFICATION

VIN 1B4GH44R8N XXXXXXXXXX Model Year 92

Vehicle Make (specify): Dodge Vehicle Model (specify): CARAVAN SE

LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L	Location of Max Crush
<u>1</u>	<u>begins @ Front corner across</u>	<u>same</u>	<u>(R) Front corner</u>
	<u>142 to (R) Front corner</u>		

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

Specific Impact Number	Plane of Impact C-Measurements	Direct Damage		Field <u>28</u>	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Width (CDC)	Max Crush								
<u>1</u>	<u>Bumper Taper</u>	<u>142</u>	<u>53</u>	<u>142</u>	<u>49</u>	<u>39</u>	<u>24</u>	<u>37</u>	<u>53</u>	<u>53</u>	<u>0</u>
					<u>8</u>	<u>3</u>	<u>1</u>	<u>1</u>	<u>3</u>	<u>8</u>	
					<u>41</u>	<u>36</u>	<u>25</u>	<u>36</u>	<u>50</u>	<u>45</u>	
					<u>measurements questionable due to complete bumper separation and no measurement adjustments for that separation</u>						


ORIGINAL SPECIFICATIONS WORK SHEET

Wheelbase	<u>119.3</u>	inches	x	2.54	=	<u>303</u> cm
Overall Length	<u>192.8</u>	inches	x	2.54	=	<u>490</u> cm
Maximum Width	<u>72.0</u>	inches	x	2.54	=	<u>183</u> cm
Curb Weight	<u>3,410</u>	pounds	x	.4536	=	<u>1,547</u> kg
Average Track	_____	inches	x	2.54	=	_____ cm
Front Overhang	_____	inches	x	2.54	=	_____ cm
Rear Overhang	_____	inches	x	2.54	=	_____ cm
Undeformed End Width	_____	inches	x	2.54	=	<u>173</u> cm
Engine Size: cyl./displ.	_____	cc	x	.001	=	_____ L
	_____	CID	x	.0164	=	_____ L

VEHICLE DAMAGE SKETCH

<p>TIRE—WHEEL DAMAGE</p> <p>a. Rotation physically restricted</p> <p>RF <u>1</u> LF <u>1</u> RR <u>2</u> LR <u>2</u></p> <p>b. Tire deflated</p> <p>RF <u>1</u> LF <u>2</u> RR <u>2</u> LR <u>2</u></p> <p>(1) Yes (2) No (8) NA (9) Unk.</p>	<p>ORIGINAL SPECIFICATIONS</p> <p>Wheelbase <u>303</u> cm</p> <p>Overall Length <u>490</u> cm</p> <p>Maximum Width <u>183</u> cm</p> <p>Curb Weight <u>1547</u> kg</p> <p>Average Track <u>measured 152</u> cm</p> <p>Front Overhang <u>measured 83</u> cm</p> <p>Rear Overhang <u>measured 99</u> cm</p> <p>Undeformed End Width <u>173</u> cm</p> <p>Engine Size: cyl./displ. <u>V6/3.3</u> L</p>	<p>WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only)</p> <p>RF \oplus <u>05</u> °</p> <p>LF \oplus <u>10</u> °</p> <p>RR \pm <u>X</u> °</p> <p>LR \pm <u>X</u> °</p> <p>Within \pm 5 degrees</p>
<p>TYPE OF TRANSMISSION</p> <p><input type="checkbox"/> Manual <input checked="" type="checkbox"/> Automatic</p> <p>END SHIFT \geq 10 CM</p> <p><input type="checkbox"/> Yes <input type="checkbox"/> No</p>	<p>DRIVE WHEELS</p> <p><input checked="" type="checkbox"/> FWD <input type="checkbox"/> RWD <input type="checkbox"/> 4WD</p> <p>Approximate Cargo Weight <u>0</u> kg</p>	

MEASUREMENTS IN CENTIMETERS

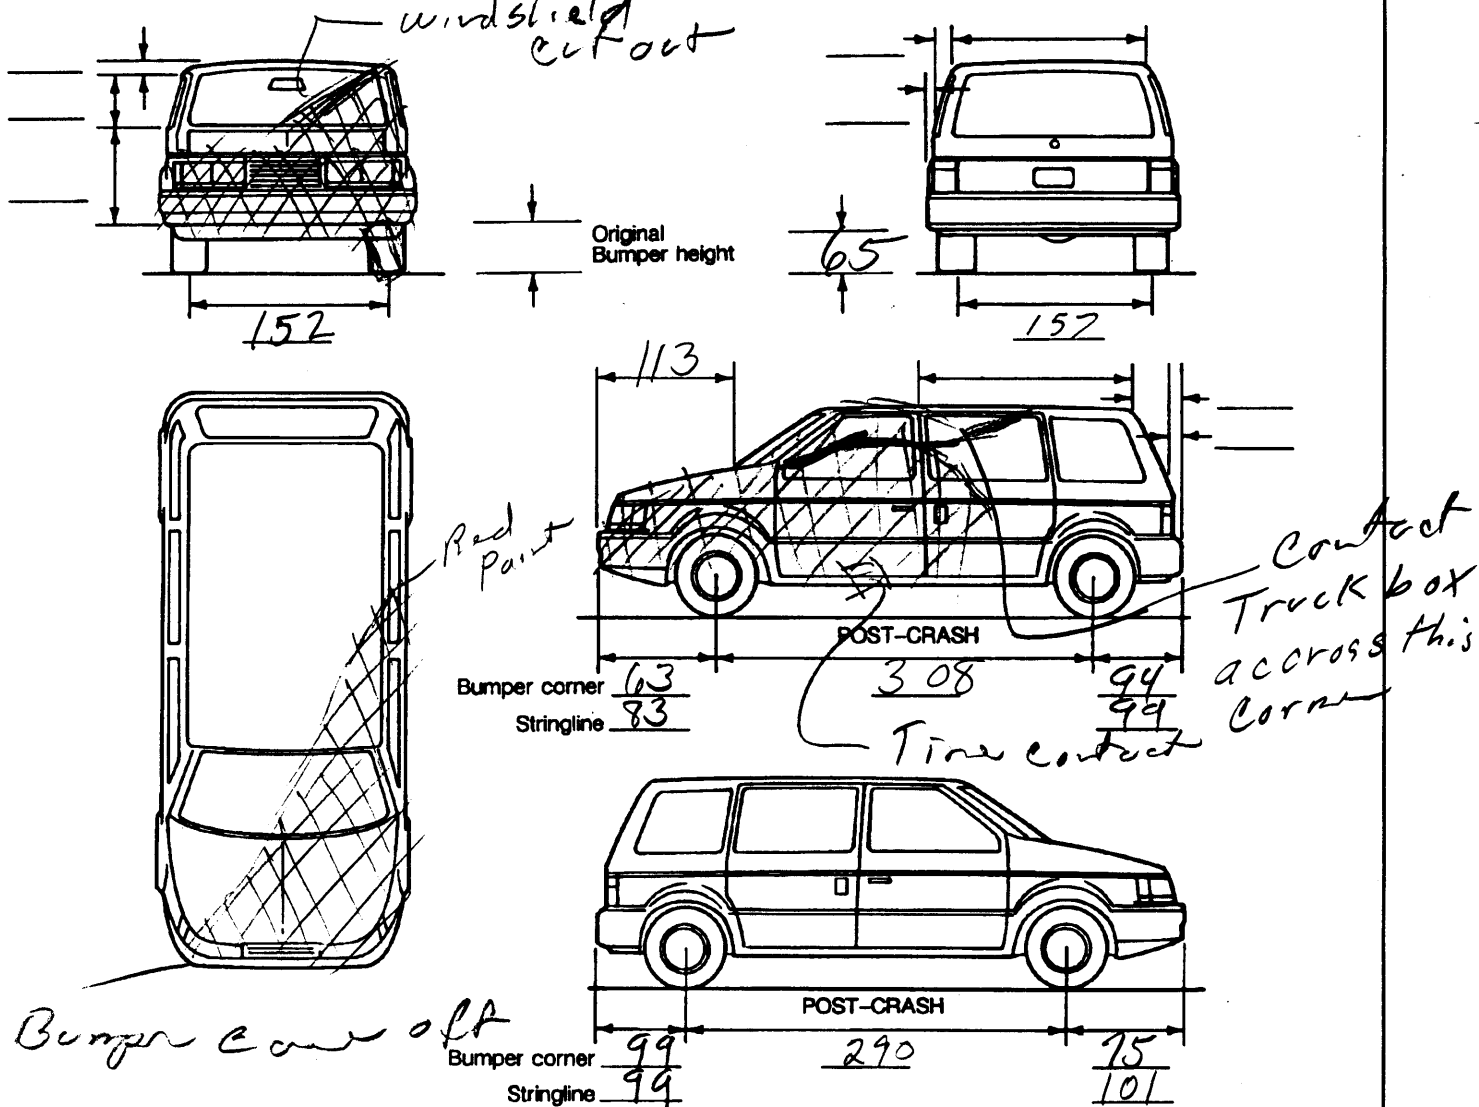

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page. Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>02</u>	6. <u>10</u>	7. <u>F</u>	8. <u>D</u>	9. <u>A</u>	10. <u>W</u>	11. <u>09</u>

Second Highest Delta "V"

12. <u>02</u>	13. <u>02</u>	14. <u>99</u>	15. <u>9</u>	16. <u>9</u>	17. <u>9</u>	18. <u>9</u>	19. <u>99</u>
---------------	---------------	---------------	--------------	--------------	--------------	--------------	---------------

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
<u>173</u>	<u>049</u>	<u>039</u>	<u>024</u>	<u>037</u>	<u>053</u>	<u>053</u>	<u>+ 000</u>

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D
---	---	---	---	---	---	---	<u>+</u> <u>-</u>

26. Undeformed End Width (Coded when highest severity impact is an end plane impact.) 173
 Code to the nearest centimeter
 (250) 250 centimeters or more
 (998) No highest severity end plane impact
 (999) Unknown

27. Direct Damage Width (For highest severity impact) 142
 Code to the nearest centimeter
 (250) 250 centimeters or more
 (999) Unknown

28. Original Wheelbase 303
 Code to the nearest centimeter
 (650) 650 centimeters or more
 (999) Unknown
 _____ inches X 2.54 = _____ centimeters

29. Original Average Track Width 152
 Code to the nearest centimeter
 (185) 185 centimeters or more
 (999) Unknown
 _____ inches X 2.54 = _____ centimeters

30. Are CDCs Documented but Not Coded on The Automated File? 0
 (0) No
 (1) Yes

31. Researcher's Assessment of Vehicle Disposition 1
 (0) Not towed due to vehicle damage
 (1) Towed due to vehicle damage
 (9) Unknown

32. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle? 0
 (0) No post manufacturer modifications
 (1) Yes - post manufacturer modifications (specify): _____

 (Include photograph of CERTIFICATION PLACARD in case report)
 (9) Unknown if vehicle is modified

FUEL SYSTEM

35. Location of Fuel Tank-1 Filler Cap 2

36. Location of Fuel Tank-2 Filler Cap 0
 (0) No fuel tank
 (1) On back plane
 (2) Aft of center of the rear wheels (rear axle) on left side plane
 (3) Aft of center of the rear wheels (rear axle) on right side plane
 (4) Forward of center of the rear wheels (rear axle) on left side plane
 (5) Forward of center of the rear wheels (rear axle) on right side plane
 (6) Over the center of the rear wheels (rear axle) on left side plane
 (7) Over the center of the rear wheels (rear axle) on right side plane
 (8) Other (specify): _____
 (9) Unknown

37. Type of Fuel Tank-1 1

38. Type of Fuel Tank-2 0
 (0) No fuel tank (electrical vehicle)
 (1) Metallic
 (2) Non-metallic
 (9) Unknown

FIRE OCCURRENCE

33. Fire Occurrence 0
 (0) No fire
 Yes, fire occurred
 (1) Minor
 (2) Major
 (9) Unknown

34. Origin of Fire 0
 (0) No fire
 (1) Vehicle exterior (front, side, back, top)
 (2) Exhaust system
 (3) Fuel tank (and other fuel retention system parts)
 (4) Engine compartment
 (5) Cargo/trunk compartment
 (6) Instrument panel
 (7) Passenger compartment area
 (8) Other location (specify): _____
 (9) Unknown

39. Location of Fuel Tank-1 0

40. Location of Fuel Tank-2 0
 (0) No fuel tank
 (1) Aft of center of the rear wheels (rear axle) centered
 (2) Aft of center of the rear wheels (rear axle) left side
 (3) Aft of center of the rear wheels (rear axle) right side
 (4) Forward of center of the rear wheels (rear axle) centered
 (5) Forward of center of the rear wheels (rear axle) left side
 (6) Forward of center of the rear wheels (rear axle) right side
 (7) Over center of the rear wheels (rear axle)
 (8) Other (specify): _____
 (9) Unknown

41. Damage to Fuel Tank-1 0

42. Damage to Fuel Tank-2 0
 (0) No fuel tank
 (1) No damage to fuel tank
 (2) Deformed, no seam failure
 (3) Deformed, with a seam failure
 (4) Punctured
 (5) Lacerated (ripped)
 (6) Abraded (scraped)
 (7) Filler neck separation from the fuel tank
 (8) Other damage (specify): _____
 (9) Unknown



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 13
 2. Case Number - Stratum 149A
 3. Vehicle Number 01

INTEGRITY

4. Passenger Compartment Integrity 12
 (00) No integrity loss

Yes, Integrity Was Lost Through *4/2/94*

(01) Windshield
 (02) Door (side)
 (03) Door/hatch (back door)
 (04) Roof
 (05) Roof glass
 (06) Side window
 (07) Rear window (backlight)
 (08) Roof and roof glass
 (09) Windshield and door (side)
 (10) Windshield and roof
 (11) Side and rear window (side window and backlight)
 (12) Windshield and side window
 (13) Door and side window
 (98) Other combination of above (specify):

 (99) Unknown

Door, Tailgate or Hatch Opening

5. LF 3 6. RF 3 7. LR 0 8. RR 3 9. TG/H 3

(0) No door/gate/hatch
 (1) Door/gate/hatch remained closed and operational
 (2) Door/gate/hatch came open during collision
 (3) Door/gate/hatch jammed shut
 (8) Other (specify):

 (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 0 11. RF 6 12. LR 0 13. RR 0 14. TG/H 0

(0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

(1) Door operational (no damage)
 (2) Latch/striker failure due to damage
 (3) Hinge failure due to damage
 (4) Door structure failure due to damage
 (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
 (6) Latch/striker and hinge failure due to damage
 (8) Other failure (specify):

 (9) Unknown

GLAZING

Type of Window/Windshield Glazing

15. WS 1 16. LF 2 17. RF 2 18. LR 2 19. RR 2
 20. BL 2 21. Roof 0 22. Other 2

(0) No glazing
 (1) AS-1 - Laminated
 (2) AS-2 - Tempered
 (3) AS-3 - Tempered-tinted (original)
 (4) AS-2 - Tempered-with after market tint
 (5) AS-3 - Tempered-tinted (with additional after market tint)
 (6) AS-14 - Glass/Plastic
 (7) Glazing removed prior to accident
 (8) Other (specify):

 (9) Unknown

Window Precrash Glazing Status

23. WS 1 24. LF 2 25. RF 2 26. LR 2 27. RR 2
 28. BL 1 29. Roof 0 30. Other 2

(0) No glazing
 (1) Fixed
 (2) Closed
 (3) Partially opened
 (4) Fully opened
 (7) Glazing removed prior to accident
 (9) Unknown

Glazing Damage from Impact Forces

31. WS 2 32. LF 6 33. RF 6 34. LR 6 35. RR 6
 36. BL 1 37. Roof 0 38. Other 6

(0) No glazing
 (1) No glazing damage from impact forces
 (2) Glazing in place and cracked from impact forces
 (3) Glazing in place and holed from impact forces
 (4) Glazing out-of-place (cracked or not) and not holed from impact forces
 (5) Glazing out-of-place and holed from impact forces
 (6) Glazing disintegrated from impact forces
 (7) Glazing removed prior to accident
 (9) Unknown if damaged


Glazing Damage from Occupant Contact

39. WS 1 40. LF 1 41. RF 1 42. LR 1 43. RR 1
 44. BL 1 45. Roof 0 46. Other 1

(0) No glazing
 (1) No occupant contact to glazing
 (2) Glazing contacted by occupant but no glazing damage
 (3) Glazing in place and cracked by occupant contact
 (4) Glazing in place and holed by occupant contact
 (5) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
 (6) Glazing out-of-place by occupant contact and holed by occupant contact
 (7) Glazing removed prior to accident
 (8) Glazing disintegrated by occupant contact
 (9) Unknown if contacted by occupant

INTRUSION WORKSHEET

Note: Sketch intruded areas

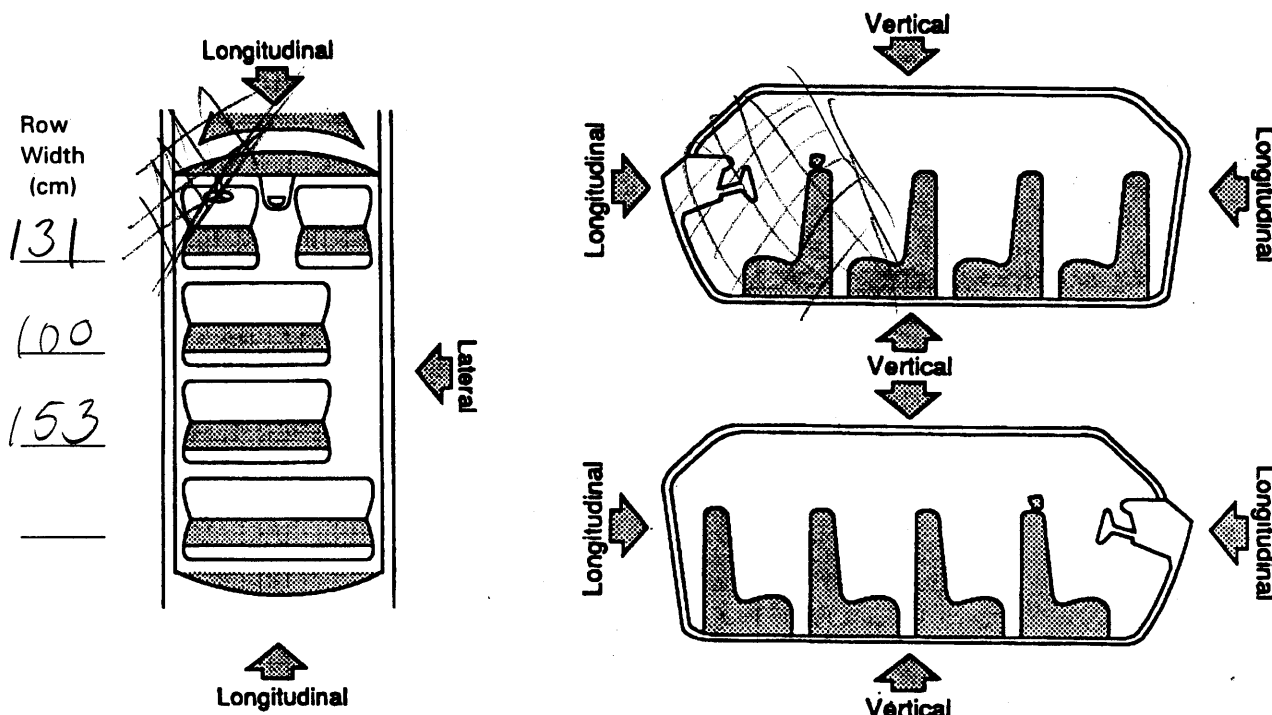

LOCATION OF INTRUSION	INTRUDED COMPONENT	(All Measurements Are In Centimeters)				DOMINANT CRUSH DIRECTION
		COMPARISON VALUE	INTRUDED VALUE	INTRUSION		
11	Door panel 11	62	41	21	Lat	
11	Apron 06	61	20	41	Lat	
11	Side Rail 14	62	19	43	Lat	
21	Backrest 07	72	45	27	Lat	
21	Panel	78	58	20	Long	
21	14	62	45	17	Long	
12	Steering wheel	86	57	29	Lat	

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Side panel - forward of the A1/A2-pillar
- (11) Door panel (side)
- (12) Side panel - rear of the B-pillar
- (13) Roof (or convertible top)
- (14) Roof side rail
- (15) Windshield
- (16) Windshield header
- (17) Window frame
- (18) Floor pan (includes sill)
- (19) Backlight header
- (20) Front seat back
- (21) Second seat back
- (22) Third seat back
- (23) Fourth seat back
- (24) Fifth seat back
- (25) Seat cushion
- (26) Back door/panel (e.g., tailgate)
- (27) Other interior component (specify): _____

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify): _____
- (32) Other exterior object in the environment (specify): _____
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify): _____
- (99) Unknown

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
--	-----------------------	---------------------	------------------------	--------------------------

1st 47. 11 48. 14 49. 4 50. 2

2nd 51. 11 52. 06 53. 4 54. 3

3rd 55. 12 56. 01 57. 3 58. 3

4th 59. 11 60. 07 61. 3 62. 3

5th 63. 11 64. 11 65. 3 66. 3

6th 67. 21 68. 12 69. 3 70. 2

7th 71. 21 72. 14 73. 3 74. 2

8th 75. _____ 76. _____ 77. _____ 78. _____

9th 79. _____ 80. _____ 81. _____ 82. _____

10th 83. _____ 84. _____ 85. _____ 86. _____

LOCATION OF INTRUSION

Front Seat

- (11) Left
- (12) Middle
- (13) Right

Second Seat

- (21) Left
- (22) Middle
- (23) Right

Third Seat

- (31) Left
- (32) Middle
- (33) Right

Fourth Seat

- (41) Left
- (42) Middle
- (43) Right

- (97) Catastrophic
- (98) Other enclosed area (specify) _____

(99) Unknown

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)




COMPARISON VALUE	—	DAMAGE VALUE	=	DEFORMATION
------------------	---	--------------	---	-------------

	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--


	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--

STEERING COLUMN	INSTRUMENT PANEL
<p>87. Steering Column Type <u>2</u></p> <p>(1) Fixed column (2) Tilt column (3) Telescoping column (4) Tilt and telescoping column (8) Other column type (specify): _____ (9) Unknown</p> <p>88. Tilt Steering Column Adjustment <u>9</u></p> <p>(0) No tilt steering column (1) Full up (2) Between full up and center (3) Center (4) Between center and full down (5) Full down (9) Unknown</p> <p>89. Telescoping Steering Column Adjustment <u>0</u></p> <p>(0) No telescoping steering column (1) Full back (2) Between full back and midpoint (3) Midpoint (4) Between midpoint and full forward (5) Full forward (9) Unknown</p> <p>90. Steering Rim/Spoke Deformation <u>15</u></p> <p>Code actual measured deformation to the nearest centimeter (00) No steering rim deformation (01-14) Actual measured value in centimeters (15) 15 centimeters or more (98) Observed deformation cannot be measured (99) Unknown</p> <p>91. Location of Steering Rim/Spoke Deformation <u>09</u></p> <p>(00) No steering rim deformation</p> <p><i>Quarter Sections</i></p> <p>(01) Section A (02) Section B (03) Section C (04) Section D</p> <div style="display: flex; align-items: center; gap: 20px;">   </div> <p><i>Half Sections</i></p> <p>(05) Upper half of rim/spoke (06) Lower half of rim/spoke (07) Left half of rim/spoke (08) Right half of rim/spoke</p> <div style="display: flex; align-items: center; gap: 20px;">  </div> <p>(09) Complete steering wheel collapse (10) Undetermined location (99) Unknown</p>	<p>92. Odometer Reading <u>999,000</u></p> <p>_____ kilometers Code to the nearest 1,000 kilometers (000) No odometer (001) Less than 1,500 kilometers (500) 499,500 kilometers or more (999) Unknown</p> <p>_____ miles X 1.6093 = _____ kilometers</p> <p>Source [REDACTED]</p> <p>93. Instrument Panel Damage from Occupant Contact? <u>1</u></p> <p>(0) No (1) Yes (9) Unknown</p> <p>94. Type of Knee Bolster Covering <u>2</u></p> <p>(0) No knee bolster (1) Padded (2) Rigid plastic (8) Other (specify): _____ (9) Unknown</p> <p>95. Knee Bolsters Deformed from Occupant Contact? <u>2</u></p> <p>(0) No knee bolster (1) No deformation (2) Yes - deformation (9) Unknown</p> <p>96. Did Glove Compartment Door Open During Collision(s)? <u>1</u></p> <p>(0) No glove compartment door (1) No - door did not open (2) Yes - door opened (9) Unknown</p> <p>97. Adaptive (Assistive) Driving Equipment <u>0</u></p> <p>(0) No adaptive driving equipment (1) Adaptive driving equipment installed (Check all that apply.)</p> <p><input type="checkbox"/> Hand controls for braking/acceleration <input type="checkbox"/> Steering control devices (attached to OEM steering wheel) <input type="checkbox"/> Steering knob attached to steering wheel <input type="checkbox"/> Low effort power steering (unit or device) <input type="checkbox"/> Replacement steering wheel (i.e., reduced diameter) <input type="checkbox"/> Joy-stick steering controls <input type="checkbox"/> Wheelchair tie-downs <input type="checkbox"/> Modification to seat belts (specify): _____</p> <p><input type="checkbox"/> Additional or relocated switches (specify): _____</p> <p><input type="checkbox"/> Raised roof <input type="checkbox"/> Wall-mounted head rest (used behind wheelchair) <input type="checkbox"/> Other adaptive device (specify): _____</p> <p>(9) Unknown</p>

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

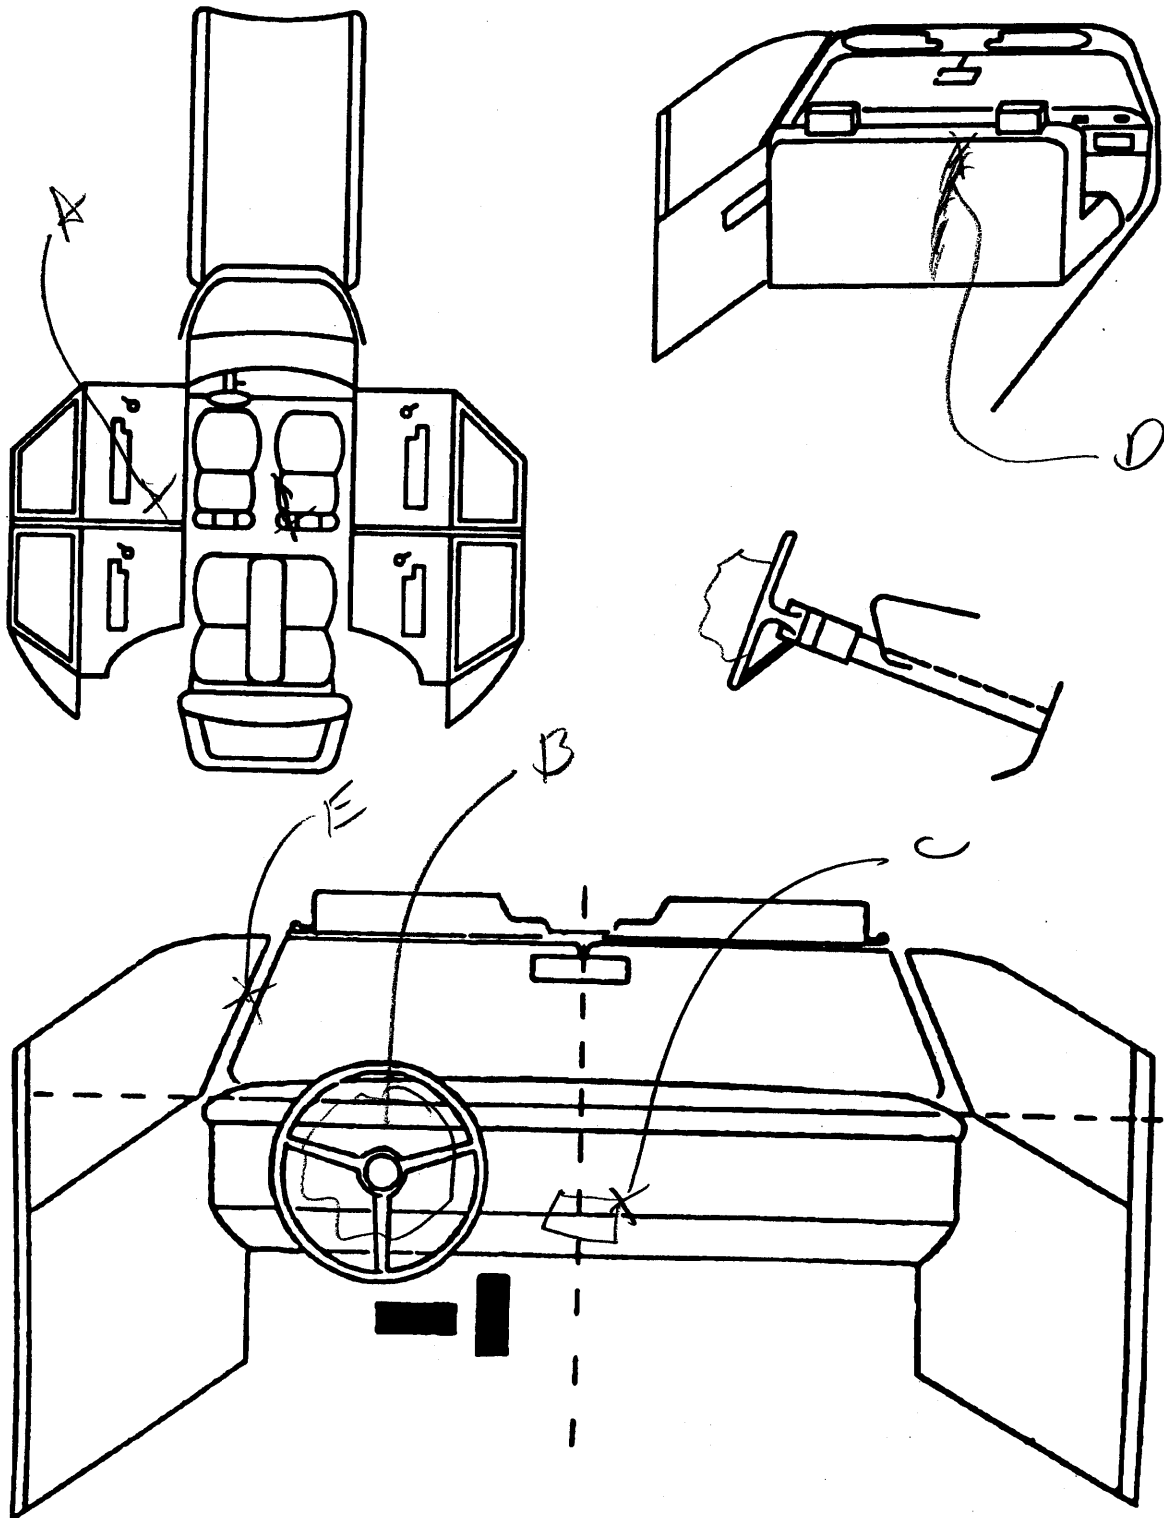

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure.
 Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.
 Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Cup Holder

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	051	1	Hip	blood Flare ✓	1
B	170	1	Face	blood SKIN Flare ✓	1
C	011	2	Leg	prop can part shoulder	1
D	151	3	body	SKIN blood	1
E	075	1	Head	HAIR	1
F					
G					
H					
I					
J					
K					
L					
M					
N					

CODES FOR INTERIOR COMPONENTS

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object, (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests
- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (175) Air bag compartment cover-driver side
- (180) Air bag-passenger side
- (185) Air bag compartment cover-passenger side
- (190) Other air bag (specify) _____
- (195) Other air bag compartment cover (specify) _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof
- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form. If a Child safety seat is present, encode the data on the back of this page. If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous page.

		Left	Center	Right
F I R S T	Availability	4	X	4
	Evidence of usage	0.4		0.4
	Used in this crash?	0		0
	Proper Use	0		0
	Failure Modes	0		0
	Anchorage Adjustment	1		1
S E C O N D	Availability	4	4	X
	Evidence of usage	0.4	0.4	
	Used in this crash?	0	0	
	Proper Use	0	0	
	Failure Modes	0	0	
	Anchorage Adjustment	0	0	
O T H E R	Availability	4	4	4
	Evidence of usage	0.4	0.4	0.4
	Used in this crash?	0	0	0
	Proper Use	0	0	0
	Failure Modes	0	0	0
	Anchorage Adjustment	1	1	1

Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

- (9) Unknown

Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of manual belt system (specify): _____

- (9) Unknown

Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other manual belt failure (specify): _____
- (9) Unknown

Shoulder Belt Upper Anchorage Adjustment

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Left Front	Right Front	Other
F I R S T	Availability/Function	/	 	
	Deployment	/	 	
	Failure	/	 	

- | | | |
|--|---|---|
| <p>Air Bag System Availability/Function
 (0) Not equipped/not available
 (1) Air bag</p> <p><i>Non-functional</i>
 (2) Air bag disconnected (specify): _____</p> <p>(3) Air bag not reinstalled
 (9) Unknown</p> <p>Are There Indications of Air Bag System Failure? (This Occupant Position)
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify): _____</p> <p>(9) Unknown</p> | <p>Frontal Air Bag System Deployment (This Occupant Position)
 (0) Not equipped/not available
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, accident sequence undetermined
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown</p> | <p>Air Bag(s) Deployment, <u>Other</u> Than First Seat Frontal (This Occupant Position)
 (0) Not equipped with an "<u>other</u>" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown</p> |
|--|---|---|

AUTOMATIC BELTS

		Left	Right
F I R S T	Availability/Function	 	
	Use	 	
	Type	 	
	Proper Use	 	
	Failure Modes	 	

- | | | |
|--|---|---|
| <p>Automatic (Passive) Belt System Availability/Function
 (0) Not equipped/not available
 (1) 2 point automatic belts
 (2) 3 point automatic belts
 (3) Automatic belts - type unknown</p> <p><i>Non-functional</i>
 (4) Automatic belts destroyed or rendered inoperative
 (9) Unknown</p> <p>Automatic (Passive) Belt System Use
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Automatic belt in use
 (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
 (3) Automatic belt use unknown
 (9) Unknown</p> <p>Automatic (Passive) Belt System Type
 (0) Not equipped/not available
 (1) Non-motorized system
 (2) Motorized system
 (9) Unknown</p> | <p>Proper Use of Automatic (Passive) Belt System
 (0) Not equipped/not available/not used
 (1) Automatic belt used properly
 (2) Automatic belt used properly with child safety seat</p> <p><i>Automatic Belt Used Improperly</i>
 (3) Automatic shoulder belt worn under arm
 (4) Automatic shoulder belt worn behind back
 (5) Automatic belt worn around more than one person
 (6) Lap portion of automatic belt worn on abdomen
 (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____</p> <p>(8) Other improper use of automatic belt system (specify): _____
 (9) Unknown</p> | <p>Automatic (Passive) Belt Failure Modes During Accident
 (0) Not equipped/not available/not in use
 (1) No automatic belt failure(s)
 (2) Torn webbing (stretched webbing not included)
 (3) Broken buckle or latchplate
 (4) Upper anchorage separated
 (5) Other anchorage separated (specify): _____</p> <p>(6) Broken retractor
 (7) Combination of above (specify): _____
 (8) Other automatic belt failure (specify): _____
 (9) Unknown</p> |
|--|---|---|

FIRST SEAT FRONTAL AIR BAGS


NOTES: Encode the applicable data *for the driver and first seat passenger* in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

	Driver	Passenger
Type of air bag?	1	
Flaps open at tear points?	2	
Flaps damaged?	1	
Air bag damaged?	01	
Source of air bag damage	01	
Air bag tethered?	2	
Air bag have vent ports?	2	
Other occupant contact air bag?	2	
Occupant wearing eyewear?		


<p>Type of Air Bag</p> <p>(0) Not equipped/not available (1) Original manufacturer installed system (2) Retrofitted air bag (3) Replacement air bag (8) Unknown type of air bag (9) Unknown</p> <p>Did Air Bag Module Cover Flap(s) Open At Designated Tear Points?</p> <p>(0) Not equipped/not available (1) No (2) Yes (3) Deployed, unknown if flap(s) opened at designated tear points (7) Not deployed (8) Unknown if deployed (9) Unknown</p> <p>Were Air Bag Module Cover Flap(s) Damaged?</p> <p>(0) Not equipped/not available (1) No (2) Yes (specify): (3) Deployed, unknown if air bag module cover flap(s) damaged (7) Not deployed (8) Unknown if deployed (9) Unknown</p>	<p>Was There Damage To The Air Bag?</p> <p>(00) Not equipped/not available (01) Not damaged</p> <p><i>Yes - Air Bag Damage</i></p> <p>(02) Ruptured (03) Cut (04) Torn (05) Holed (06) Burned (07) Abraded (88) Other damage (specify): (95) Damaged, details unknown (96) Deployed, unknown if damaged (97) Not deployed (98) Unknown if deployed (99) Unknown</p> <p>Source of Air Bag Damage</p> <p>(00) Not equipped/not available (01) Not damaged (02) Object worn by occupant, (specify): (03) Object carried by occupant, (specify): (04) Adaptive/assistive controls, (specify): (05) Fire in vehicle (06) Thermal burns (07) Rescue or emergency efforts (88) Other damage source (specify): (95) Damaged, unknown source (96) Deployed, unknown if damaged (97) Not deployed (98) Unknown if deployed (99) Unknown</p>	<p>Was The Air Bag Tethered?</p> <p>(0) Not equipped/not available (1) No (2) Yes (specify number of tether straps): <u>3</u> (3) Deployed, unknown if tethered (7) Not deployed (8) Unknown if deployed (9) Unknown</p> <p>Did The Air Bag Have Vent Ports?</p> <p>(0) Not equipped/not available (1) No (2) Yes (specify number of vent ports): <u>2</u> (3) Deployed, unknown if vent ports present (7) Not deployed (8) Unknown if deployed (9) Unknown</p> <p>Was the Air Bag in this Occupant's Position Contacted by Another Occupant?</p> <p>(0) Not equipped/not available (1) No (2) Yes (specify): <u>Passenger</u> (3) Deployed/unknown if other occupant contact to air bag (7) Not deployed (8) Unknown if deployed (9) Unknown</p> <p>Was This Occupant Wearing Eye-wear?</p> <p>(0) Not equipped/not available (1) No (2) Eyeglasses/sunglasses (3) Contact lenses (4) Deployed, unknown if eyewear worn (7) Not deployed (8) Unknown if deployed (9) Unknown</p>
--	--	--

DRIVER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Front)

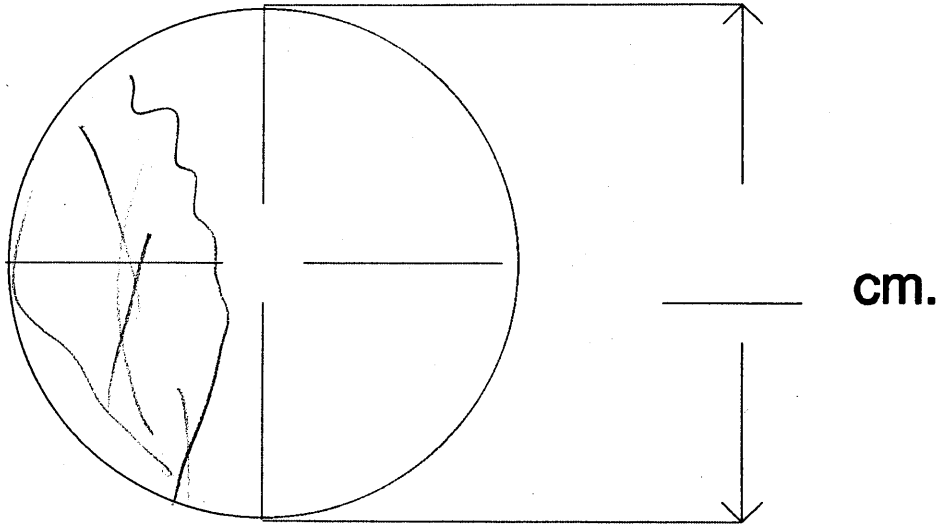

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Back)

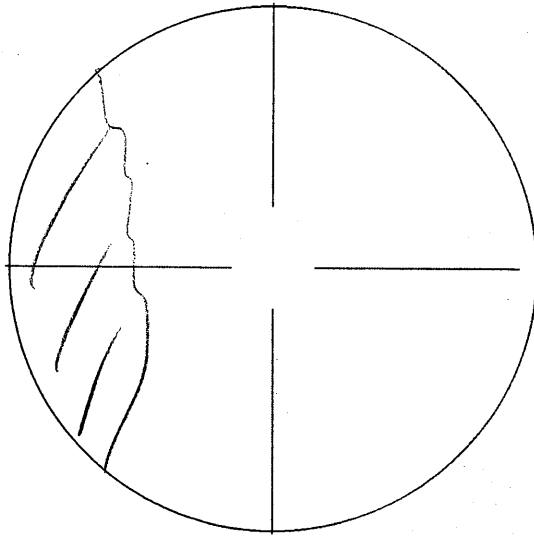

DRIVER AIR BAG SKETCHES (Cont'd)

3. DRIVER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap


b. Lower Flap

width (W_u) 18

width (W_l) 18

height (H_u) 5


height (H_l) 6

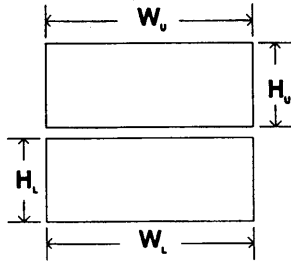

4. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE


5. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

6. SKETCH LOCATION OF CIRCULAR AIR BAG VENT PORTS

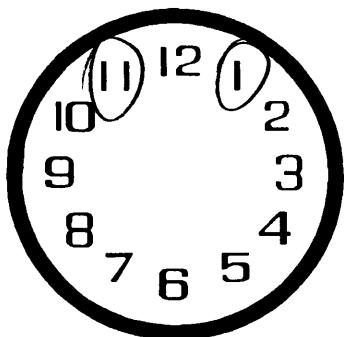


PASSENGER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Front)

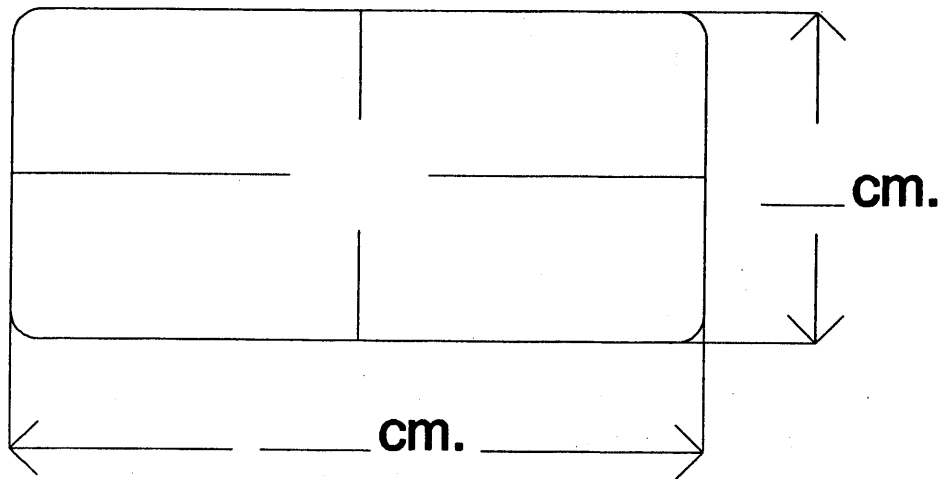

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Back)

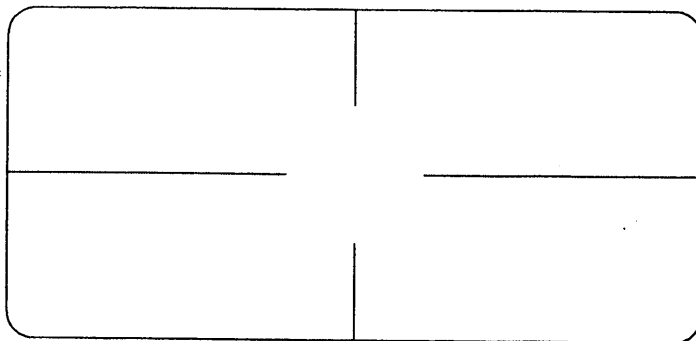


PASSENGER AIR BAG SKETCHES (Cont'd)

3. PASSENGER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

a. Flap

width (W) _____

height (H) _____

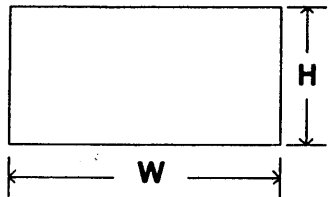

4. PASSENGER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap


b. Lower Flap

width (W_U) _____

width (W_L) _____

height (H_U) _____


height (H_L) _____

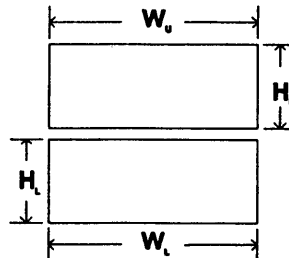

5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE

6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

7. SKETCH LOCATION OF RECTANGULAR AIR BAG VENT PORTS

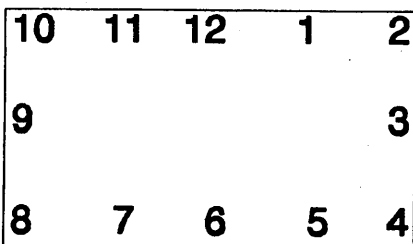

"OTHER" AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Front)

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Back)

"OTHER" AIR BAG SKETCHES (Cont'd)

3. SKETCH AIR BAG MODULE FLAP AND SIZE OR OPENING FOR AIRBAG

4. SKETCH AIR BAG VENT PORTS

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
FIRST	Head Restraint Type/Damage	1		1
	Seat Type	10	X	10
	Seat Performance	6		1
	Seat Orientation	4		4
	Seat Track Position	4		4
	Seat Back Incline Pre/Post Impact	14		23
SECOND	Head Restraint Type/Damage	0		0
	Seat Type	03	X	03
	Seat Performance	1		1
	Seat Orientation	1		1
	Seat Track Position	1		1
	Seat Back Incline Pre/Post Impact	04		04
THIRD	Head Restraint Type/Damage	0	6	6
	Seat Type	03	03	03
	Seat Performance	1	1	1
	Seat Orientation	1	1	1
	Seat Track Position	1	1	1
	Seat Back Incline Pre/Post Impact	04	04	04
OTHER	Head Restraint Type/Damage			
	Seat Type	X	X	X
	Seat Performance			
	Seat Orientation			
	Seat Track Position			
	Seat Back Incline Pre/Post Impact			

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

HEAD RESTRAINTS/SEAT EVALUATION

Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral — no damage
- (2) Integral — damaged during accident
- (3) Adjustable — no damage
- (4) Adjustable — damaged during accident
- (5) Add-on — no damage
- (6) Add-on — damaged during accident
- (8) Other
Specify: _____
- (9) Unknown

Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) ~~Seat tracks/anchors failed~~
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify) Occupant Intrusion
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

Seat Track Adjusted Position Prior To Impact




- (0) Occupant not seated or no seat
- (1) Non-adjustable seat track
- Adjustable Seat Track*
- (2) Seat at forward most track position
- (3) Seat between forward most and middle track positions
- (4) Seat at middle track position
- (5) Seat between middle and rear most track positions
- (6) Seat at rear most track position
- (9) Unknown

Seat Back Incline Prior and Post Impact

- (00) Occupant not seated or no seat
- (01) Not adjustable
- Upright prior to impact*
- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

- Slightly reclined prior to impact*
- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

- Completely reclined prior to impact*
- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position
- (99) Unknown

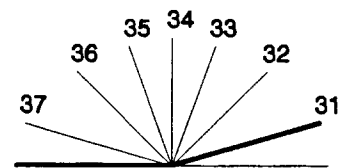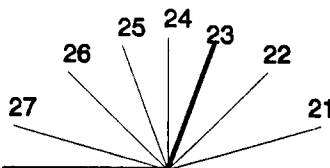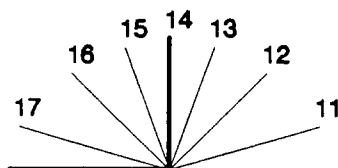

Coding diagrams for *Seat Back Incline Position Prior and Post Impact*

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

N/A

<p>1. Type of Child Safety Seat</p> <ul style="list-style-type: none"> (0) No child safety seat (1) Infant seat (2) Toddler seat (3) Convertible seat (4) Booster seat (7) Other type child safety seat (specify): _____ (8) Unknown child safety seat type (9) Unknown if child safety seat used <p>2. Child Safety Seat Orientation</p> <p>(00) No child safety seat</p> <p>Designed for Rear Facing for This Age/Weight</p> <ul style="list-style-type: none"> (01) Rear facing (02) Forward facing (08) Other orientation (specify): _____ (09) Unknown orientation <p>Designed for Forward Facing for This Age/Weight</p> <ul style="list-style-type: none"> (11) Rear facing (12) Forward facing (18) Other orientation (specify): _____ (19) Unknown orientation <p>Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight</p> <ul style="list-style-type: none"> (21) Rear facing (22) Forward facing (28) Other orientation (specify): _____ (29) Unknown orientation <p>(99) Unknown if child safety seat used</p> <p>3. Child Safety Seat Harness Usage</p>	<p>4. Child Safety Seat Shield Usage</p> <p>5. Child Safety Seat Tether Usage Note: Options Below Are Used for Variables 3-5.</p> <p>(00) No child safety seat</p> <p>Not Designed with Harness/Shield/Tether</p> <ul style="list-style-type: none"> (01) After market harness/shield/tether added, not used (02) After market harness/shield/tether used (03) Child safety seat used, but no after market harness/shield/tether added (09) Unknown if harness/shield/tether added or used <p>Designed With Harness/Shield/Tether</p> <ul style="list-style-type: none"> (11) Harness/shield/tether not used (12) Harness/shield/tether used (19) Unknown if harness/shield/tether used <p>Unknown If Designed With Harness/Shield/Tether</p> <ul style="list-style-type: none"> (21) Harness/shield/tether not used (22) Harness/shield/tether used (29) Unknown if harness/shield/tether used <p>(99) Unknown if child safety seat used</p> <p>6. Child Safety Seat Make/Model (Specify make/model and occupant number)</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>
---	--

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No [] Yes []

Describe indications of ejection and body parts involved in partial ejection(s):

brain & part of skull

where?

Occupant Number	1						
Ejection	2						
(Note on Vehicle Interior Sketch) Ejection Area	4						
Ejection Medium	4						
Medium Status	2						

Ejection

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

Ejection Area

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

(8) Other area (e.g., back of pickup, etc.) (specify):

(9) Unknown

Ejection Medium

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

out window

(5) Integral structure

(8) Other medium (specify):

(9) Unknown

Medium Status (Immediately Prior to Impact)

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

ENTRAPMENT No [/] Yes []

Describe entrapment mechanism: _____

Component(s): _____

(Note in vehicle interior diagram)



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 13
 2. Case Number - Stratum 149A
 3. Vehicle Number 01
 4. Occupant Number 01

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 30
 Code actual age at time of accident.
 (00) Less than one year old (specify by month): _____
 (97) 97 years and older
 (99) Unknown

6. Occupant's Sex 2
 (1) Male
 (2) Female-not reported pregnant
 (3) Female-pregnant-1st trimester(1st-3rd month)
 (4) Female-pregnant-2nd trimester(4th-6th month)
 (5) Female-pregnant-3rd trimester(7th-9th month)
 (6) Female-pregnant-term unknown
 (9) Unknown

7. Occupant's Height 178
 Code actual height to the nearest centimeter.
 (999) Unknown
70 inches X 2.54 = _____ centimeters

8. Occupant's Weight 61
 Code actual weight to the nearest kilogram.
 (999)Unknown
135 pounds X .4536 = _____ kilograms

9. Occupant's Role 1
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 9
 (0) Normal posture

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection

2

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area

2

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium

4

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):
Left Front Window
- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

15. Medium Status (Immediately Prior To Impact)

2

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment

0

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility

0

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or disoriented
- (2) Removed from vehicle due to injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (9) Unknown

BELT SYSTEM FUNCTION

18. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

(9) Unknown

19. Manual (Active) Belt System Use 04

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

20. Proper Use of Manual (Active) Belts 9 X

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown

21. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown

22. Shoulder Belt Upper Anchorage Adjustment 1

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable Shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

23. Automatic (Passive) Belt System Availability/Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

24. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
- (3) Automatic belt use unknown
- (9) Unknown

25. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

26. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of automatic belt system (specify): _____

(9) Unknown

27. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor

(7) Combination of above (specify): _____

(8) Other automatic belt failure (specify): _____

(9) Unknown

POLICE REPORTED RESTRAINT USE

AIR BAG SYSTEM FUNCTION

28. Police Reported Belt Use 4
- (0) None used
 - (1) Police did not indicate belt use
 - (2) Shoulder belt
 - (3) Lap belt
 - (4) Lap and shoulder belt
 - (5) Belt used, type not specified
 - (6) Child safety seat.
 - (7) Automatic belt
 - (8) Other type belt, (specify): _____
 - (9) Police indicated "unknown" _____

29. Police Reported Air Bag Availability/Function 2
- (0) No air bag available
 - (1) Police did not indicate air bag availability/function
 - (2) Deployed
 - (3) Not deployed
 - (4) Unknown if deployed
 - (9) Police indicated "unknown"

Check the Primary Source Used In Determining Belt Use.

- Not equipped/not available/destroyed or rendered inoperative
- Vehicle inspection
- Official injury data
- Driver/occupant interview
- Other (specify): _____
- Unknown if belt used _____

_____ vehicle inspection _____
 _____ pass no seat belt _____
 _____ used _____

30. Frontal Air Bag System Availability/Function (This Occupant Position) 1
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify): _____
 - (3) Air bag not reinstalled _____
 - (9) Unknown

31. Frontal Air Bag System Deployment (This Occupant Position) 1
- (0) Not equipped/not available
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify): _____
 - (3) Air bag not reinstalled _____
 - (9) Unknown
- Specify type of "other" air bag present:*

33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) 0
- (0) Not equipped with an "other" air bag
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

34. Are There Indications of Air Bag System Failure? (This Occupant Position) 1
- (0) Not equipped/not available
 - (1) No
 - (2) Yes (specify): _____
 - (9) Unknown _____

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

<p>35. Had Vehicle Been in Previous Accident(s)? <u>9</u> (0) Not equipped/not available (1) No previous accidents</p> <p>Yes (2) Previous accident(s) without deployment(s) (3) One previous accident with deployment (4) More than one previous accident with at least one deployment (8) Previous accidents, unknown deployment status (9) Unknown</p>	<p>40. Longitudinal Component of Delta V For Air Bag Deployment Impact <u>0</u> -050 (000) Not equipped/not available <u>-025</u> <i>Code the value of the delta V for the impact that initiated the air bag deployment</i> (_996) Deployment, unknown longitudinal Delta V (_997) Not deployed (_998) Unknown if deployed (_999) Unknown</p>
<p>36. Type of Air Bag <u>9</u> (0) Not equipped/not available (1) Original manufacturer installed system (2) Retrofitted air bag (3) Replacement air bag (8) Unknown type of air bag (9) Unknown</p>	<p>41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? <u>2</u> (0) Not equipped/not available (1) No (2) Yes (3) Deployed, unknown if flap(s) opened at designated tear points (7) Not deployed (8) Unknown if deployed (9) Unknown</p>
<p>37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? <u>9</u> (0) Not equipped/not available (1) No prior maintenance (2) Yes, prior maintenance (specify): _____ (9) Unknown</p>	<p>42. Were Air Bag Module Cover Flap(s) Damaged? <u>1</u> (0) Not equipped/not available (1) No (2) Yes (specify): _____ (3) Deployed, unknown if air bag module cover flap(s) damaged (7) Not deployed (8) Unknown if deployed (9) Unknown</p>
<p>38. Air Bag Deployment Accident Event Sequence Number <u>01</u> (00) Not equipped/not available _____ Code the accident event sequence number that initiated the air bag deployment (96) Deployed, unknown event (97) Not deployed (98) Unknown if deployed (99) Unknown</p>	<p>43. Was There Damage To The Air Bag? <u>01</u> (00) Not equipped/not available (01) Not damaged</p> <p>Yes - Air Bag Damage (02) Ruptured (03) Cut (04) Torn (05) Holed (06) Burned (07) Abraded (88) Other damage (specify): _____</p>
<p>39. CDC For Air Bag Deployment Impact <u>1</u> (0) Not equipped/not available (1) Highest delta V (2) Second highest delta V (3) Other non-coded delta V (specify): _____ _____ (6) Deployed, unknown event (7) Not deployed (8) Unknown if deployed (9) Unknown</p>	<p>(95) Damaged, details unknown (96) Deployed, unknown if damaged (97) Not deployed (98) Unknown if deployed (99) Unknown</p>

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*

44. Source of Air Bag Damage 01
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (88) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):
3
 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):
2
 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):
Right Seat Passenger
 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 1
 (0) Not equipped/not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION

49. Head Restraint Type/Damage by Occupant at This Occupant Position 1
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 09
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):

 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 4
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track
Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION *continued*

53. Seat Back Incline Prior and Post Impact

~~14~~
23

- (00) Occupant not seated or no seat
- (01) Not adjustable

Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position




Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

(99) Unknown

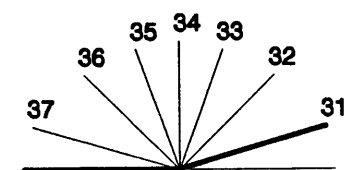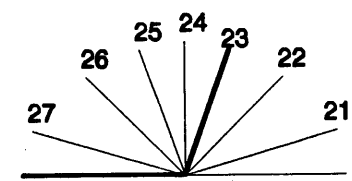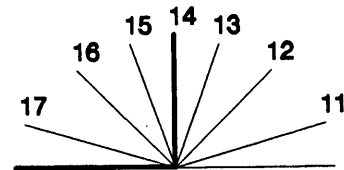

54. Seat Performance (this Occupant Position)

1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion, (specify): _____

(7) Combination of above (specify): _____

(8) Other (specify): _____

(9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

56. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat - with shield
 (5) Booster seat - without shield
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00
 (00) No child safety seat

Designed for Rear Facing for This Age/Weight
 (01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight
 (11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
 (21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

 (99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 00

59. Child Safety Seat Shield Usage 00

60. Child Safety Seat Tether Usage 00

Note: Options below applicable to
 Variables OA58-OA60.
 (00) No child safety seat

Not Designed With Harness/Shield/Tether

- (01) After market harness/shield/tether added, not used
- (02) After market harness/shield/tether used
- (03) Child safety seat used, but no after market harness/shield/tether added
- (09) Unknown if harness/shield/tether added or used

Designed With Harness/Shield/Tether

- (11) Harness/shield/tether not used
- (12) Harness/shield/tether used
- (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

- (21) Harness/shield/tether not used
- (22) Harness/shield/tether used
- (29) Unknown if harness/shield/tether used
- (99) Unknown if child safety seat used

INJURY CONSEQUENCES61. Injury Severity (Police Rating) 4

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 1

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 62

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP WORK HERE**VARIABLES 66-74****TO BE CODED BY THE ZONE CENTER**

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES****TRAUMA DATA**66. Time to Death 01

Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)

- (00) Not fatal
(96) Fatal - ruled disease
(99) Unknown

67. 1st Medically Reported Cause of Death 9968. 2nd Medically Reported Cause of Death 0069. 3rd Medically Reported Cause of Death 00
Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death

- (00) Not fatal or no additional causes
(96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown

70. Number of Recorded Injuries for This Occupant 14

Code the actual number of injuries recorded for this occupant.

- (00) No recorded injuries
(97) Injured, details unknown
(99) Unknown if injured

71. Glasgow Coma Scale (GCS) Score 01
(at Medical Facility)

- (00) Not injured
(01) Injured - not treated at medical facility
(02) No GCS Score at medical facility
(03-15) Code the actual value of the initial GCS Score recorded at medical facility.
(97) Injured, details unknown
(99) Unknown if injured

72. Was the Occupant Given Blood? 1

- (1) No - blood not given
(2) Yes - blood given
(specify units): _____
(9) Unknown if blood given

73. Arterial Blood Gases (ABG) - HCO₃ 01

- (00) Not injured
(01) Injured, ABGs not measured or reported
(02-50) Code the actual value of the HCO₃
(96) ABGs reported, HCO₃ unknown
(97) Injured, details unknown
(99) Unknown if injured

BELT USE DETERMINATION74. Primary Source of Belt Use Determination 1

- (0) Not equipped/not available/destroyed or rendered inoperative
(1) Vehicle inspection
(2) Official injury data
(3) Driver/occupant interview
(8) Other (specify): _____
(9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>13</u>	3. Vehicle Number <u>01</u>
2. Case Number - Stratum <u>149A</u>	4. Occupant Number <u>01</u>

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

*skull
fract*

Source of Injury Data	A.I.S. - 90						Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number	
	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect					
<i>base</i> 1st	5. <u>1</u>	6. <u>1</u>	7. <u>5</u>	8. <u>02</u>	9. <u>06</u>	10. <u>4</u>	11. <u>8</u>	12. <u>507</u>	13. <u>3</u>	14. <u>1</u>	15. <u>00</u>
<i>pneumocephalus</i> 2nd	16. <u>1</u>	17. <u>1</u>	18. <u>4</u>	19. <u>06</u>	20. <u>82</u>	21. <u>3</u>	22. <u>9</u>	23. <u>507</u>	24. <u>3</u>	25. <u>1</u>	26. <u>50</u>
<i>subarachnoid hemorrhage</i> 3rd	27. <u>1</u>	28. <u>1</u>	29. <u>4</u>	30. <u>06</u>	31. <u>84</u>	32. <u>3</u>	33. <u>9</u>	34. <u>507</u>	35. <u>3</u>	36. <u>1</u>	37. <u>00</u>
<i>maxilla fracture</i> 4th	38. <u>1</u>	39. <u>2</u>	40. <u>5</u>	41. <u>08</u>	42. <u>00</u>	43. <u>2</u>	44. <u>9</u>	45. <u>507</u>	46. <u>3</u>	47. <u>1</u>	48. <u>00</u>
<i>lung cont</i> 5th	49. <u>1</u>	50. <u>4</u>	51. <u>4</u>	52. <u>14</u>	53. <u>10</u>	54. <u>4</u>	55. <u>3</u>	56. <u>051</u>	57. <u>3</u>	58. <u>1</u>	59. <u>05</u>
<i>fract</i> 6th	60. <u>1</u>	61. <u>7</u>	62. <u>5</u>	63. <u>18</u>	64. <u>00</u>	65. <u>2</u>	66. <u>2</u>	67. <u>051</u>	68. <u>2</u>	69. <u>1</u>	70. <u>05</u>
<i>fract</i> 7th	71. <u>1</u>	72. <u>7</u>	73. <u>5</u>	74. <u>18</u>	75. <u>00</u>	76. <u>2</u>	77. <u>1</u>	78. <u>010</u>	79. <u>3</u>	80. <u>1</u>	81. <u>00</u>
<i>fract</i> 8th	82. <u>1</u>	83. <u>4</u>	84. <u>5</u>	85. <u>02</u>	86. <u>20</u>	87. <u>2</u>	88. <u>2</u>	89. <u>051</u>	90. <u>2</u>	91. <u>1</u>	92. <u>05</u>
<i>chin</i> 9th	93. <u>1</u>	94. <u>2</u>	95. <u>9</u>	96. <u>02</u>	97. <u>02</u>	98. <u>1</u>	99. <u>8</u>	100. <u>602</u>	101. <u>2</u>	102. <u>3</u>	103. <u>00</u>
<i>chest</i> 10th	104. <u>1</u>	105. <u>4</u>	106. <u>9</u>	107. <u>04</u>	108. <u>02</u>	109. <u>1</u>	110. <u>2</u>	111. <u>051</u>	112. <u>2</u>	113. <u>1</u>	114. <u>05</u>

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head		Specific injuries are assigned consecutive two-digit numbers beginning with 02. To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(1) Right
(2) Face			(2) Left
(3) Neck			(3) Bilateral
(4) Thorax			(4) Central
(5) Abdomen			(5) Anterior
(6) Spine			(6) Posterior
(7) Upper Extremity			(7) Superior
(8) Lower Extremity			(8) Inferior
(9) Unspecified			(9) Unknown
			(0) Whole region
	<u>Vessels, Nerves, Organs.</u> <u>Bones, Joints</u> are assigned consecutive two digit numbers beginning with 02.		
	The exceptions to this rule apply to:		
	<u>Whole Area</u>		
	(02) Skin - Abrasion		
	(04) Skin - Contusion		
	(06) Skin - Laceration		
	(08) Skin - Avulsion		
	(10) Amputation		
	(20) Burn		
	(30) Crush		
	(40) Degloving		
	(50) Injury - NFS		
	(90) Trauma, other than mechanical		
	<u>Head - LOC</u>		
	(02) Length of LOC		
	(04) Level		
	(06) of		
	(08) Consciousness		
	(10) Concussion		
	<u>Spine</u>		
	(02) Cervical		
	(04) Thoracic		
	(06) Lumbar		
		Abbreviated Injury Scale	
		(1) Minor Injury	
		(2) Moderate Injury	
		(3) Serious Injury	
		(4) Severe Injury	
		(5) Critical Injury	
		(6) Maximum (untreatable)	
		(7) Injured, unknown severity	

SOURCE OF INJURY DATA	INJURY SOURCE CONFIDENCE LEVEL	DIRECT/INDIRECT INJURY
<u>OFFICIAL RECORDS</u> (1) Autopsy records with or without hospital/medical records (2) Hospital/medical records other than emergency room (e.g., discharge summary) (3) Emergency room records only (including associated X-rays or other lab reports) (4) Private physician, walk-in or emergency clinic <u>UNOFFICIAL RECORDS</u> (5) Lay coroner report (6) E.M.S. personnel (7) Interviewee (8) Other source (specify): _____ (9) Police _____	(1) Certain (2) Probable (3) Possible (9) Unknown	(1) Direct contact injury (2) Indirect contact injury (3) Noncontact injury (7) Injured, unknown source

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify): _____
- (195) Other air bag compartment cover (specify): _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify): _____
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify): _____
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify): _____
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify): _____
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify): _____
- (599) Unknown vehicle or object

NONCONTACT INJURY

- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify): _____
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

ALL INJURIES FROM AUTOPSY

Ⓞ CHIN - 3x2cm ABRASION

GRAY PAINT PARTICLES
PRESENT ON FACE

Ⓞ LATERAL CHEST
7x10cm BRUISE

Ⓞ FOREARM
SHOWS NUMEROUS
LAC. + BRUISES.
7x5cm LAC.
ON MEDIAL
SURFACE



Ⓞ UPPER ARM
6x6cm LAC.
ELBOW JOINT CAN
BE PALPATED
THROUGH THE
LAC.

Ⓞ KNEE Ⓞ SIDE
6x3cm BRUISE

Ⓞ KNEE - Ⓞ SIDE
6x5cm BRUISE

Ⓞ LOWER LEG
BRUISES

Ⓞ HAND - LAC.
BETWEEN 3RD & 4TH FINGERS

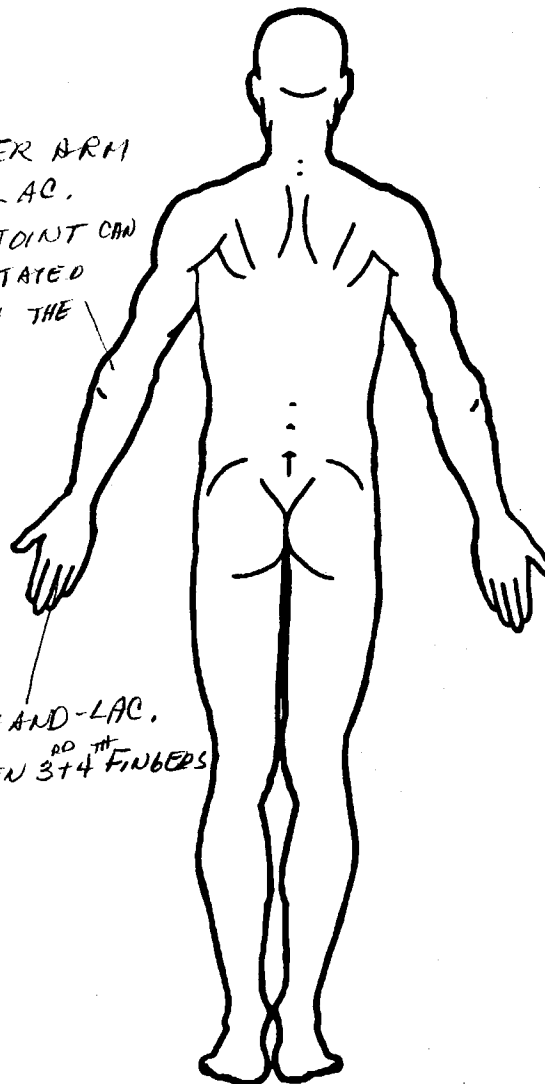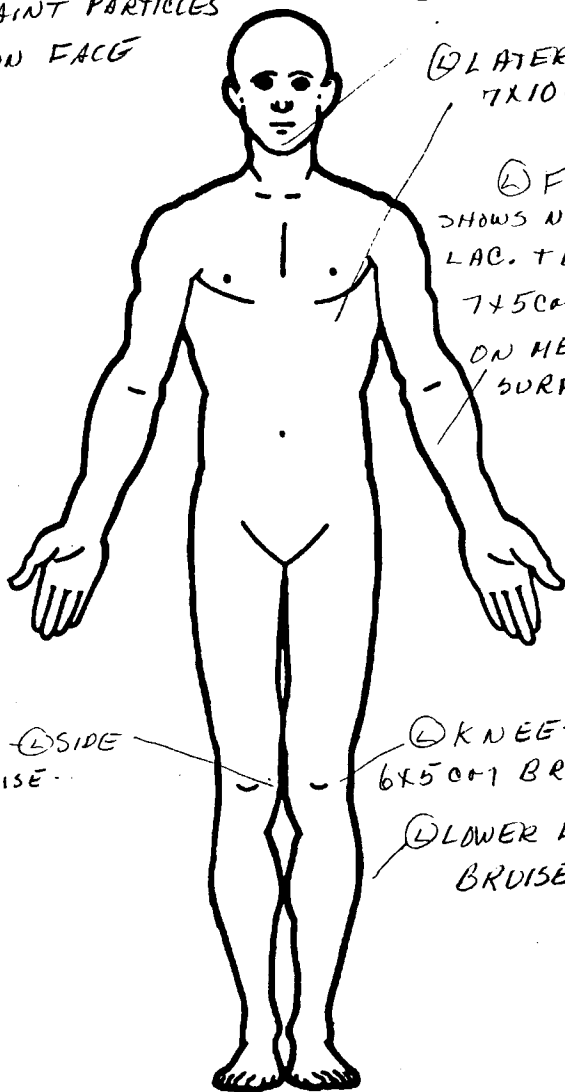

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

— No *NR*
 — Yes

Blood Alcohol Level (mg/dl)

BAL = *0*

Glasgow Coma Scale Score

GCS = *Dead at scene*

Units of Blood Given

Units =

Arterial Blood Gases

pH =

PO₂ =



PCO₂ =

HCO₃ =

Dead at scene

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

ALL INJURIES FROM AUTOPSY

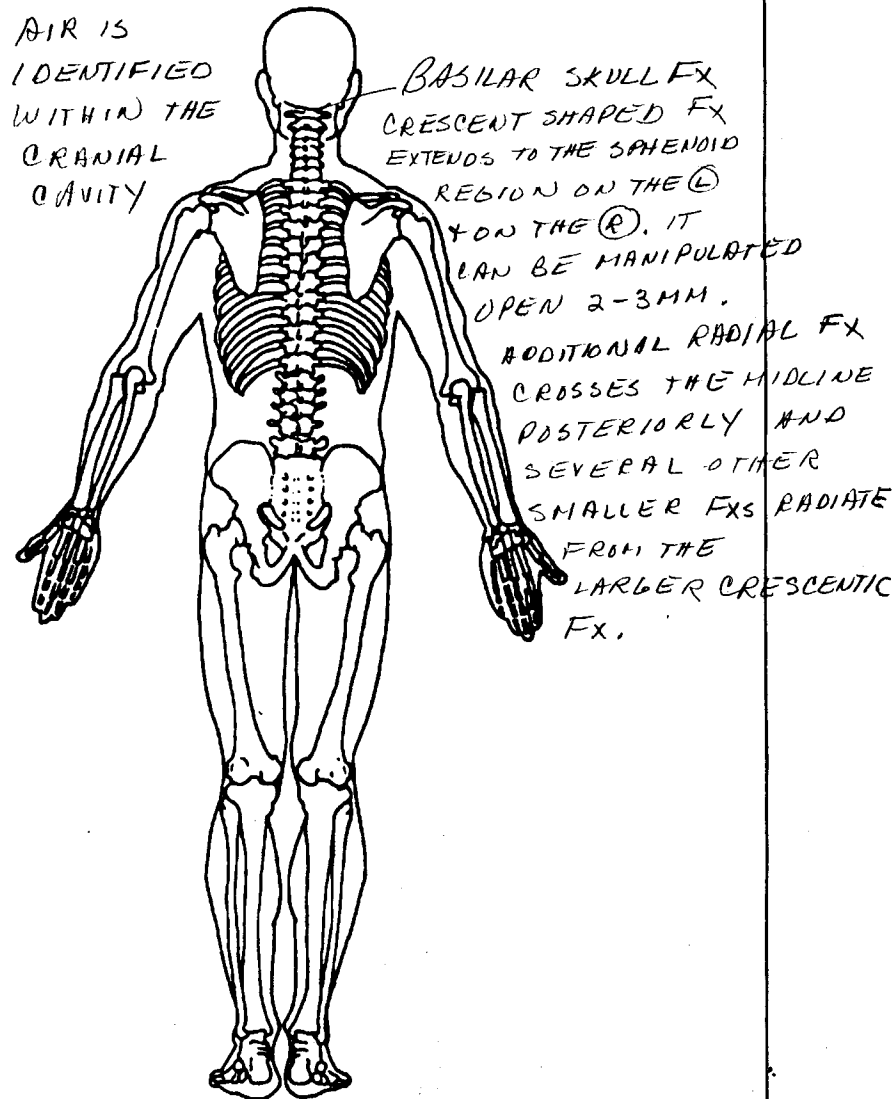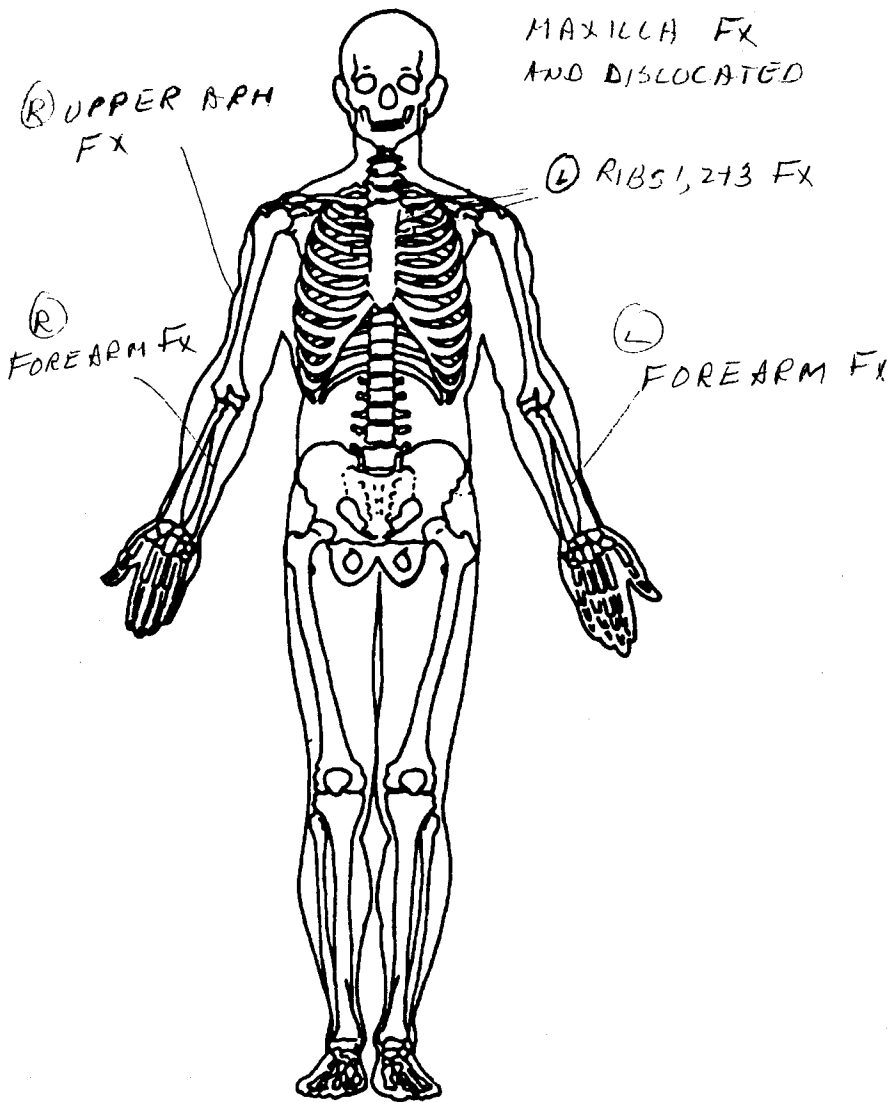


OFFICIAL INJURY DATA — INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)


AUTOPSY

DIFFUSE
SUBARACHNOID
HEMORRHAGE

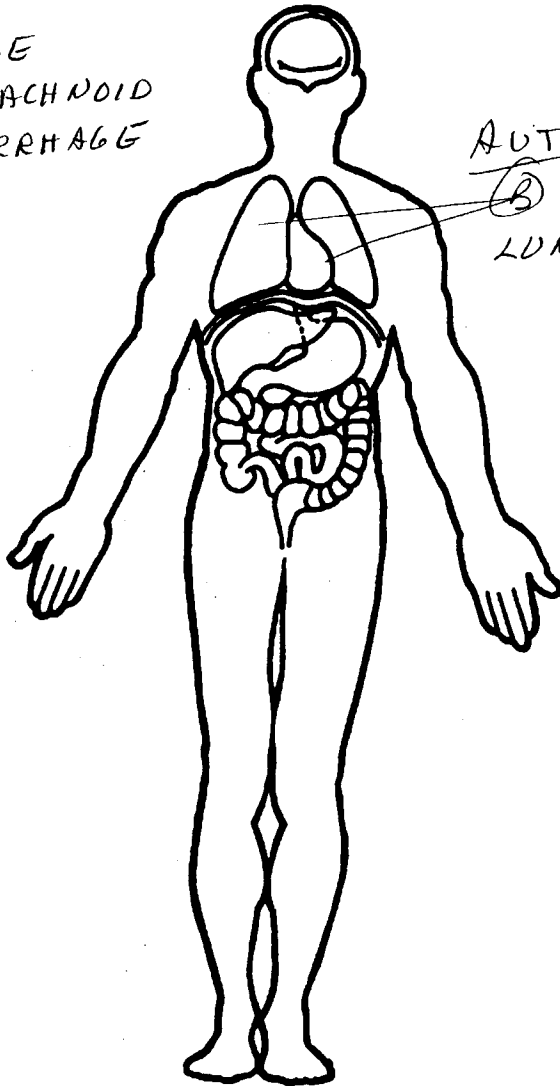

AUTOPSY

LUNG CONTUSIONS

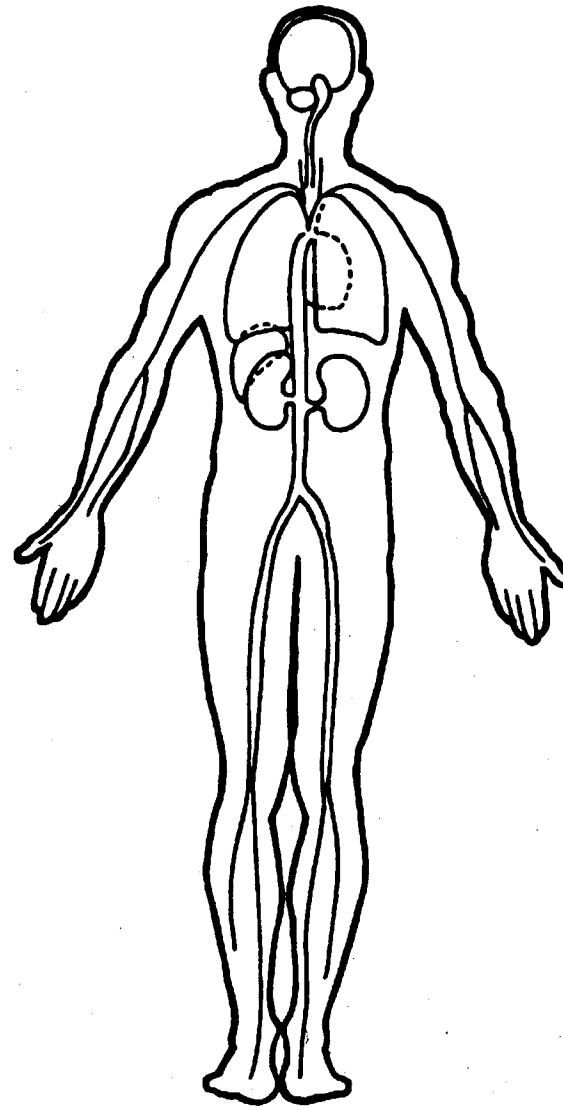



OCCUPANT ASSESSMENT FORM

OCCUPANT'S SEATING

1. Primary Sampling Unit Number 13
 2. Case Number - Stratum 149A
 3. Vehicle Number 01
 4. Occupant Number 02

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 07
 Code actual age at time of accident.
 (00) Less than one year old (specify by month):

 (97) 97 years and older
 (99) Unknown

6. Occupant's Sex 2
 (1) Male
 (2) Female-not reported pregnant
 (3) Female-pregnant-1st trimester(1st-3rd month)
 (4) Female-pregnant-2nd trimester(4th-6th month)
 (5) Female-pregnant-3rd trimester(7th-9th month)
 (6) Female-pregnant-term unknown
 (9) Unknown

7. Occupant's Height 999
 Code actual height to the nearest
 centimeter.
 (999) Unknown
 _____ inches X 2.54 = _____ centimeters

8. Occupant's Weight 999
 Code actual weight to the nearest
 kilogram.
 (999)Unknown
 _____ pounds X .4536 = _____ kilograms

9. Occupant's Role 2
 (1) Driver
 (2) Passenger
 (9) Unknown

10. Occupant's Seat Position 13
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

- Second Seat*
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

- Third Seat*
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

- Fourth Seat*
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant
 (97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 9
 (0) Normal posture

- Abnormal posture*
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

- (5) Integral structure
- (8) Other medium (specify):

- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 0

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility 2

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or disoriented
- (2) Removed from vehicle due to injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (9) Unknown

BELT SYSTEM FUNCTION

18. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

(9) Unknown _____

19. Manual (Active) Belt System Use 00

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt _____
- (03) Lap belt _____
- (04) Lap and shoulder belt _____
- (05) Belt used—type unknown _____
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat _____
- (13) Lap belt used with child safety seat _____
- (14) Lap and shoulder belt used with child safety seat _____
- (15) Belt used with child safety seat—type unknown _____
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used _____

20. Proper Use of Manual (Active) Belts 0

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

21. Manual (Active) Belt Failure Modes During Accident 0

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

22. Shoulder Belt Upper Anchorage Adjustment 1

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

23. Automatic (Passive) Belt System Availability/Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

24. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
- (3) Automatic belt use unknown
- (9) Unknown

25. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

26. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of automatic belt system (specify): _____

(9) Unknown _____

27. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other automatic belt failure (specify): _____

(9) Unknown _____

POLICE REPORTED RESTRAINT USE	AIR BAG SYSTEM FUNCTION
<p>28. Police Reported Belt Use <u>0</u></p> <p>(0) None used (1) Police did not indicate belt use (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt used, type not specified (6) Child safety seat. (7) Automatic belt (8) Other type belt, (specify): _____ (9) Police indicated "unknown"</p>	<p>30. Frontal Air Bag System Availability/Function (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available (1) Air bag</p> <p><i>Non-functional</i> (2) Air bag disconnected (specify): _____ (3) Air bag not reinstalled (9) Unknown</p>
<p>29. Police Reported Air Bag Availability/Function <u>2</u></p> <p>(0) No air bag available (1) Police did not indicate air bag availability/function (2) Deployed (3) Not deployed (4) Unknown if deployed (9) Police indicated "unknown"</p>	<p>31. Frontal Air Bag System Deployment (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available (1) Deployed during accident (as a result of impact) (2) Deployed inadvertently just prior to accident (3) Deployed, details unknown (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (5) Unknown if deployed (7) Nondeployed (9) Unknown</p>
<p>Check the Primary Source Used In Determining Belt Use.</p> <p><input type="checkbox"/> Not equipped/not available/destroyed or rendered inoperative <input checked="" type="checkbox"/> Vehicle inspection <input type="checkbox"/> Official injury data <input type="checkbox"/> Driver/occupant interview <input type="checkbox"/> Other (specify): _____ <input type="checkbox"/> Unknown if belt used _____ _____ _____</p>	<p>32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available (1) Air bag</p> <p><i>Non-functional</i> (2) Air bag disconnected (specify): _____ (3) Air bag not reinstalled (9) Unknown <i>Specify type of "other" air bag present:</i> _____</p>
	<p>33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) <u>0</u></p> <p>(0) Not equipped with an "other" air bag (1) Deployed during accident (as a result of impact) (2) Deployed inadvertently just prior to accident (3) Deployed, details unknown (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (5) Unknown if deployed (7) Nondeployed (9) Unknown</p>
	<p>34. Are There Indications of Air Bag System Failure? (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available (1) No (2) Yes (specify): _____ (9) Unknown</p>

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 0

- (0) Not equipped/not available.
 (1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
 (3) One previous accident with deployment
 (4) More than one previous accident with at least one deployment
 (8) Previous accidents, unknown deployment status
 (9) Unknown

36. Type of Air Bag 0

- (0) Not equipped/not available
 (1) Original manufacturer installed system
 (2) Retrofitted air bag
 (3) Replacement air bag
 (8) Unknown type of air bag
 (9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 0

- (0) Not equipped/not available
 (1) No prior maintenance
 (2) Yes, prior maintenance (specify):

 (9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 00

- (00) Not equipped/not available
 _____ Code the accident event sequence number that initiated the air bag deployment
 (96) Deployed, unknown event
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

39. CDC For Air Bag Deployment Impact 0

- (0) Not equipped/not available
 (1) Highest delta V
 (2) Second highest delta V
 (3) Other non-coded delta V (specify):

 (6) Deployed, unknown event
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact + 000

- (_000) Not equipped/not available
Code the value of the delta V for the impact that initiated the air bag deployment
 (_996) Deployment, unknown longitudinal Delta V
 (_997) Not deployed
 (_998) Unknown if deployed
 (_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 0

- (0) Not equipped/not available
 (1) No
 (2) Yes
 (3) Deployed, unknown if flap(s) opened at designated tear points
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 0

- (0) Not equipped/not available
 (1) No
 (2) Yes (specify): _____
 (3) Deployed, unknown if air bag module cover flap(s) damaged
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

43. Was There Damage To The Air Bag? 00

- (00) Not equipped/not available
 (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
 (03) Cut
 (04) Torn
 (05) Holed
 (06) Burned
 (07) Abraded
 (88) Other damage (specify):

 (95) Damaged, details unknown
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*
HEAD RESTRAINT AND SEAT EVALUATION

44. Source of Air Bag Damage 00
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (88) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):

 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):

 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 0
 (0) Not equipped/not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

49. Head Restraint Type/Damage by Occupant at This Occupant Position 1
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 09
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):

 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 4
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track
Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown


HEAD RESTRAINT AND SEAT EVALUATION *continued*

53. Seat Back Incline Prior and Post Impact 23

- (00) Occupant not seated or no seat
- (01) Not adjustable


Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

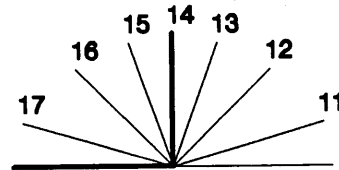


Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

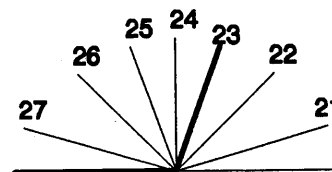

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

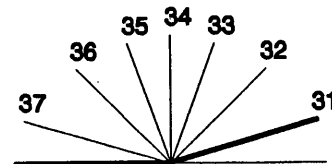

(99) Unknown

54. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion, (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000

(000) No child safety seat

Applicable codes are found in your NASS CDS
Data Collection, Coding and Editing

(950) Built-in child safety seat

(997) Other make/model (specify):

(998) Unknown make/model

(999) Unknown if child safety seat used

56. Type of Child Safety Seat 0

(0) No child safety seat

(1) Infant seat

(2) Toddler seat

(3) Convertible seat

(4) Booster seat - with shield

(5) Booster seat - without shield

(7) Other type child safety seat (specify):

(8) Unknown child safety seat type

(9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing

(02) Forward facing

(08) Other orientation (specify):

(09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing

(12) Forward facing

(18) Other orientation (specify):

(19) Unknown orientation

*Unknown Design or Orientation For This
Age/Weight, or Unknown Age/Weight*

(21) Rear facing

(22) Forward facing

(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 0059. Child Safety Seat Shield Usage 0060. Child Safety Seat Tether Usage 00Note: Options below applicable to
Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether(01) After market harness/shield/tether
added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market
harness/shield/tether added(09) Unknown if harness/shield/tether
added or used*Designed With Harness/Shield/Tether*

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES61. Injury Severity (Police Rating) 3

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 3

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 2

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 99

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 97

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP WORK HERE**VARIABLES 66-74****TO BE CODED BY THE ZONE CENTER**

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES**

66. Time to Death 00
 _____ Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
 (00) Not fatal
 (96) Fatal - ruled disease
 (99) Unknown
67. 1st Medically Reported Cause of Death 00

68. 2nd Medically Reported Cause of Death 00

69. 3rd Medically Reported Cause of Death 00
 _____ Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
 (00) Not fatal or no additional causes
 (96) Mode of death given but specific injuries are not linked to cause of death. (specify): _____
 (97) Other result (includes fatal ruled disease) (specify): _____
 (99) Unknown _____
70. Number of Recorded Injuries for This Occupant 17
 _____ Code the actual number of injuries recorded for this occupant.
 (00) No recorded injuries
 (97) Injured, details unknown
 (99) Unknown if injured

TRAUMA DATA

71. Glasgow Coma Scale (GCS) Score 14
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured
72. Was the Occupant Given Blood? 9
 (1) No - blood not given
 (2) Yes - blood given (specify units): _____
 (9) Unknown if blood given
73. Arterial Blood Gases (ABG) - HCO₃ 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO₃
 (96) ABGs reported, HCO₃ unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number 13
2. Case Number - Stratum 149A

3. Vehicle Number 01
4. Occupant Number 02

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

skull

Source of Injury Data	A.I.S. - 90						Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect				

1st fit 5. 2 6. 1 7. 5 8. 02 9. 00 10. 3 11. 8 12. 015 13. 3 14. 1 15. 02

2nd subarachnoid hem 16. 3 17. 1 18. 4 19. 06 20. 84 21. 3 22. 9 23. 015 24. 3 25. 1 26. 02

3rd Closed Head Inf 27. 3 28. 1 29. 6 30. 06 31. 06 32. 2 33. 8 34. 015 35. 3 36. 1 37. 02

nose

4th bt 38. 2 39. 2 40. 5 41. 10 42. 04 43. 2 44. 4 45. 015 46. 3 47. 1 48. 02

mouth

5th 49. 2 50. 2 51. 5 52. 08 53. 00 54. 2 55. 2 56. 015 57. 3 58. 1 59. 02

forehead cont

6th 60. 3 61. 2 62. 9 63. 04 64. 02 65. 1 66. 7 67. 015 68. 3 69. 1 70. 02

cheek

7th loc 71. 3 72. 2 73. 9 74. 06 75. 02 76. 1 77. 2 78. 015 79. 3 80. 1 81. 02

radius

8th 82. 2 83. 7 84. 5 85. 28 86. 04 87. 3 88. 2 89. 011 90. 3 91. 1 92. 00

ulna

9th 93. 2 94. 7 95. 5 96. 32 97. 02 98. 2 99. 2 100. 011 101. 3 102. 1 103. 00

chest

10th 104. 3 105. 4 106. 9 107. 02 108. 02 109. 1 110. 8 111. 004 112. 3 113. 1 114. 03

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head		Specific injuries are assigned consecutive two-digit numbers beginning with 02. To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(1) Right
(2) Face			(2) Left
(3) Neck			(3) Bilateral
(4) Thorax			(4) Central
(5) Abdomen			(5) Anterior
(6) Spine			(6) Posterior
(7) Upper Extremity			(7) Superior
(8) Lower Extremity			(8) Inferior
(9) Unspecified			(9) Unknown
			(0) Whole region
	<u>Vessels, Nerves, Organs.</u> <u>Bones, Joints</u> are assigned consecutive two digit numbers beginning with 02.		
	The exceptions to this rule apply to:		
	<u>Whole Area</u>		
	(02) Skin - Abrasion		
	(04) Skin - Contusion		
	(06) Skin - Laceration		
	(08) Skin - Avulsion		
	(10) Amputation		
	(20) Burn		
	(30) Crush		
	(40) Degloving		
	(50) Injury - NFS		
	(90) Trauma, other than mechanical		
	<u>Head - LOC</u>		
	(02) Length of LOC		
	(04) Level		
	(06) of		
	(08) Consciousness		
	(10) Concussion		
	<u>Spine</u>		
	(02) Cervical		
	(04) Thoracic		
	(06) Lumbar		
		Abbreviated Injury Scale	
		(1) Minor Injury	
		(2) Moderate Injury	
		(3) Serious Injury	
		(4) Severe Injury	
		(5) Critical Injury	
		(6) Maximum (untreatable)	
		(7) Injured, unknown severity	

SOURCE OF INJURY DATA	INJURY SOURCE CONFIDENCE LEVEL	DIRECT/INDIRECT INJURY
<u>OFFICIAL RECORDS</u> (1) Autopsy records with or without hospital/medical records (2) Hospital/medical records other than emergency room (e.g., discharge summary) (3) Emergency room records only (including associated X-rays or other lab reports) (4) Private physician, walk-in or emergency clinic <u>UNOFFICIAL RECORDS</u> (5) Lay coroner report (6) E.M.S. personnel (7) Interviewee (8) Other source (specify): _____ (9) Police _____	(1) Certain (2) Probable (3) Possible (9) Unknown	(1) Direct contact injury (2) Indirect contact injury (3) Noncontact injury (7) Injured, unknown source

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify):

(019) Other front object (specify):

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify):
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify):

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify):
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify):

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify):
- (155) Head restraint system
- (160) Other occupants (specify):
- (161) Interior loose objects
- (162) Child safety seat (specify):
- (163) Other interior object (specify):

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify):
- (195) Other air bag compartment cover (specify):

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify):

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify):
- (409) Additional or relocated switches, (specify):

(410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify):

EXTERIOR OF OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify):
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify):
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify):

- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify):

- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify):
- (599) Unknown vehicle or object

NONCONTACT INJURY

- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify):
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)



ER
MIDFOREHEAD - LARGE
HEMATOMA

ER ICH
① CHEEK - PUNCTURE WOUND
INTO MAXILLARY SINUS

ER
LARGE ABRASION
& ECCHYMOSSIS
ACROSS LOWER
CHEST &
UPPER ABDOMEN

ER
MULTIPLE ABRASIONS &
ECCHYMOSSIS

ER
② KNEE - ICH LAC.

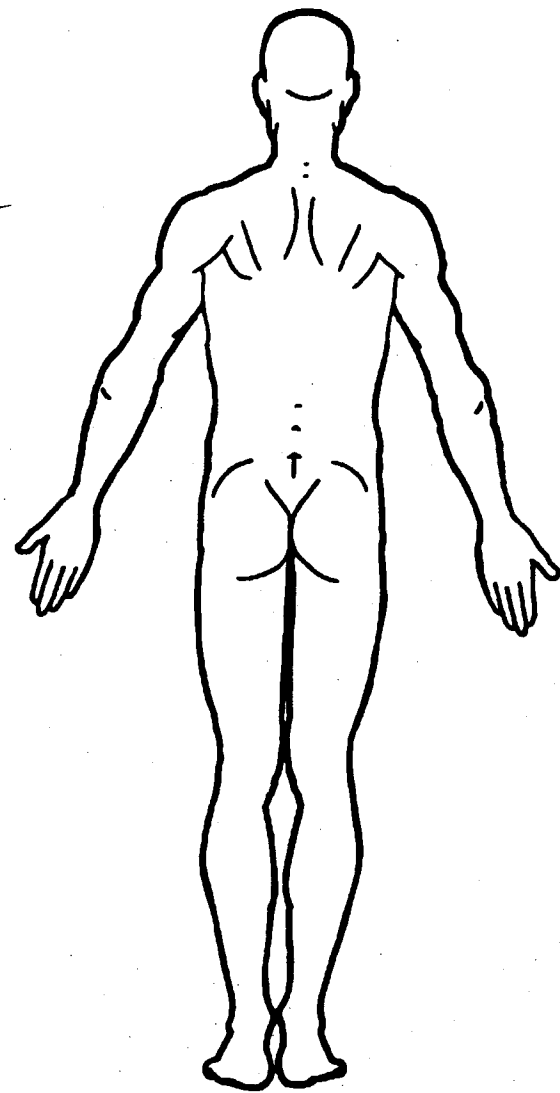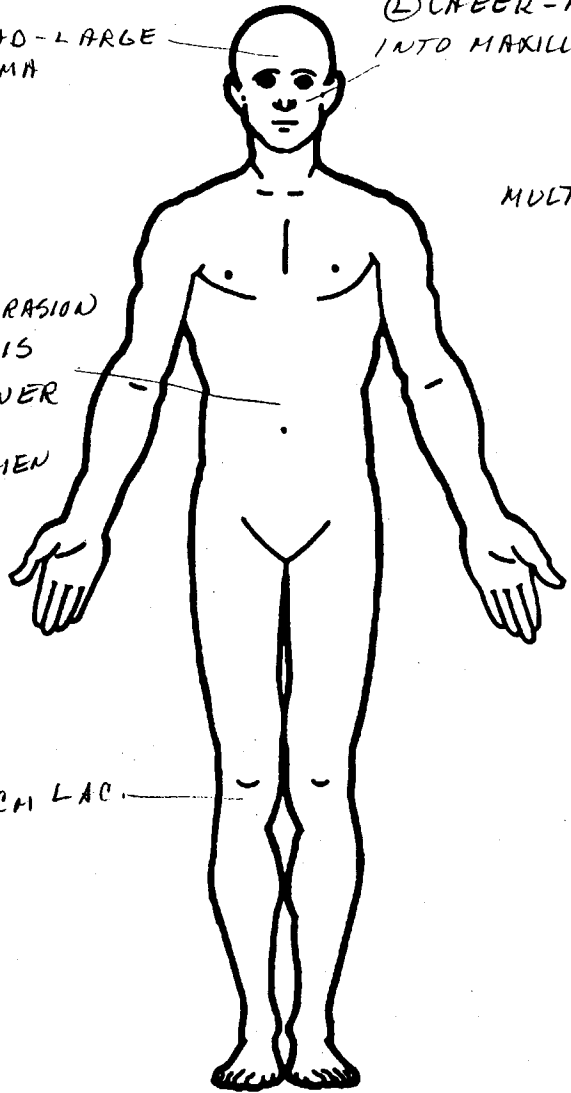

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

No

Yes

Blood Alcohol Level (mg/dl)

BAL = NR

Glasgow Coma Scale Score

GCSS = 14

Units of Blood Given

Units = NR

Arterial Blood Gases

pH =

PO₂ =

PCO₂ =

HCO₃ =

not reported

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

RAD
MULTIPLE FXs INVOLVING BOTH
Ⓡ+Ⓛ NASAL ALA EXTENDING TO
NASAL BRIDGE
RAD
FX OF MEDIAL + ANTERIOR WALLS OF
Ⓡ MAXILLARY SINUS
RAD
Ⓛ RADIUS FX - SHAFT
DIS PLACED TOWARD ULNA
Ⓛ ULNA FX - SHAFT
NON DIS PLACED

RAD
BASILAR SKULL FX

OFFICIAL INJURY DATA — INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

ER - CLOSED HEAD INJURY; EMs FOUND HER CONSCIOUS + CRYING; SOMNOLENT BUT ADROUSABLE INER

OR

COMPLETE DIVISION OF STOMACH FROM THE DUODENUM AT THE PYLORUS

OR


COMPLETE TRANSECTION OF DUODENUM IN THE MIDDLESCENDING DUODENUM

OR

LAC. AVULSION OF THE COMMON BILE DUCT AND COMMON PANCREATIC DUCTS

OR

HEAD OF PANCREAS AND UNCINATE PROCESS HAS BEEN TOTALLY AVULSED OFF THE DISTAL BODY OF THE PANCREAS

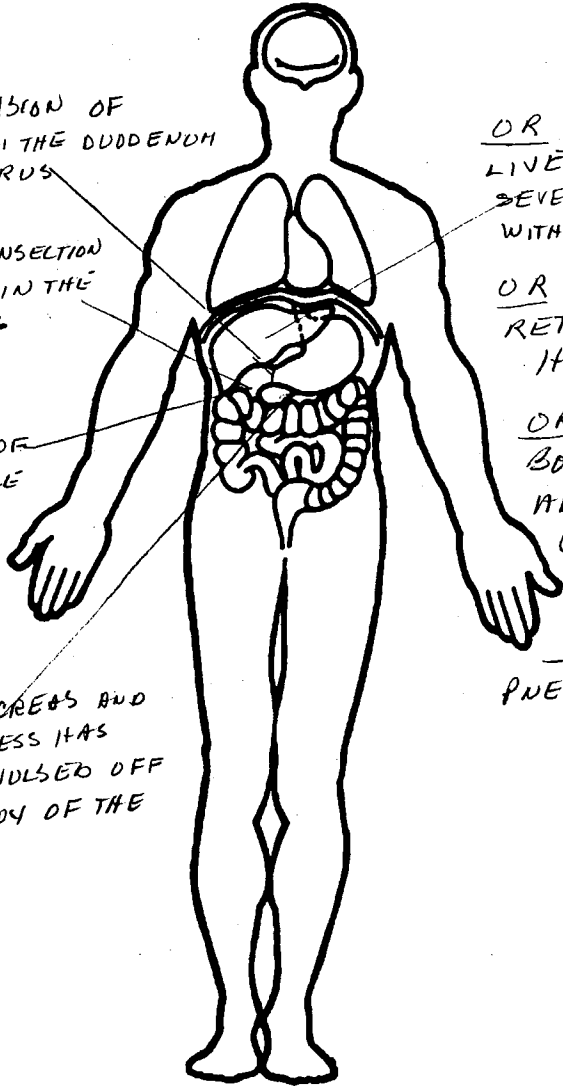

OR

LIVER - SEVERAL AREAS OF HEMATOMA WITHIN THE LIVER

OR

RETROPERITONEAL HEMATOMA

OR


BOTH RECTUS ABDOMINUS MUSCLES COMPLETELY LACERATED

OR

PNEUMOPERITONEUM

ER

SUBARACHNOID HEMORRHAGE POSTERIOR

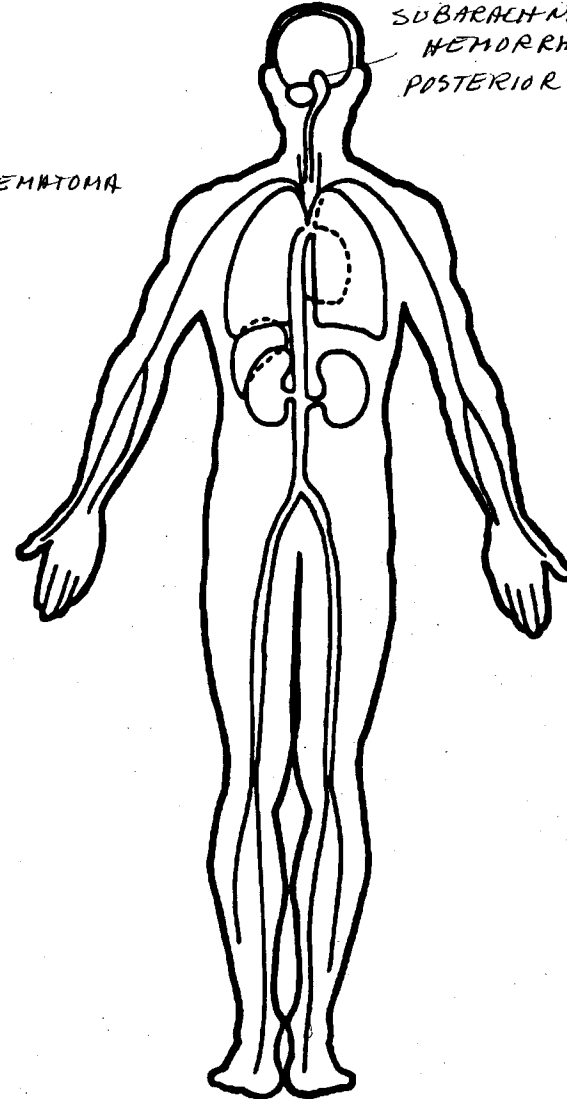



UPDATE FORM

3rd

1. Primary Sampling Unit Number 13

2. Case Number — Stratum 1494

3. Vehicle Number 01

4. Occupant Number 02

Driver or Occupant Name: _____

Address: _____

Other Information: _____

RECEIVED [REDACTED] 1995

(Sanitize this section prior to Update submission.)

STATUS OF OCCUPANT INFORMATION

	INITIAL SUBMISSION	UPDATED INFORMATION
OAL08. Date Official Medical Data Requested	[REDACTED]	<u>95</u>
OAL09. Date Official Medical Data Obtained	[REDACTED]	<u>95</u>
OAL16. Injury Treatment Status	<u>4</u>	<u>4</u>
OAL17. Injury Information		
<u>Official</u>		
a. Autopsy (invasive examination)	<u>B</u>	---
b. Post-ER medical record which includes information about death based on non-invasive examination	<u>B</u>	---
c. Admission record/summary or admission/discharge face sheet	<u>B</u>	---
d. Discharge summary	<u>B</u>	---
e. Operative report	<u>B</u>	<u>11</u>
f. Radiographic record(s) (X-ray, CT scan)	<u>B</u>	<u>11</u>
g. History and physical examination and/or consultation records	<u>B</u>	<u>11</u>
h. Emergency room records (includes nurses' notes)	<u>B</u>	---
j. Private physician	<u>B</u>	---
<u>Unofficial</u>		
k. Lay coroner	<u>B</u>	---
l. EMS record	<u>B</u>	<u>11</u>
m. Interviewee	<u>B</u>	---
n. Other source (specify):	<u>B</u>	<u>B</u>
o. Police report	<u>B</u>	<u>B</u>

	INITIAL SUBMISSION	UPDATED INFORMATION
OAL18. Medical Facility Code	<u>02</u>	<u>08</u>
GV14. Alcohol Test Results For Driver	<u>00</u>	---
GV16. Other Drug Specimen Test Type For Driver	---	---
OA05. Occupant's Age	<u>07</u>	<u>01</u>
OA06. Occupant's Sex	<u>2</u>	<u>2</u>
OA07. Occupant's Height	<u>999</u>	---
OA08. Occupant's Weight	<u>999</u>	---
OA61. Treatment-Mortality	<u>3</u>	<u>3</u>
OA62. Type of Medical Facility (for Initial Treatment)	<u>2</u>	<u>1</u>
OA63. Hospital Stay	<u>99</u>	---



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 13
 2. Case Number - Stratum 149A
 3. Vehicle Number 01
 4. Occupant Number 03

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 10
 Code actual age at time of accident.
 (00) Less than one year old (specify by month):
 (97) 97 years and older
 (99) Unknown

6. Occupant's Sex 1
 (1) Male
 (2) Female-not reported pregnant
 (3) Female-pregnant-1st trimester(1st-3rd month)
 (4) Female-pregnant-2nd trimester(4th-6th month)
 (5) Female-pregnant-3rd trimester(7th-9th month)
 (6) Female-pregnant-term unknown
 (9) Unknown

7. Occupant's Height 999
 Code actual height to the nearest centimeter.
 (999) Unknown
 _____ inches X 2.54 = _____ centimeters

8. Occupant's Weight 999
 Code actual weight to the nearest kilogram.
 (999)Unknown
 _____ pounds X .4536 = _____ kilograms

9. Occupant's Role 2
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 22
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 9
 (0) Normal posture

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT**12. Ejection** 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____
- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 0

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility 2

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or disoriented
- (2) Removed from vehicle due to injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (9) Unknown

BELT SYSTEM FUNCTION

18. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify):

(9) Unknown

19. Manual (Active) Belt System Use 00

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify):

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify):

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify):
- (99) Unknown if belt used

20. Proper Use of Manual (Active) Belts 0

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify):

(8) Other improper use of manual belt system (specify):

(9) Unknown

21. Manual (Active) Belt Failure Modes During Accident 0

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):

(6) Broken retractor

(7) Combination of above (specify):

(8) Other manual belt failure (specify):

(9) Unknown

22. Shoulder Belt Upper Anchorage Adjustment 1

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

23. Automatic (Passive) Belt System Availability/Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

24. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify):
- (3) Automatic belt use unknown
- (9) Unknown

25. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

26. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify):

(8) Other improper use of automatic belt system (specify):

(9) Unknown

27. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):

(6) Broken retractor

(7) Combination of above (specify):

(8) Other automatic belt failure (specify):

(9) Unknown

POLICE REPORTED RESTRAINT USE

AIR BAG SYSTEM FUNCTION

28. Police Reported Belt Use 0
- (0) None used
 - (1) Police did not indicate belt use
 - (2) Shoulder belt
 - (3) Lap belt
 - (4) Lap and shoulder belt
 - (5) Belt used, type not specified
 - (6) Child safety seat.
 - (7) Automatic belt
 - (8) Other type belt, (specify): _____
 - (9) Police indicated "unknown" _____

29. Police Reported Air Bag Availability/Function 2
- (0) No air bag available
 - (1) Police did not indicate air bag availability/function
 - (2) Deployed
 - (3) Not deployed
 - (4) Unknown if deployed
 - (9) Police indicated "unknown"

Check the Primary Source Used In Determining Belt Use.

- Not equipped/not available/destroyed or rendered inoperative
- Vehicle inspection
- Official injury data
- Driver/occupant interview
- Other (specify): _____
- Unknown if belt used _____

30. Frontal Air Bag System Availability/Function (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify): _____
 - (3) Air bag not reinstalled _____
 - (9) Unknown

31. Frontal Air Bag System Deployment (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify): _____
 - (3) Air bag not reinstalled _____
 - (9) Unknown
- Specify type of "other" air bag present:*
- _____

33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) 0
- (0) Not equipped with an "other" air bag
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

34. Are There Indications of Air Bag System Failure? (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) No
 - (2) Yes (specify): _____
 - (9) Unknown _____

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 0

- (0) Not equipped/not available
 (1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
 (3) One previous accident with deployment
 (4) More than one previous accident with at least one deployment
 (8) Previous accidents, unknown deployment status
 (9) Unknown

36. Type of Air Bag 0

- (0) Not equipped/not available
 (1) Original manufacturer installed system
 (2) Retrofitted air bag
 (3) Replacement air bag
 (8) Unknown type of air bag
 (9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 0

- (0) Not equipped/not available
 (1) No prior maintenance
 (2) Yes, prior maintenance (specify): _____
 (9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 00

- (00) Not equipped/not available
 _____ Code the accident event sequence number that initiated the air bag deployment
 (96) Deployed, unknown event
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

39. CDC For Air Bag Deployment Impact 0

- (0) Not equipped/not available
 (1) Highest delta V
 (2) Second highest delta V
 (3) Other non-coded delta V (specify): _____
 (6) Deployed, unknown event
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact + 000

- (_000) Not equipped/not available
Code the value of the delta V for the impact that initiated the air bag deployment
 (_996) Deployment, unknown longitudinal Delta V
 (_997) Not deployed
 (_998) Unknown if deployed
 (_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 0

- (0) Not equipped/not available
 (1) No
 (2) Yes
 (3) Deployed, unknown if flap(s) opened at designated tear points
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 0

- (0) Not equipped/not available
 (1) No
 (2) Yes (specify): _____
 (3) Deployed, unknown if air bag module cover flap(s) damaged
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

43. Was There Damage To The Air Bag? 00

- (00) Not equipped/not available
 (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
 (03) Cut
 (04) Torn
 (05) Holed
 (06) Burned
 (07) Abraded
 (88) Other damage (specify): _____
 (95) Damaged, details unknown
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*

44. Source of Air Bag Damage 00
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (88) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):

 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):

 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 0
 (0) Not equipped/not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION

49. Head Restraint Type/Damage by Occupant at This Occupant Position 0
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 03
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):

 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 1
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track


Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION *continued*

53. Seat Back Incline Prior and Post Impact 01
 (00) Occupant not seated or no seat
 (01) Not adjustable


Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

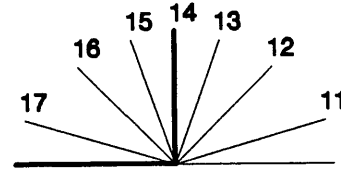


Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

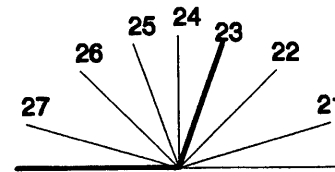

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

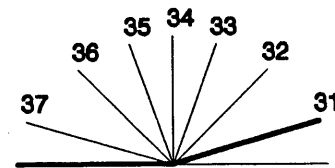

(99) Unknown

54. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion, (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000

(000) No child safety seat

Applicable codes are found in your NASS CDS
Data Collection, Coding and Editing

(950) Built-in child safety seat

(997) Other make/model (specify):

(998) Unknown make/model

(999) Unknown if child safety seat used

56. Type of Child Safety Seat 0

(0) No child safety seat

(1) Infant seat

(2) Toddler seat

(3) Convertible seat

(4) Booster seat - with shield

(5) Booster seat - without shield

(7) Other type child safety seat (specify):

(8) Unknown child safety seat type

(9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing

(02) Forward facing

(08) Other orientation (specify):

(09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing

(12) Forward facing

(18) Other orientation (specify):

(19) Unknown orientation

*Unknown Design or Orientation For This
Age/Weight, or Unknown Age/Weight*

(21) Rear facing

(22) Forward facing

(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 0059. Child Safety Seat Shield Usage 0060. Child Safety Seat Tether Usage 00Note: Options below applicable to
Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether(01) After market harness/shield/tether
added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market
harness/shield/tether added(09) Unknown if harness/shield/tether
added or used*Designed With Harness/Shield/Tether*

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

61. Injury Severity (Police Rating) 3

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 3 Y

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 2

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8). Other (specify):

- (9) Unknown

64. Hospital Stay 02
00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 97

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP WORK HERE

VARIABLES 66-74

TO BE CODED BY THE ZONE CENTER

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES**

66. Time to Death 00
 _____ Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
 (00) Not fatal
 (96) Fatal - ruled disease
 (99) Unknown

67. 1st Medically Reported Cause of Death 00

68. 2nd Medically Reported Cause of Death 00

69. 3rd Medically Reported Cause of Death 00

_____ Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
 (00) Not fatal or no additional causes
 (96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown

70. Number of Recorded Injuries for This Occupant 05

_____ Code the actual number of injuries recorded for this occupant.
 (00) No recorded injuries
 (97) Injured, details unknown
 (99) Unknown if injured

TRAUMA DATA

71. Glasgow Coma Scale (GCS) Score 15
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

72. Was the Occupant Given Blood? 9
 (1) No - blood not given
 (2) Yes - blood given
 (specify units): _____
 (9) Unknown if blood given

73. Arterial Blood Gases (ABG) - HCO₃ 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO₃
 (96) ABGs reported, HCO₃ unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>13</u>	3. Vehicle Number <u>01</u>
2. Case Number - Stratum <u>149A</u>	4. Occupant Number <u>03</u>

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

Source of Injury Data	A.I.S. - 90							Injury Source	Injury Confidence Level	Direct/ Indirect Injury	Occupant Area Intrusion Number	
	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect	Injury Source					
<i>brain</i>	1st	5. <u>2</u>	6. <u>1</u>	7. <u>4</u>	8. <u>06</u>	9. <u>70</u>	10. <u>3</u>	11. <u>2</u>	12. <u>151</u>	13. <u>2</u>	14. <u>1</u>	15. <u>00</u>
	2nd	16. <u>2</u>	17. <u>1</u>	18. <u>6</u>	19. <u>04</u>	20. <u>10</u>	21. <u>2</u>	22. <u>0</u>	23. <u>151</u>	24. <u>2</u>	25. <u>1</u>	26. <u>00</u>
<i>food</i>	3rd	27. <u>2</u>	28. <u>2</u>	29. <u>9</u>	30. <u>02</u>	31. <u>02</u>	32. <u>1</u>	33. <u>2</u>	34. <u>151</u>	35. <u>2</u>	36. <u>1</u>	37. <u>00</u>
<i>eyebrow</i>	4th	38. <u>3</u>	39. <u>2</u>	40. <u>9</u>	41. <u>04</u>	42. <u>02</u>	43. <u>1</u>	44. <u>7</u>	45. <u>151</u>	46. <u>2</u>	47. <u>1</u>	48. <u>00</u>
<i>eye</i>	5th	49. <u>3</u>	50. <u>2</u>	51. <u>9</u>	52. <u>74</u>	53. <u>02</u>	54. <u>1</u>	55. <u>2</u>	56. <u>151</u>	57. <u>2</u>	58. <u>1</u>	59. <u>00</u>
	6th	60. ___	61. ___	62. ___	63. ___	64. ___	65. ___	66. ___	67. ___	68. ___	69. ___	70. ___
	7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
	8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
	9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
	10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head (2) Face (3) Neck (4) Thorax (5) Abdomen (6) Spine (7) Upper Extremity (8) Lower Extremity (9) Unspecified	<u>Vessels, Nerves, Organs, Bones, Joints</u> are assigned consecutive two digit numbers beginning with 02. The exceptions to this rule apply to:	Specific injuries are assigned consecutive two-digit numbers beginning with 02. To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(1) Right (2) Left (3) Bilateral (4) Central (5) Anterior (6) Posterior (7) Superior (8) Inferior (9) Unknown (0) Whole region
Type of Anatomic Structure	<u>Whole Area</u> (02) Skin - Abrasion (04) Skin - Contusion (06) Skin - Laceration (08) Skin - Avulsion (10) Amputation (20) Burn (30) Crush (40) Degloving (50) Injury - NFS (90) Trauma, other than mechanical <u>Head - LOC</u> (02) Length of LOC (04) Level (06) of (08) Consciousness (10) Concussion <u>Spine</u> (02) Cervical (04) Thoracic (06) Lumbar	Abbreviated Injury Scale (1) Minor Injury (2) Moderate Injury (3) Serious Injury (4) Severe Injury (5) Critical Injury (6) Maximum (untreatable) (7) Injured, unknown severity	

SOURCE OF INJURY DATA	INJURY SOURCE CONFIDENCE LEVEL	DIRECT/INDIRECT INJURY
<u>OFFICIAL RECORDS</u> (1) Autopsy records with or without hospital/medical records (2) Hospital/medical records other than emergency room (e.g., discharge summary) (3) Emergency room records only (including associated X-rays or other lab reports) (4) Private physician, walk-in or emergency clinic <u>UNOFFICIAL RECORDS</u> (5) Lay coroner report (6) E.M.S. personnel (7) Interviewee (8) Other source (specify): _____ (9) Police	(1) Certain (2) Probable (3) Possible (9) Unknown	(1) Direct contact injury (2) Indirect contact injury (3) Noncontact injury (7) Injured, unknown source

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify): _____
- (195) Other air bag compartment cover (specify): _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____

- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify): _____
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify): _____
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify): _____
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify): _____
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify): _____
- (599) Unknown vehicle or object

NONCONTACT INJURY


- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify): _____
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

ER ; CLOSED HEAD INJURY ; CANNOT REMEMBER WHAT HAPPENED


ER
Ⓡ EYEBROW
BRUISING

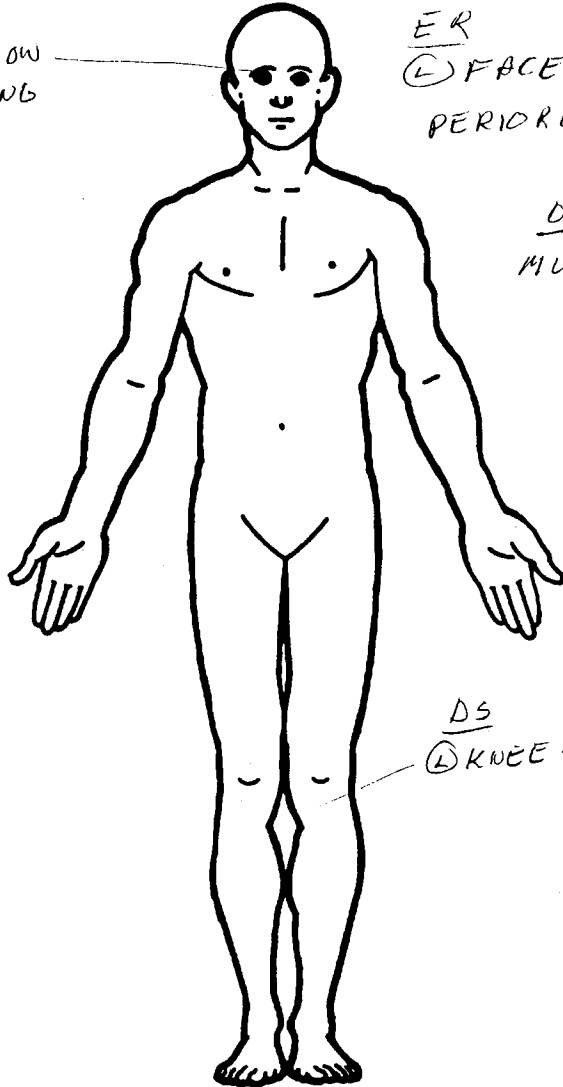

ER
Ⓛ FACE ABR.
PERIORBITAL ECCHYMOSIS

DS
MULTIPLE ABRASIONS

DS
Ⓛ KNEE - LAC, 1CM.

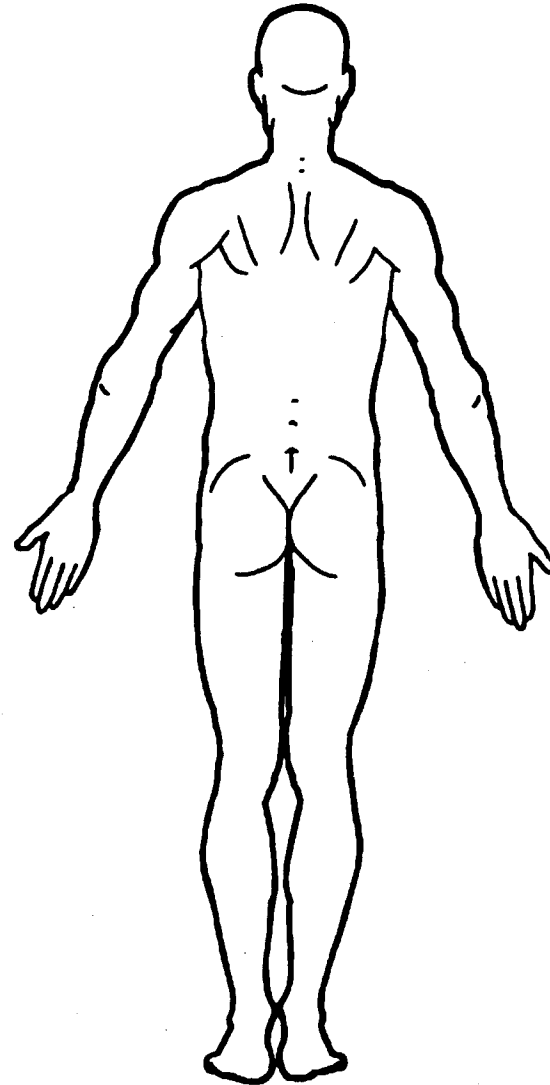

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

No

Yes

Blood Alcohol Level (mg/dl)

BAL = NR

Glasgow Coma Scale Score

GCSS = 15

A/D L3

Units of Blood Given

Units = NR

Arterial Blood Gases

pH = —



PO₂ = —

PCO₂ = —

HCO₃ = —


not reported

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

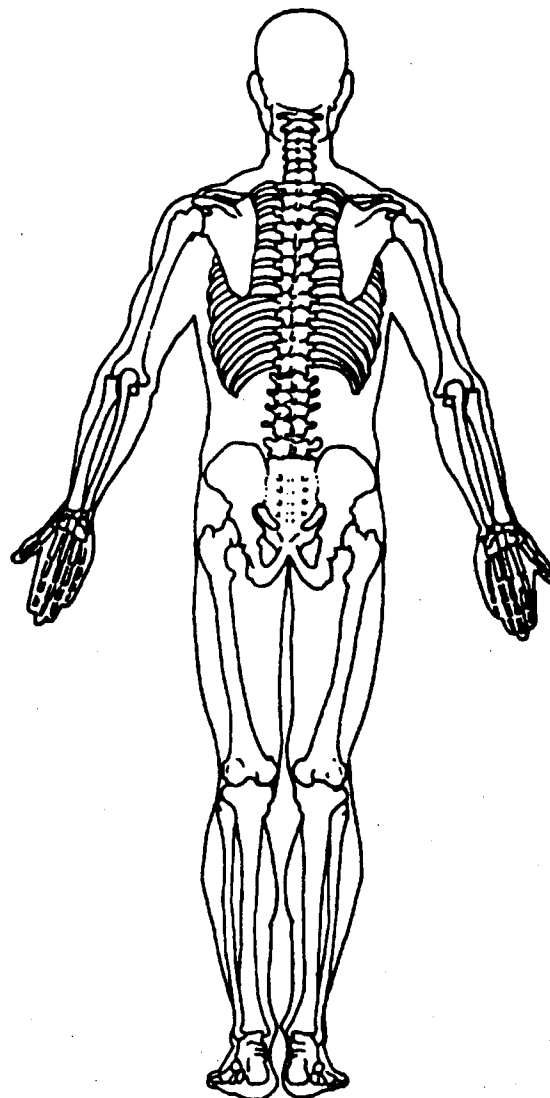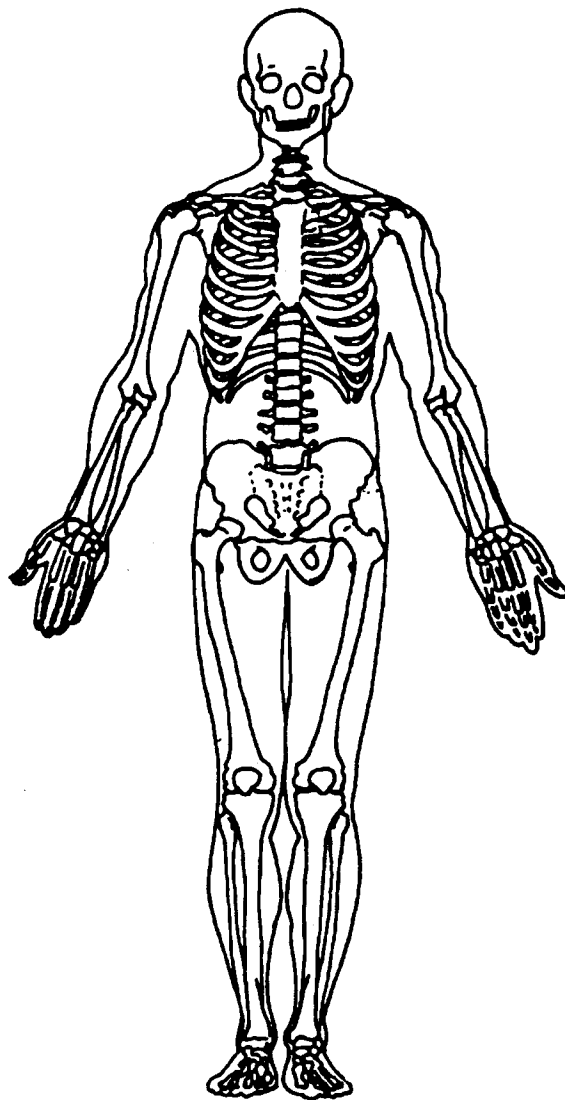

OFFICIAL INJURY DATA — INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

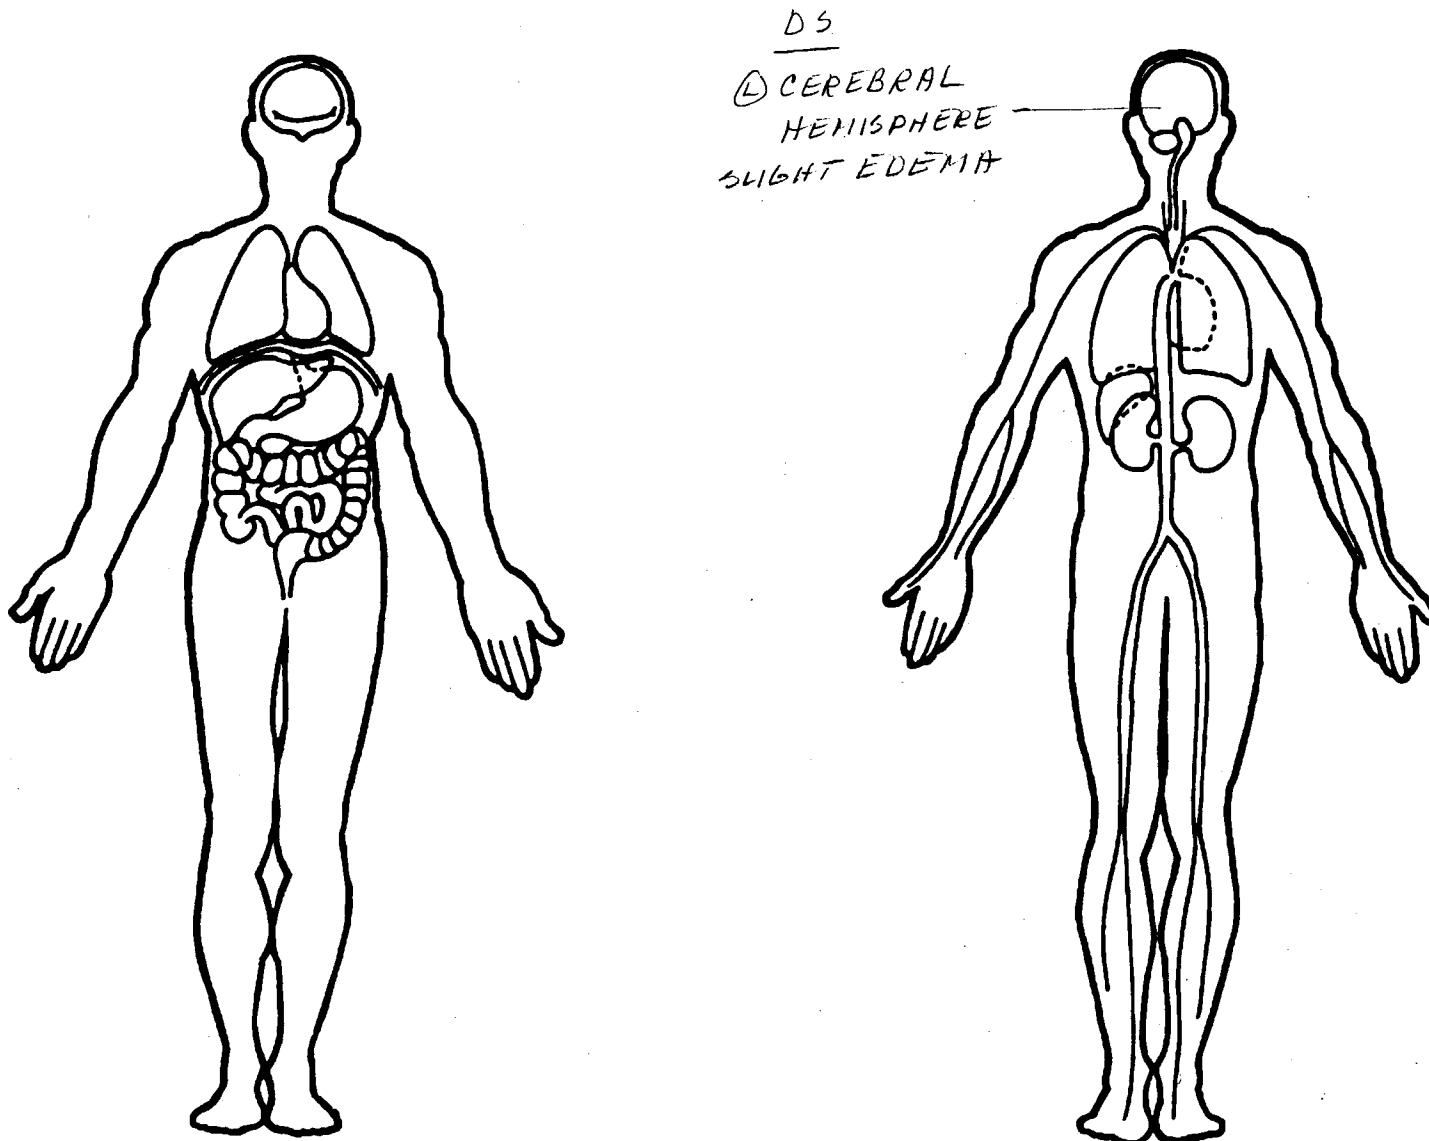

PRECRASH ENVIRONMENTAL DATA19. Relation To Interchange Or Junction 2

- (0) Non-interchange area and non-junction
 (1) Interchange area related

Non-Interchange junctions

- (2) Intersection related
 (3) Driveway, alley access related
 (4) Other junction (specify) _____

(5) Unknown type of junction

(9) Unknown

20. Trafficway Flow 0

- (0) Not physically divided (two way traffic)
 (1) Divided trafficway-median strip without positive barrier
 (2) Divided trafficway-median strip with positive barrier
 (3) One way traffic
 (9) Unknown

21. Number Of Travel Lanes 2

- (1) One
 (2) Two
 (3) Three
 (4) Four
 (5) Five
 (6) Six
 (7) Seven or more
 (9) Unknown

22. Roadway Alignment 1

- (1) Straight
 (2) Curve right
 (3) Curve left
 (9) Unknown

23. Roadway Profile 1

- (1) Level
 (2) Uphill grade (>2%)
 (3) Hill crest
 (4) Downhill grade (>2%)
 (5) Sag
 (9) Unknown

24. Roadway Surface Type 2

- (1) Concrete
 (2) Bituminous (asphalt)
 (3) Brick or block
 (4) Slag, gravel, or stone
 (5) Dirt
 (8) Other (specify): _____
 (9) Unknown

25. Roadway Surface Condition 1

- (1) Dry
 (2) Wet
 (3) Snow or slush
 (4) Ice
 (5) Sand, dirt, or oil
 (8) Other (specify): _____
 (9) Unknown

26. Light Conditions 1

- (1) Daylight
 (2) Dark
 (3) Dark, but lighted
 (4) Dawn
 (5) Dusk
 (9) Unknown

27. Atmospheric Conditions 0

- (0) No adverse atmospheric-related driving conditions
 (1) Rain
 (2) Sleet/hail
 (3) Snow
 (4) Fog
 (5) Rain and fog
 (6) Sleet and fog
 (7) Other (e.g., smog, smoke, blowing sand or dust, etc.) (specify): _____
 (9) Unknown

28. Traffic Control Device 1

- (0) No traffic control(s)
 (1) Traffic control signal (not RR crossing)

Regulatory

- (2) Stop sign
 (3) Yield sign
 (4) School zone sign
 (5) Other regulatory sign (specify): _____

(6) Warning sign (not RR crossing)

(7) Unknown sign

(8) Miscellaneous/other controls including RR controls (specify): _____

(9) Unknown

29. Traffic Control Device Functioning 2

- (0) No traffic control device
 (1) Traffic control device not functioning (specify): _____
 (2) Traffic control device functioning properly
 (9) Unknown

OCCUPANT RELATED

- 37. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
- 38. Number of Occupants This Vehicle 01
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
- 39. Number of Occupant Forms Submitted 01

AIR BAG RELATED

- 40. Is this an AOPS Vehicle? 0
 (0) No (includes unknown)
 (1) Yes - researcher determined
 (2) VIN determined air bag system
 (3) VIN determined automatic (passive) belts
 (4) VIN determined air bag and automatic (passive) belts
- 41. Air Bag(s) Deployment, First Seat Frontal 0
 (0) Not equipped or not available
 (1) No air bags deployed
Single Air Bag Vehicle
 (2) Driver air bag deployed
 (3) Driver air bag, unknown if deployed
Multiple Air Bag Vehicle
 (4) Driver side only deployed
 (5) Passenger side only deployed
 (6) Driver and passenger side deployed
 (7) Driver and passenger side unknown if deployed
 (8) Air bag(s) deployed, details unknown
 (9) Unknown
- 42. Air Bag(s) Deployment, Other Than First Seat Frontal 0
 (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

Specify type of "other" air bag present: _____

VEHICLE WEIGHT ITEMS

- 43. Vehicle Curb Weight 2,130
 Code weight to nearest 10 kilograms.
 (045) Less than 450 kilograms
 (610) 6,100 kilograms or more
 (999) Unknown
 lbs X .4536 = 2,132 kgs

Source: _____

- 44. Vehicle Cargo Weight 1,400
 Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (450) 4,500 kilograms or more
 (999) Unknown
3,080 lbs X .4536 = 1,397 kgs
 Source: _____

ROLLOVER DATA

- 45. Rollover 05
 (00) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
 (01-16) Code the number of quarter turns
 (17) Rollover, 17 or more quarter turns (specify): _____
 (98) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (99) Rollover (overturn), details unknown
- 46. Rollover Initiation Type 07
 (00) No rollover
 (01) Trip-over
 (02) Flip-over
 (03) Turn-over
 (04) Climb-over
 (05) Fall-over
 (06) Bounce-over
 (07) Collision with another vehicle
 (08) Other rollover initiation type specify): _____
 (98) Rollover--end-over-end
 (99) Unknown rollover initiation type
- 47. Location of Rollover Initiation 4
 (0) No rollover
 (1) On roadway
 (2) On shoulder--paved
 (3) On shoulder--unpaved
 (4) On roadside or divided trafficway median
 (8) Rollover--end-over-end
 (9) Unknown
- 48. Rollover Initiation Object Contacted 01
 (Note: Applicable codes on back of page)
- 49. Location on Vehicle Where Initial Principal Tripping Force Is Applied 2
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (6) Non-contact rollover forces (specify): _____
 (8) Rollover--end-over-end
 (9) Unknown

- 50. Direction of Initial Roll 2
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (8) Rollover--end-over-end
 (9) Unknown roll direction

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

(00) No rollover
(01-30) — Vehicle Number

Noncollision

(31) Turn-over — fall-over
(32) No rollover impact initiation (end-over-end)
(34) Jackknife

Collision With Fixed Object

(41) Tree (≤ 10 cm in diameter)
(42) Tree (> 10 cm in diameter)
(43) Shrubbery or bush
(44) Embankment

(45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

(50) Pole or post (≤ 10 cm in diameter)
(51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
(52) Pole or post (> 30 cm in diameter)
(53) Pole or post (diameter unknown)

(54) Concrete traffic barrier
(55) Impact attenuator
(56) Other traffic barrier (includes guardrail)
(specify): _____

(57) Fence
(58) Wall
(59) Building
(60) Ditch or culvert
(61) Ground
(62) Fire hydrant
(63) Curb
(64) Bridge
(68) Other fixed object (specify):

(69) Unknown fixed object

Collision with Nonfixed Object

(70) Passenger car, light truck, van, or other vehicle not in-transport
(71) Medium/heavy truck or bus not in-transport
(76) Animal
(77) Train
(78) Trailer, disconnected in transport
(79) Object fell from vehicle in-transport
(88) Other nonfixed object (specify):

(89) Unknown nonfixed object

(98) Other event (specify):

(99) Unknown event or object


ORIGINAL SPECIFICATIONS WORK SHEET

Wheelbase	<u>136.8</u>	inches	x 2.54	=	<u>347</u>	cm
Overall Length	<u>208.8</u>	inches	x 2.54	=	<u>530</u>	cm
Maximum Width	_____	inches	x 2.54	=	_____	cm
Curb Weight	<u>4700</u>	pounds	x .4536	=	<u>2132</u>	kg
Average Track	<u>62.2</u>	inches	x 2.54	=	<u>158</u>	cm
Front Overhang	<u>33.5</u>	inches	x 2.54	=	<u>85</u>	cm
Rear Overhang	_____	inches	x 2.54	=	_____	cm
Undeformed End Width	_____	inches	x 2.54	=	_____	cm
Engine Size: cyl./displ.	_____	cc	x .001	=	_____	L
	_____	CID	x .0164	=	_____	L


[REDACTED] ^{had}
 if weighted

VEHICLE DAMAGE SKETCH




<p>TIRE—WHEEL DAMAGE</p> <p>a. Rotation physically restricted</p> <p>RF <u>1</u> LF <u>2</u> RR <u>2</u> LR <u>2</u></p> <p>b. Tire deflated</p> <p>RF <u>2</u> LF <u>1</u> RR <u>3</u> LR <u>1</u></p> <p>(1) Yes (2) No (8) NA (9) Unk.</p>	<p>ORIGINAL SPECIFICATIONS</p> <p>Wheelbase <u>347</u> cm</p> <p>Overall Length <u>530</u> cm</p> <p>Maximum Width <u>measured 170</u> cm</p> <p>Curb Weight <u>2400^{lb} 2132</u> kg</p> <p>Average Track <u>158</u> cm</p> <p>Front Overhang <u>85</u> cm</p> <p>Rear Overhang <u>measured 100</u> cm</p> <p>Undeformed End Width <u>225</u> cm</p> <p>Engine Size: cyl./displ. <u>1/8/7.3</u> L <i>Diesel</i></p>	<p>WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only)</p> <p>RF ϕ <u>10</u> ° LF ϕ <u>10</u> ° RR \pm <u> </u> ° LR \pm <u> </u> °</p> <p>Within \pm 5 degrees</p>
<p>TYPE OF TRANSMISSION</p> <p><input type="checkbox"/> Manual <input checked="" type="checkbox"/> Automatic</p> <p>END SHIFT \geq 10 CM</p> <p><input type="checkbox"/> Yes <input checked="" type="checkbox"/> No</p>	<p>DRIVE WHEELS</p> <p><input type="checkbox"/> FWD <input type="checkbox"/> RWD <input checked="" type="checkbox"/> 4WD</p> <p>Approximate Cargo Weight <u>1392</u> kg</p>	

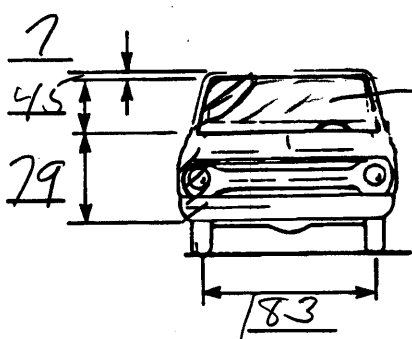

MEASUREMENTS IN CENTIMETERS

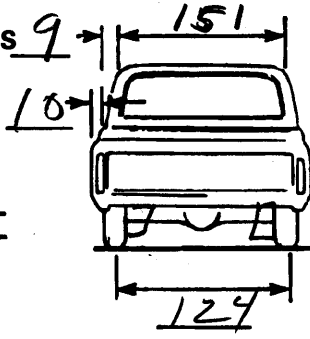

rock
No Rear Bumper

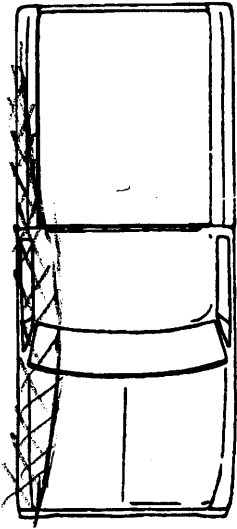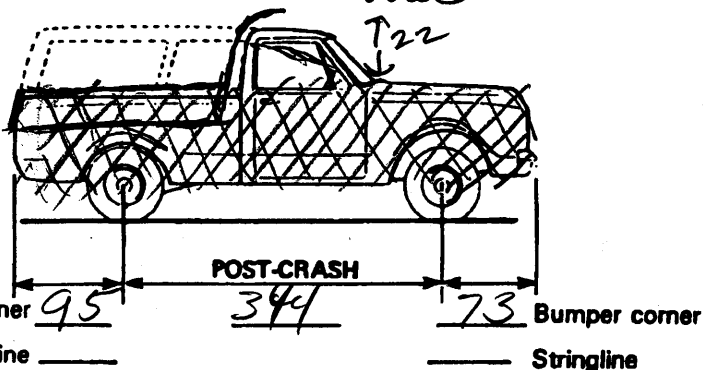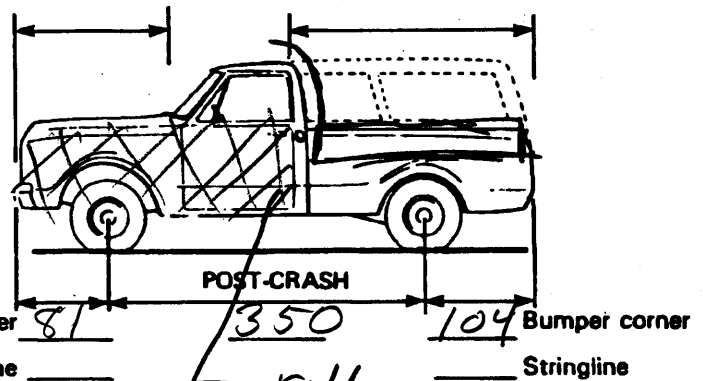

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

113

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>01</u>	6. <u>01</u>	7. <u>R</u>	8. <u>D</u>	9. <u>E</u>	10. <u>W</u>	11. <u>03</u>

Second Highest Delta "V"

12. 03 ⁰⁴	13. <u>31</u>	14. 00	15. <u>T</u>	16. <u>D</u>	17. <u>D</u>	18. <u>O</u>	19. <u>04</u>
---------------------------------	---------------	-------------------	--------------	--------------	--------------	--------------	---------------

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
<u>390</u>	<u>000</u>	<u>000</u>	<u>038</u>	<u>042</u>	<u>015</u>	<u>027</u>	<u>005</u>

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D
---	---	---	---	---	---	---	+
---	---	---	---	---	---	---	-

26. Undeformed End Width
(Coded when highest severity impact is an end plane impact.)
Code to the nearest centimeter
(250) 250 centimeters or more
(998) No highest severity end plane impact
(999) Unknown
998

27. Direct Damage Width
(For highest severity impact)
Code to the nearest centimeter
(250) 250 centimeters or more
(999) Unknown
390
250

28. Original Wheelbase
Code to the nearest centimeter
(650) 650 centimeters or more
(999) Unknown
_____ inches X 2.54 = _____ centimeters
347

29. Original Average Track Width
Code to the nearest centimeter
(185) 185 centimeters or more
(999) Unknown
_____ inches X 2.54 = _____ centimeters
158

FUEL SYSTEM

30. Are CDCs Documented but Not Coded on The Automated File? 0
 (0) No
 (1) Yes
31. Researcher's Assessment of Vehicle Disposition 1
 (0) Not towed due to vehicle damage
 (1) Towed due to vehicle damage
 (9) Unknown
32. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle? 1
 (0) No post manufacturer modifications
 (1) Yes - post manufacturer modifications (specify): Dump box Added
- (Include photograph of CERTIFICATION PLACARD in case report)
 (9) Unknown if vehicle is modified

35. Location of Fuel Tank-1 Filler Cap 4
36. Location of Fuel Tank-2 Filler Cap 2
 (0) No fuel tank
 (1) On back plane
 (2) Aft of center of the rear wheels (rear axle) on left side plane
 (3) Aft of center of the rear wheels (rear axle) on right side plane
 (4) Forward of center of the rear wheels (rear axle) on left side plane
 (5) Forward of center of the rear wheels (rear axle) on right side plane
 (6) Over the center of the rear wheels (rear axle) on left side plane
 (7) Over the center of the rear wheels (rear axle) on right side plane
 (8) Other (specify): _____
 (9) Unknown
37. Type of Fuel Tank-1 1
2
38. Type of Fuel Tank-2 Mag Test
 (0) No fuel tank (electrical vehicle)
 (1) Metallic
 (2) Non-metallic
 (9) Unknown

FIRE OCCURRENCE

33. Fire Occurrence 0
 (0) No fire
 Yes, fire occurred
 (1) Minor
 (2) Major
 (9) Unknown
34. Origin of Fire 0
 (0) No fire
 (1) Vehicle exterior (front, side, back, top)
 (2) Exhaust system
 (3) Fuel tank (and other fuel retention system parts)
 (4) Engine compartment
 (5) Cargo/trunk compartment
 (6) Instrument panel
 (7) Passenger compartment area
 (8) Other location (specify): _____
 (9) Unknown

39. Location of Fuel Tank-1 5
40. Location of Fuel Tank-2 F
 (0) No fuel tank
 (1) Aft of center of the rear wheels (rear axle) centered
 (2) Aft of center of the rear wheels (rear axle) left side
 (3) Aft of center of the rear wheels (rear axle) right side
 (4) Forward of center of the rear wheels (rear axle) centered
 (5) Forward of center of the rear wheels (rear axle) left side
 (6) Forward of center of the rear wheels (rear axle) right side
 (7) Over center of the rear wheels (rear axle)
 (8) Other (specify): _____
 (9) Unknown
41. Damage to Fuel Tank-1 1
42. Damage to Fuel Tank-2 1
 (0) No fuel tank
 (1) No damage to fuel tank
 (2) Deformed, no seam failure
 (3) Deformed, with a seam failure
 (4) Punctured
 (5) Lacerated (ripped)
 (6) Abraded (scraped)
 (7) Filler neck separation from the fuel tank
 (8) Other damage (specify): _____
 (9) Unknown

43. Leakage Location of Fuel System-1 1

44. Leakage Location of Fuel System-2 1

(0) No fuel tank
(1) No fuel leakage

Primary Area Of Leakage

(2) Tank
(3) Filler neck
(4) Cap
(5) Lines/pump/filter
(6) Vent/emission recovery
(8) Other (specify): _____
(9) Unknown

45. Fuel Type-1 02

46. Fuel Type-2 02

Single Fuel Type

(00) No fuel tank
(01) Gasoline
(02) Diesel
(03) CNG (Compressed Natural Gas)
(04) LPG (Liquid Petroleum Gas) also known as Propane
(05) LNG (Liquid Natural Gas)
(06) Methanol (M100 or M85)
(07) Ethanol (E100 or E85)
(08) Other (Hydrogen or others) (specify): _____

Electric Powered or Electric/Solar Powered Vehicles

(10) Lead Acid Battery
(11) Nickel-Iron Battery
(12) Nickel-Cadmium Battery
(13) Sodium Metal Chloride Battery
(14) Sodium Sulfur Battery
(18) Other (Specify): _____

(98) Other Hybrid (specify): _____

(99) Unknown fuel type

47. Is This Vehicle Equipped With More Than Two Fuel Tanks? 0

(0) No (one or two tanks only)

Yes - More Than Two Tanks

(1) Yes -- no damage to any tank or filler cap and no fuel system leakage

(2) Yes -- no damage to any tank or filler cap but there is fuel system leakage (specify leakage location): _____

(3) Yes -- damage to an additional tank or filler cap and there is fuel system leakage (specify the following):
 Type of tank _____
 Tank location _____
 Filler cap location _____
 Tank damage _____
 Location of leakage _____
 Type of fuel _____

(9) Unknown if more than two tanks

COMMENTS

*** STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED ***

(GV10=0)

DO NOT COMPLETE THE INTERIOR VEHICLE FORM.



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 13
 2. Case Number - Stratum 149A
 3. Vehicle Number 02

INTEGRITY

4. Passenger Compartment Integrity 11
 (00) No integrity loss

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door)
- (04) Roof
- (05) Roof glass
- (06) Side window
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):
- (99) Unknown

Door, Tailgate or Hatch Opening

5. LF 1 6. RF 3 7. LR 0 8. RR 0 9. TG/H 0

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify):
- (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 0 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

- (0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify):
- (9) Unknown

GLAZING

Type of Window/Windshield Glazing

15. WS 1 16. LF 2 17. RF 2 18. LR 0 19. RR 0
 20. BL 2 21. Roof 0 22. Other 2

- (0) No glazing
- (1) AS-1 - Laminated
- (2) AS-2 - Tempered
- (3) AS-3 - Tempered-tinted (original)
- (4) AS-2 - Tempered-with after market tint
- (5) AS-3 - Tempered-tinted (with additional after market tint)
- (6) AS-14 - Glass/Plastic
- (7) Glazing removed prior to accident
- (8) Other (specify):
- (9) Unknown

Window Precrash Glazing Status

23. WS 1 24. LF 4 25. RF 4 26. LR 0 27. RR 0
 28. BL 1 29. Roof 0 30. Other 3

- (0) No glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (7) Glazing removed prior to accident
- (9) Unknown

Glazing Damage from Impact Forces

31. WS 2 32. LF 1 33. RF 6 34. LR 0 35. RR 0
 36. BL 6 37. Roof 0 38. Other 6

- (0) No glazing
- (1) No glazing damage from impact forces
- (2) Glazing in place and cracked from impact forces
- (3) Glazing in place and holed from impact forces
- (4) Glazing out-of-place (cracked or not) and not holed from impact forces
- (5) Glazing out-of-place and holed from impact forces
- (6) Glazing disintegrated from impact forces
- (7) Glazing removed prior to accident
- (9) Unknown if damaged

Glazing Damage from Occupant Contact

39. WS 1 40. LF 1 41. RF 1 42. LR 0 43. RR 0
 44. BL 1 45. Roof 0 46. Other 1

- (0) No glazing
- (1) No occupant contact to glazing
- (2) Glazing contacted by occupant but no glazing damage
- (3) Glazing in place and cracked by occupant contact
- (4) Glazing in place and holed by occupant contact
- (5) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (6) Glazing out-of-place by occupant contact and holed by occupant contact
- (7) Glazing removed prior to accident
- (8) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. <u>13</u>	48. <u>13</u>	49. <u>3</u>	50. <u>3</u>
2nd	51. <u>13</u>	52. <u>11</u>	53. <u>1</u>	54. <u>1</u>
3rd	55. _____	56. _____	57. _____	58. _____
4th	59. _____	60. _____	61. _____	62. _____
5th	63. _____	64. _____	65. _____	66. _____
6th	67. _____	68. _____	69. _____	70. _____
7th	71. _____	72. _____	73. _____	74. _____
8th	75. _____	76. _____	77. _____	78. _____
9th	79. _____	80. _____	81. _____	82. _____
10th	83. _____	84. _____	85. _____	86. _____

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Side panel - forward of the A1/A2-pillar
- (11) Door panel (side)
- (12) Side panel - rear of the B-pillar
- (13) Roof (or convertible top)
- (14) Roof side rail
- (15) Windshield
- (16) Windshield header
- (17) Window frame
- (18) Floor pan (includes sill)
- (19) Backlight header
- (20) Front seat back
- (21) Second seat back
- (22) Third seat back
- (23) Fourth seat back
- (24) Fifth seat back
- (25) Seat cushion
- (26) Back door/panel (e.g., tailgate)
- (27) Other interior component (specify): _____

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify): _____
- (32) Other exterior object in the environment (specify): _____
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify): _____
- (99) Unknown

LOCATION OF INTRUSION

- Front Seat
- (11) Left
 - (12) Middle
 - (13) Right

- Fourth Seat
- (41) Left
 - (42) Middle
 - (43) Right

- Second Seat
- (21) Left
 - (22) Middle
 - (23) Right

- (97) Catastrophic
- (98) Other enclosed area (specify) _____

- Third Seat
- (31) Left
 - (32) Middle
 - (33) Right

- (99) Unknown

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION




- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)


COMPARISON VALUE	—	DAMAGE VALUE	=	DEFORMATION
------------------	---	--------------	---	-------------

	—		=	
	—		=	
	—		=	
	—		=	

STEERING COLUMN	INSTRUMENT PANEL
<p>87. Steering Column Type <u>1</u></p> <p>(1) Fixed column (2) Tilt column (3) Telescoping column (4) Tilt and telescoping column (8) Other column type (specify): _____ (9) Unknown</p>	<p>92. Odometer Reading <u>999,000</u></p> <p>_____ kilometers Code to the nearest 1,000 kilometers (000) No odometer (001) Less than 1,500 kilometers (500) 499,500 kilometers or more (999) Unknown <i>Unable To Read</i></p> <p>_____ miles X 1.6093 = _____ kilometers</p> <p>Source: _____</p>
<p>88. Tilt Steering Column Adjustment <u>0</u></p> <p>(0) No tilt steering column (1) Full up (2) Between full up and center (3) Center (4) Between center and full down (5) Full down (9) Unknown</p>	<p>93. Instrument Panel Damage from Occupant Contact? <u>0</u></p> <p>(0) No (1) Yes (9) Unknown</p>
<p>89. Telescoping Steering Column Adjustment <u>0</u></p> <p>(0) No telescoping steering column (1) Full back (2) Between full back and midpoint (3) Midpoint (4) Between midpoint and full forward (5) Full forward (9) Unknown</p>	<p>94. Type of Knee Bolster Covering <u>0</u></p> <p>(0) No knee bolster (1) Padded (2) Rigid plastic (8) Other (specify): _____ (9) Unknown</p>
<p>90. Steering Rim/Spoke Deformation <u>00</u></p> <p>Code actual measured deformation to the nearest centimeter (00) No steering rim deformation (01-14) Actual measured value in centimeters (15) 15 centimeters or more (98) Observed deformation cannot be measured (99) Unknown</p>	<p>95. Knee Bolsters Deformed from Occupant Contact? <u>0</u></p> <p>(0) No knee bolster (1) No deformation (2) Yes - deformation (9) Unknown</p>
<p>91. Location of Steering Rim/Spoke Deformation <u>00</u></p> <p>(00) No steering rim deformation</p> <p><i>Quarter Sections</i></p> <p>(01) Section A (02) Section B (03) Section C (04) Section D</p> <div style="display: flex; align-items: center; gap: 20px;">   </div> <p><i>Half Sections</i></p> <p>(05) Upper half of rim/spoke (06) Lower half of rim/spoke (07) Left half of rim/spoke (08) Right half of rim/spoke</p> <div style="display: flex; align-items: center; gap: 20px;">  </div> <p>(09) Complete steering wheel collapse (10) Undetermined location (99) Unknown</p>	<p>96. Did Glove Compartment Door Open During Collision(s)? <u>1</u></p> <p>(0) No glove compartment door (1) No - door did not open (2) Yes - door opened (9) Unknown</p>
<p>97. Adaptive (Assistive) Driving Equipment <u>0</u></p> <p>(0) No adaptive driving equipment (1) Adaptive driving equipment installed (Check all that apply.)</p> <p>[] Hand controls for braking/acceleration [] Steering control devices (attached to OEM steering wheel) [] Steering knob attached to steering wheel [] Low effort power steering (unit or device) [] Replacement steering wheel (i.e., reduced diameter) [] Joy-stick steering controls [] Wheelchair tie-downs [] Modification to seat belts (specify): _____ [] Additional or relocated switches (specify): _____ [] Raised roof [] Wall-mounted head rest (used behind wheelchair) [] Other adaptive device (specify): _____</p> <p>(9) Unknown</p>	<p>97. Adaptive (Assistive) Driving Equipment <u>0</u></p> <p>(0) No adaptive driving equipment (1) Adaptive driving equipment installed (Check all that apply.)</p> <p>[] Hand controls for braking/acceleration [] Steering control devices (attached to OEM steering wheel) [] Steering knob attached to steering wheel [] Low effort power steering (unit or device) [] Replacement steering wheel (i.e., reduced diameter) [] Joy-stick steering controls [] Wheelchair tie-downs [] Modification to seat belts (specify): _____ [] Additional or relocated switches (specify): _____ [] Raised roof [] Wall-mounted head rest (used behind wheelchair) [] Other adaptive device (specify): _____</p> <p>(9) Unknown</p>

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

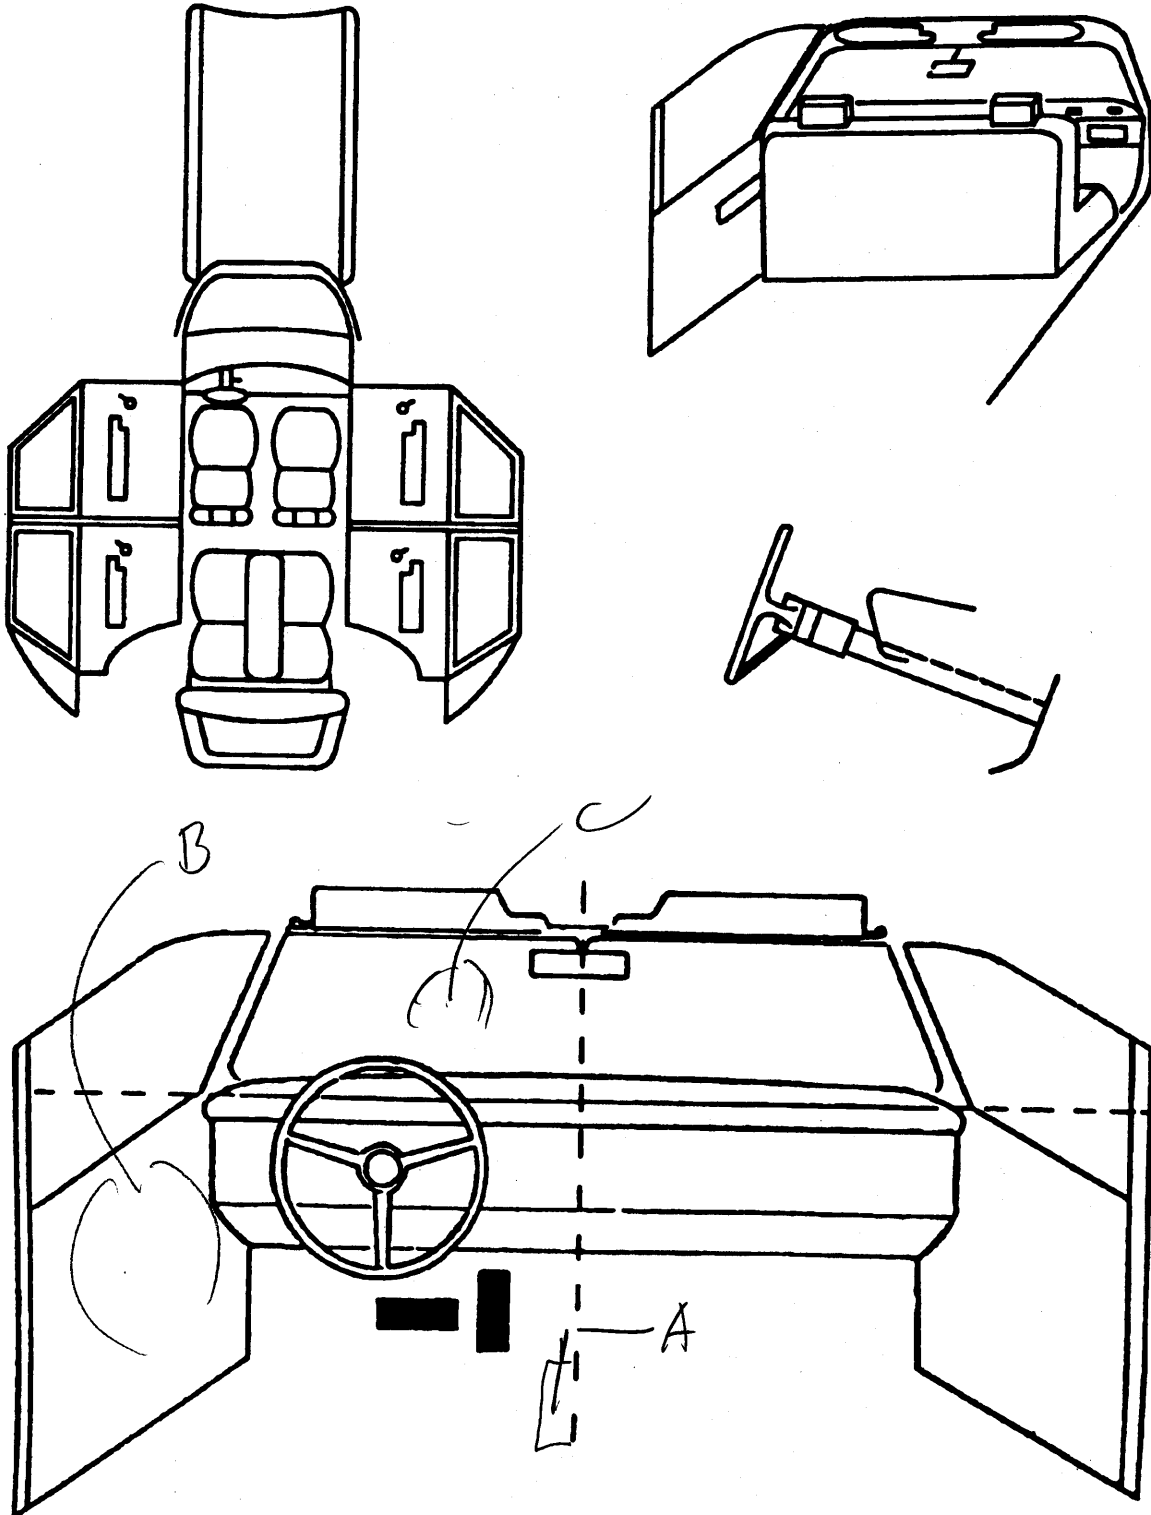

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).
Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.
Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	252	1	Leg	Scuff Fabric	2
B	051	1	Hip	Scuff Fabric blood skin	2
C	001	1	Hand	SKIN	2
D					
E					
F					
G					
H					
I					
J					
K					
L					
M					
N					

CODES FOR INTERIOR COMPONENTS

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object, (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests
- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (175) Air bag compartment cover-driver side
- (180) Air bag-passenger side
- (185) Air bag compartment cover-passenger side
- (190) Other air bag (specify) _____
- (195) Other air bag compartment cover (specify) _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof
- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form. If a Child safety seat is present, encode the data on the back of this page. If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous page.

		Left	Center	Right
F I R S T	Availability	4	3	4
	Evidence of usage	04	03	04
	Used in this crash?	1	0	0
	Proper Use	1	0	0
	Failure Modes	1	0	0
	Anchorage Adjustment	1	0	1
S E C O N D	Availability			
	Evidence of usage	X	X	X
	Used in this crash?	X	X	X
	Proper Use	X	X	X
	Failure Modes	X	X	X
	Anchorage Adjustment	X	X	X
O T H E R	Availability	X	X	X
	Evidence of usage	X	X	X
	Used in this crash?	X	X	X
	Proper Use	X	X	X
	Failure Modes	X	X	X
	Anchorage Adjustment	X	X	X

Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

- (9) Unknown

Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____

- (02) _____
- (03) Shoulder belt
- (04) Lap belt
- (05) Lap and shoulder belt
- (06) Belt used - type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of manual belt system (specify): _____
- (9) Unknown

Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other manual belt failure (specify): _____
- (9) Unknown

Shoulder Belt Upper Anchorage Adjustment

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Left Front	Right Front	Other
F I R S T	Availability/Function	 	 	
	Deployment	 	 	
	Failure	 	 	

Air Bag System Availability/Function

- (0) Not equipped/not available
- (1) Air bag

Non-functional

- (2) Air bag disconnected (specify): _____
- (3) Air bag not reinstalled
- (9) Unknown

Are There Indications of Air Bag System Failure? (This Occupant Position)

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____
- (9) Unknown

Frontal Air Bag System Deployment (This Occupant Position)

- (0) Not equipped/not available
- (1) Deployed during accident (as a result of impact)
- (2) Deployed inadvertently just prior to accident
- (3) Deployed, accident sequence undetermined
- (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (5) Unknown if deployed
- (7) Nondeployed
- (9) Unknown

Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position)

- (0) Not equipped with an "other" air bag
- (1) Deployed during accident (as a result of impact)
- (2) Deployed inadvertently just prior to accident
- (3) Deployed, details unknown
- (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (5) Unknown if deployed
- (7) Nondeployed
- (9) Unknown

AUTOMATIC BELTS

		Left	Right
F I R S T	Availability/Function	 	
	Use	 	
	Type	 	
	Proper Use	 	
	Failure Modes	 	

Automatic (Passive) Belt System Availability/Function

- (0) Not equipped/not available
 - (1) 2 point automatic belts
 - (2) 3 point automatic belts
 - (3) Automatic belts - type unknown
- Non-functional*
- (4) Automatic belts destroyed or rendered inoperative
 - (9) Unknown

Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
- (3) Automatic belt use unknown
- (9) Unknown

Automatic (Passive) Belt System Type

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

Proper Use of Automatic (Passive) Belt System

- (0) Not equipped/not available/not used
 - (1) Automatic belt used properly
 - (2) Automatic belt used properly with child safety seat
- Automatic Belt Used Improperly*
- (3) Automatic shoulder belt worn under arm
 - (4) Automatic shoulder belt worn behind back
 - (5) Automatic belt worn around more than one person
 - (6) Lap portion of automatic belt worn on abdomen
 - (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____
 - (8) Other improper use of automatic belt system (specify): _____
 - (9) Unknown

Automatic (Passive) Belt Failure Modes During Accident

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

FIRST SEAT FRONTAL AIR BAGS

NOTES: Encode the applicable data *for the driver and first seat passenger* in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

	Driver	Passenger
Type of air bag?	X	X
Flaps open at tear points?		
Flaps damaged?		
Air bag damaged?		
Source of air bag damage		
Air bag tethered?		
Air bag have vent ports?		
Other occupant contact air bag?		
Occupant wearing eyewear?		

Type of Air Bag

- (0) Not equipped/not available
- (1) Original manufacturer installed system
- (2) Retrofitted air bag
- (3) Replacement air bag
- (8) Unknown type of air bag
- (9) Unknown

Did Air Bag Module Cover Flap(s) Open At Designated Tear Points?

- (0) Not equipped/not available
- (1) No
- (2) Yes
- (3) Deployed, unknown if flap(s) opened at designated tear points
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

Were Air Bag Module Cover Flap(s) Damaged?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if air bag module cover flap(s) damaged
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

Was There Damage To The Air Bag?

- (00) Not equipped/not available
- (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
- (03) Cut
- (04) Torn
- (05) Holed
- (06) Burned
- (07) Abraded
- (88) Other damage (specify):

Source of Air Bag Damage

- (00) Not equipped/not available
- (01) Not damaged
- (02) Object worn by occupant, (specify):
- (03) Object carried by occupant, (specify):
- (04) Adaptive/assistive controls, (specify):
- (05) Fire in vehicle
- (06) Thermal burns
- (07) Rescue or emergency efforts
- (88) Other damage source (specify):
- (95) Damaged, unknown source
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

Was The Air Bag Tethered?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of tether straps):
- (3) Deployed, unknown if tethered
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

Did The Air Bag Have Vent Ports?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of vent ports):
- (3) Deployed, unknown if vent ports present
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

Was the Air Bag in this Occupant's Position Contacted by Another Occupant?


- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if other occupant contact to air bag
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

Was This Occupant Wearing Eye-wear?


- (0) Not equipped/not available
- (1) No
- (2) Eyeglasses/sunglasses
- (3) Contact lenses
- (4) Deployed, unknown if eyewear worn
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

DRIVER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Front)

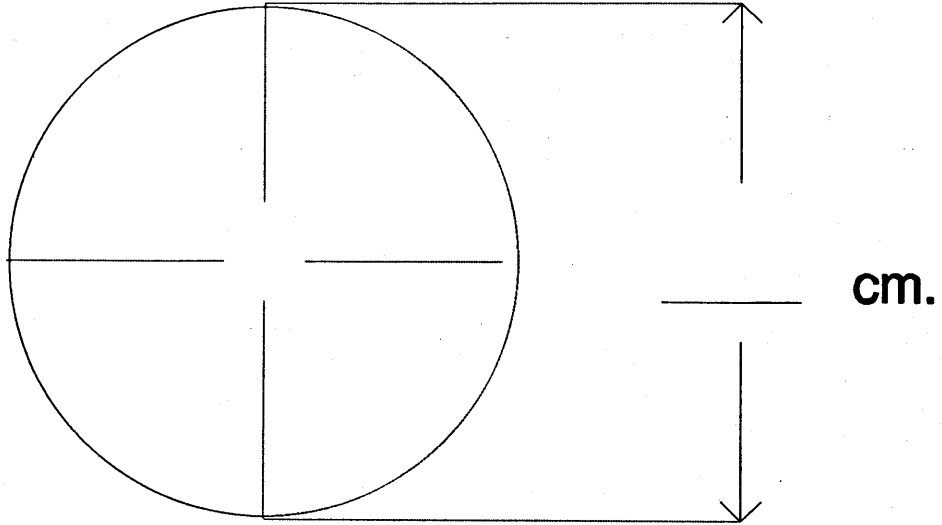


2. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Back)

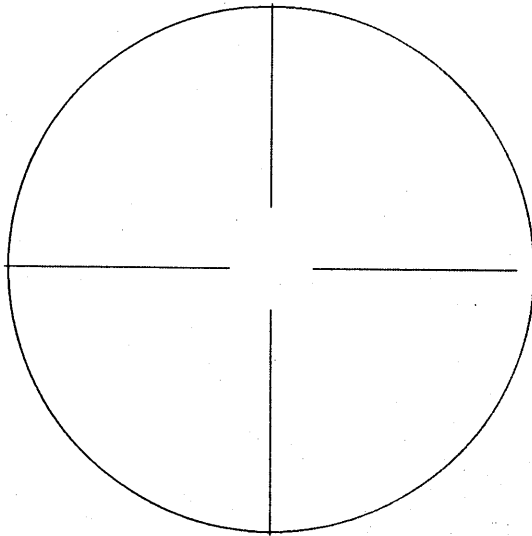

DRIVER AIR BAG SKETCHES (Cont'd)

3. DRIVER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)


- a. Upper Flap b. Lower Flap
- width (W_u) _____ width (W_l) _____
- height (H_u) _____ height (H_l) _____

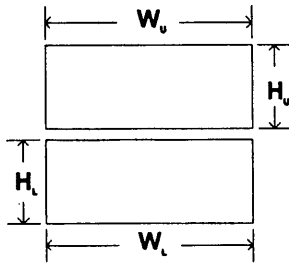

4. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE


5. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

6. SKETCH LOCATION OF CIRCULAR AIR BAG VENT PORTS

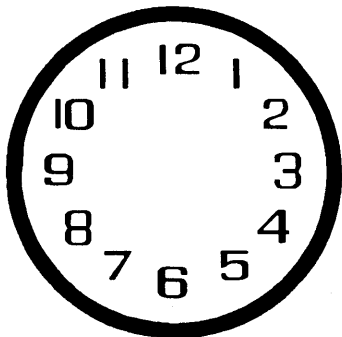


PASSENGER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Front)

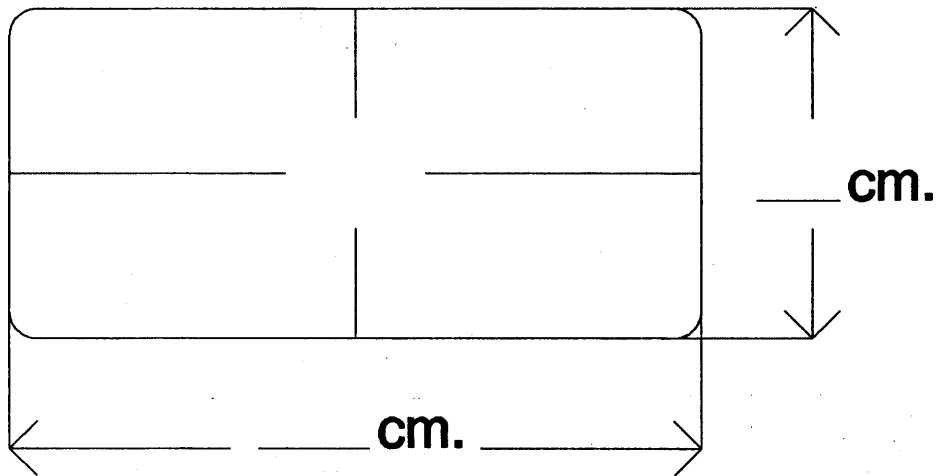

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Back)

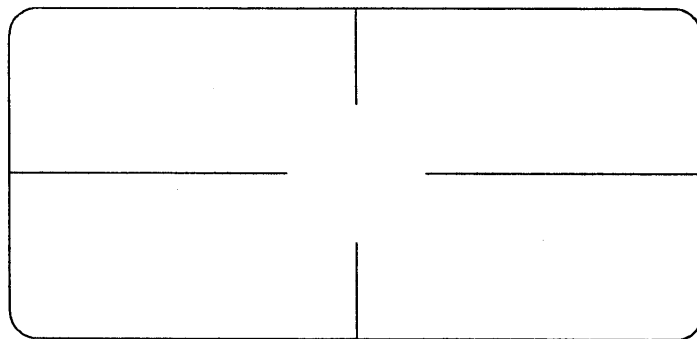


PASSENGER AIR BAG SKETCHES (Cont'd)

3. PASSENGER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

a. Flap

width (W) _____

height (H) _____

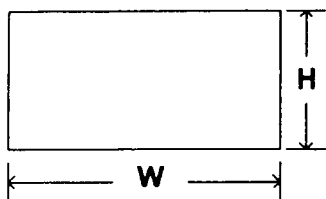

4. PASSENGER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap


b. Lower Flap

width (W_u) _____

width (W_l) _____

height (H_u) _____


height (H_l) _____

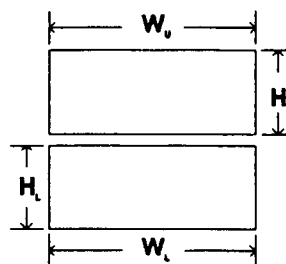

5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE

6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

7. SKETCH LOCATION OF RECTANGULAR AIR BAG VENT PORTS

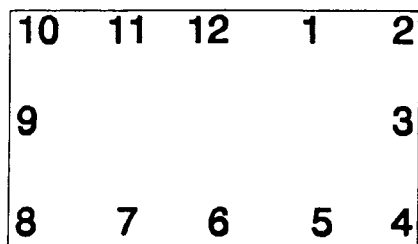

"OTHER" AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Front)

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Back)

"OTHER" AIR BAG SKETCHES (Cont'd)

3. SKETCH AIR BAG MODULE FLAP AND SIZE OR OPENING FOR AIRBAG

4. SKETCH AIR BAG VENT PORTS

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
FIRST	Head Restraint Type/Damage	3	6	3
	Seat Type	03	03	03
	Seat Performance	1	1	1
	Seat Orientation	1	1	1
	Seat Track Position	6	6	6
	Seat Back Incline Pre/Post Impact	01	01	01
SECOND	Head Restraint Type/Damage			
	Seat Type	X		X
	Seat Performance	X	X	X
	Seat Orientation			
	Seat Track Position	X	X	X
	Seat Back Incline Pre/Post Impact			
THIRD	Head Restraint Type/Damage			
	Seat Type	X	X	X
	Seat Performance	X	X	X
	Seat Orientation			
	Seat Track Position	X	X	X
	Seat Back Incline Pre/Post Impact			
OTHER	Head Restraint Type/Damage			
	Seat Type	X	X	X
	Seat Performance	X	X	X
	Seat Orientation			
	Seat Track Position	X	X	X
	Seat Back Incline Pre/Post Impact			

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

HEAD RESTRAINTS/SEAT EVALUATION

Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral -- no damage
- (2) Integral -- damaged during accident
- (3) Adjustable -- no damage
- (4) Adjustable -- damaged during accident
- (5) Add-on -- no damage
- (6) Add-on -- damaged during accident
- (8) Other
Specify): _____
- (9) Unknown

Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

Seat Track Adjusted Position Prior To Impact

- (0) Occupant not seated or no seat
- (1) Non-adjustable seat track
- Adjustable Seat Track**
- (2) Seat at forward most track position
- (3) Seat between forward most and middle track positions
- (4) Seat at middle track position
- (5) Seat between middle and rear most track positions
- (6) Seat at rear most track position
- (9) Unknown

Seat Back Incline Prior and Post Impact

- (00) Occupant not seated or no seat
- (01) Not adjustable

Upright prior to impact




- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position
- (99) Unknown

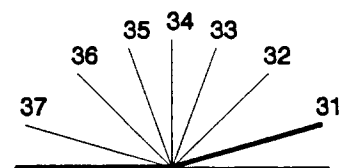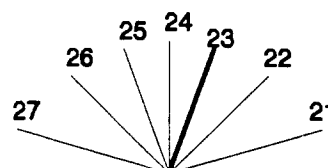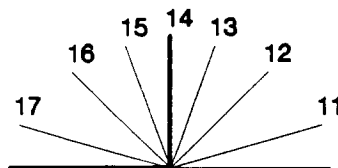

Coding diagrams for *Seat Back Incline Position Prior and Post Impact*

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

NA

1. Type of Child Safety Seat
 - (0) No child safety seat
 - (1) Infant seat
 - (2) Toddler seat
 - (3) Convertible seat
 - (4) Booster seat
 - (7) Other type child safety seat (specify): _____
 - (8) Unknown child safety seat type
 - (9) Unknown if child safety seat used

2. Child Safety Seat Orientation
 - (00) No child safety seat
 - Designed for Rear Facing for This Age/Weight
 - (01) Rear facing
 - (02) Forward facing
 - (08) Other orientation (specify): _____
 - (09) Unknown orientation
 - Designed for Forward Facing for This Age/Weight
 - (11) Rear facing
 - (12) Forward facing
 - (18) Other orientation (specify): _____
 - (19) Unknown orientation
 - Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
 - (21) Rear facing
 - (22) Forward facing
 - (28) Other orientation (specify): _____
 - (29) Unknown orientation
 - (99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage

4. Child Safety Seat Shield Usage

5. Child Safety Seat Tether Usage
 - Note: Options Below Are Used for Variables 3-5.
 - (00) No child safety seat
 - Not Designed with Harness/Shield/Tether
 - (01) After market harness/shield/tether added, not used
 - (02) After market harness/shield/tether used
 - (03) Child safety seat used, but no after market harness/shield/tether added
 - (09) Unknown if harness/shield/tether added or used
 - Designed With Harness/Shield/Tether
 - (11) Harness/shield/tether not used
 - (12) Harness/shield/tether used
 - (19) Unknown if harness/shield/tether used
 - Unknown If Designed With Harness/Shield/Tether
 - (21) Harness/shield/tether not used
 - (22) Harness/shield/tether used
 - (29) Unknown if harness/shield/tether used
 - (99) Unknown if child safety seat used

6. Child Safety Seat Make/Model
 - (Specify make/model and occupant number)
 - _____
 - _____
 - _____
 - _____

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No Yes

Describe indications of ejection and body parts involved in partial ejection(s):

Occupant Number						
Ejection						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						

- Ejection**
- (1) Complete ejection
 - (2) Partial ejection
 - (3) Ejection, Unknown degree
 - (9) Unknown

- Ejection Area**
- (1) Windshield
 - (2) Left front
 - (3) Right front
 - (4) Left rear
 - (5) Right rear
 - (6) Rear

- (7) Roof
- (8) Other area (e.g., back of pickup, etc.) (specify): _____
- (9) Unknown

- Ejection Medium**
- (1) Door/hatch/tailgate
 - (2) Nonfixed roof structure
 - (3) Fixed glazing
 - (4) Nonfixed glazing (specify): _____

- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

- Medium Status (Immediately Prior to Impact)**
- (1) Open
 - (2) Closed
 - (3) Integral structure
 - (9) Unknown

ENTRAPMENT No Yes

Describe entrapment mechanism: _____

Component(s): _____

(Note in vehicle interior diagram)



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 13
 2. Case Number - Stratum 149A
 3. Vehicle Number 02
 4. Occupant Number 01

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 34
 Code actual age at time of accident.
 (00) Less than one year old (specify by month): _____
 (97) 97 years and older _____
 (99) Unknown

6. Occupant's Sex 1
 (1) Male
 (2) Female-not reported pregnant
 (3) Female-pregnant-1st trimester(1st-3rd month)
 (4) Female-pregnant-2nd trimester(4th-6th month)
 (5) Female-pregnant-3rd trimester(7th-9th month)
 (6) Female-pregnant-term unknown
 (9) Unknown

7. Occupant's Height 183
 Code actual height to the nearest
 centimeter.
 (999) Unknown
72 inches X 2.54 = _____ centimeters

8. Occupant's Weight 082
 Code actual weight to the nearest
 kilogram.
 (999)Unknown
180 pounds X .4536 = _____ kilograms

9. Occupant's Role 1
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 0
 (0) Normal posture

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

- (5) Integral structure
- (8) Other medium (specify):

- (9) Unknown

15. Medium Status (Immediately Prior To Impact)

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or disoriented
- (2) Removed from vehicle due to injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (9) Unknown

BELT SYSTEM FUNCTION

18. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

(9) Unknown _____

19. Manual (Active) Belt System Use 04

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt _____
- (03) Lap belt _____
- (04) Lap and shoulder belt _____
- (05) Belt used—type unknown _____
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used _____

20. Proper Use of Manual (Active) Belts 1

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

21. Manual (Active) Belt Failure Modes During Accident +

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

22. Shoulder Belt Upper Anchorage Adjustment 1

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

23. Automatic (Passive) Belt System Availability/Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

24. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
- (3) Automatic belt use unknown
- (9) Unknown

25. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

26. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of automatic belt system (specify): _____

(9) Unknown _____

27. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other automatic belt failure (specify): _____

(9) Unknown _____

POLICE REPORTED RESTRAINT USE

AIR BAG SYSTEM FUNCTION

28. Police Reported Belt Use 4
- (0) None used
 - (1) Police did not indicate belt use
 - (2) Shoulder belt
 - (3) Lap belt
 - (4) Lap and shoulder belt
 - (5) Belt used, type not specified
 - (6) Child safety seat
 - (7) Automatic belt
 - (8) Other type belt, (specify): _____
 - (9) Police indicated "unknown"

29. Police Reported Air Bag Availability/Function 0
- (0) No air bag available
 - (1) Police did not indicate air bag availability/function
 - (2) Deployed
 - (3) Not deployed
 - (4) Unknown if deployed
 - (9) Police indicated "unknown"

Check the Primary Source Used In Determining Belt Use.

- Not equipped/not available/destroyed or rendered inoperative
- Vehicle inspection
- Official injury data
- Driver/occupant interview
- Other (specify): _____
- Unknown if belt used

30. Frontal Air Bag System Availability/Function (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify): _____
 - (3) Air bag not reinstalled
 - (9) Unknown

31. Frontal Air Bag System Deployment (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify): _____
 - (3) Air bag not reinstalled
 - (9) Unknown
- Specify type of "other" air bag present:*
- _____

33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) 0
- (0) Not equipped with an "other" air bag
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

34. Are There Indications of Air Bag System Failure? (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) No
 - (2) Yes (specify): _____
 - (9) Unknown

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 0

- (0) Not equipped/not available
- (1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
- (3) One previous accident with deployment
- (4) More than one previous accident with at least one deployment
- (8) Previous accidents, unknown deployment status
- (9) Unknown

36. Type of Air Bag 0

- (0) Not equipped/not available
- (1) Original manufacturer installed system
- (2) Retrofitted air bag
- (3) Replacement air bag
- (8) Unknown type of air bag
- (9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 0

- (0) Not equipped/not available
- (1) No prior maintenance
- (2) Yes, prior maintenance (specify): _____

(9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 00

- (00) Not equipped/not available
- _____ Code the accident event sequence number that initiated the air bag deployment

- (96) Deployed, unknown event
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

39. CDC For Air Bag Deployment Impact 0

- (0) Not equipped/not available
- (1) Highest delta V
- (2) Second highest delta V
- (3) Other non-coded delta V (specify): _____

- (6) Deployed, unknown event
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact +

- (_000) Not equipped/not available
Code the value of the delta V for the impact that initiated the air bag deployment
- (_996) Deployment, unknown longitudinal Delta V
- (_997) Not deployed
- (_998) Unknown if deployed
- (_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes
- (3) Deployed, unknown if flap(s) opened at designated tear points
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____
- (3) Deployed, unknown if air bag module cover flap(s) damaged
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

43. Was There Damage To The Air Bag? 00

- (00) Not equipped/not available
- (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
- (03) Cut
- (04) Torn
- (05) Holed
- (06) Burned
- (07) Abraded
- (88) Other damage (specify): _____

- (95) Damaged, details unknown
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*

44. Source of Air Bag Damage 00
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (88) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):

 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):

 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 0
 (0) Not equipped/not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION

49. Head Restraint Type/Damage by Occupant at This Occupant Position 3
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 03
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):


 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 6
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track
Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION *continued*

53. Seat Back Incline Prior and Post Impact 01
 (00) Occupant not seated or no seat
 (01) Not adjustable


Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

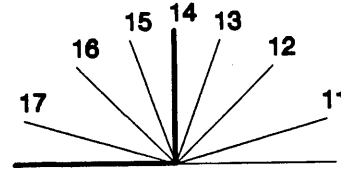


Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

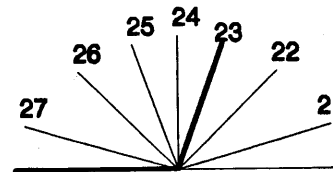

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

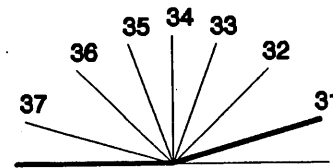

(99) Unknown

54. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion, (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000

(000) No child safety seat

Applicable codes are found in your NASS CDS
Data Collection, Coding and Editing

(950) Built-in child safety seat

(997) Other make/model (specify):

(998) Unknown make/model

(999) Unknown if child safety seat used

56. Type of Child Safety Seat 0

(0) No child safety seat

(1) Infant seat

(2) Toddler seat

(3) Convertible seat

(4) Booster seat - with shield

(5) Booster seat - without shield

(7) Other type child safety seat (specify):

(8) Unknown child safety seat type

(9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing

(02) Forward facing

(08) Other orientation (specify):

(09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing

(12) Forward facing

(18) Other orientation (specify):

(19) Unknown orientation

*Unknown Design or Orientation For This
Age/Weight, or Unknown Age/Weight*

(21) Rear facing

(22) Forward facing

(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 0059. Child Safety Seat Shield Usage 0060. Child Safety Seat Tether Usage 00Note: Options below applicable to
Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether(01) After market harness/shield/tether
added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market
harness/shield/tether added(09) Unknown if harness/shield/tether
added or used*Designed With Harness/Shield/Tether*

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

61. Injury Severity (Police Rating) 2

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 0

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 00

- (00) Not Hospitalized
Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 00

- Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP WORK HERE

VARIABLES 66-74

TO BE CODED BY THE ZONE CENTER

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES****TRAUMA DATA**

66. Time to Death 00

 Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
 (00) Not fatal
 (96) Fatal - ruled disease
 (99) Unknown

67. 1st Medically Reported Cause of Death 00

68. 2nd Medically Reported Cause of Death 00

69. 3rd Medically Reported Cause of Death 60

 Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
 (00) Not fatal or no additional causes
 (96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown

70. Number of Recorded Injuries for This Occupant 04

 Code the actual number of injuries recorded for this occupant.
 (00) No recorded injuries
 (97) Injured, details unknown
 (99) Unknown if injured

71. Glasgow Coma Scale (GCS) Score 01
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

72. Was the Occupant Given Blood? 1
 (1) No - blood not given
 (2) Yes - blood given
 (specify units): _____
 (9) Unknown if blood given

73. Arterial Blood Gases (ABG) - HCO₃ 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO₃
 (96) ABGs reported, HCO₃ unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>13</u>	3. Vehicle Number <u>02</u>
2. Case Number - Stratum <u>149A</u>	4. Occupant Number <u>01</u>

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

forehead cuts
④ shoulder cont
chest cont
abdomen cont

Source of Injury Data	A.I.S. - 90							Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect	Injury Source				
1st	5. <u>7</u>	6. <u>2</u>	7. <u>9</u>	8. <u>06</u>	9. <u>00</u>	10. <u>1</u>	11. <u>7</u>	12. <u>602</u>	13. <u>2</u>	14. <u>3</u>	15. <u>00</u>
2nd	16. <u>7</u>	17. <u>7</u>	18. <u>9</u>	19. <u>04</u>	20. <u>02</u>	21. <u>1</u>	22. <u>2</u>	23. <u>152</u>	24. <u>1</u>	25. <u>1</u>	26. <u>00</u>
3rd	27. <u>7</u>	28. <u>4</u>	29. <u>9</u>	30. <u>04</u>	31. <u>02</u>	32. <u>1</u>	33. <u>2</u>	34. <u>152</u>	35. <u>1</u>	36. <u>1</u>	37. <u>00</u>
4th	38. <u>7</u>	39. <u>5</u>	40. <u>9</u>	41. <u>04</u>	42. <u>02</u>	43. <u>1</u>	44. <u>7</u>	45. <u>152</u>	46. <u>1</u>	47. <u>1</u>	48. <u>00</u>
5th	49. ___	50. ___	51. ___	52. ___	53. ___	54. ___	55. ___	56. ___	57. ___	58. ___	59. ___
6th	60. ___	61. ___	62. ___	63. ___	64. ___	65. ___	66. ___	67. ___	68. ___	69. ___	70. ___
7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify): _____
- (195) Other air bag compartment cover (specify): _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____

- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

EXTERIOR OF OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify): _____
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify): _____
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify): _____
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify): _____
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT



- (551) Ground
- (598) Other vehicle or object (specify): _____
- (599) Unknown vehicle or object

NONCONTACT INJURY

- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify): _____
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

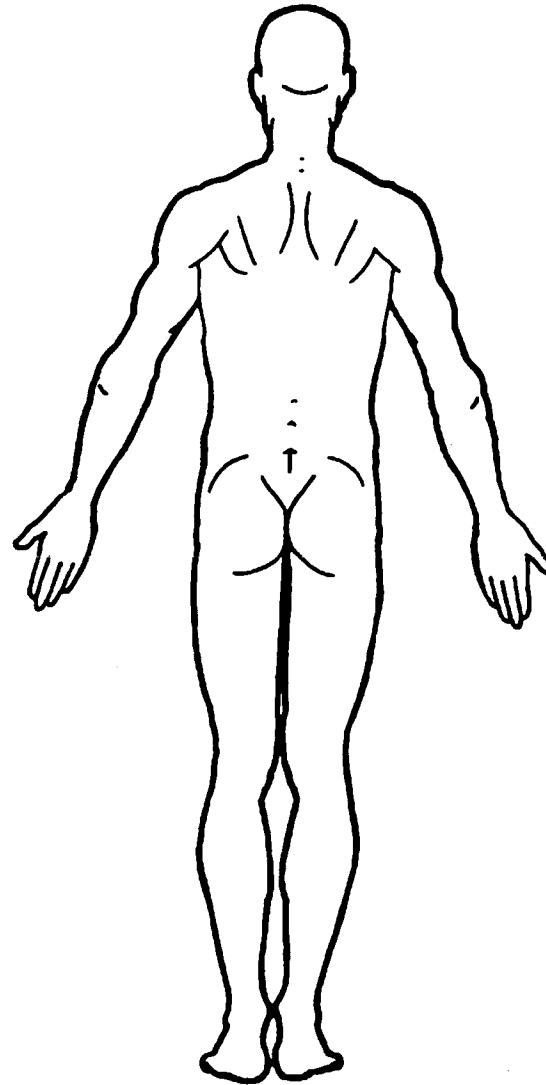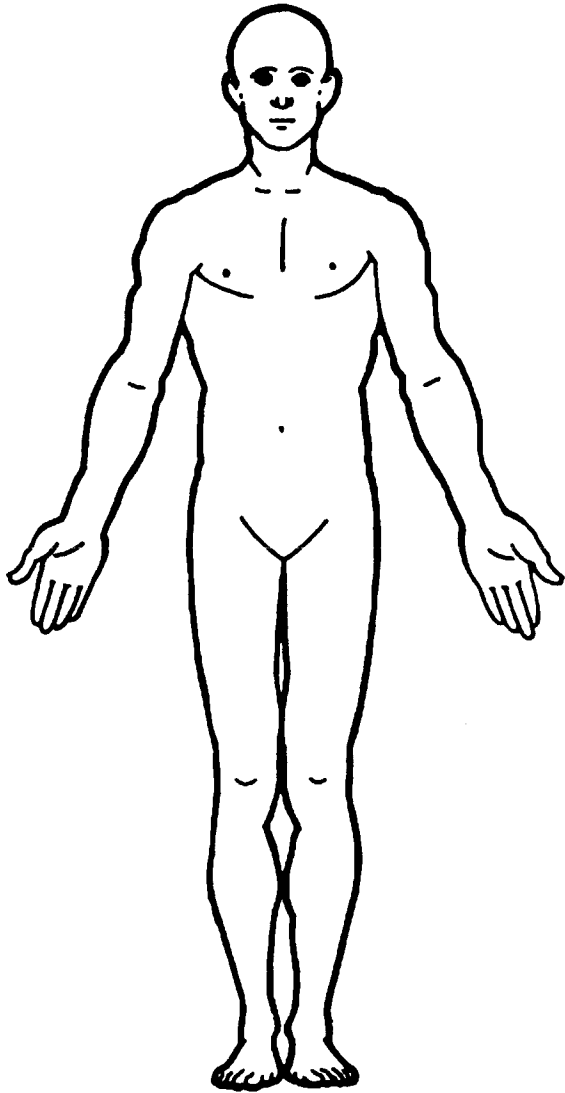

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

No

Yes

Blood Alcohol
Level (mg/dl)

BAL = _____

Glasgow Coma
Scale Score

GCSS = _____

Units of Blood
Given

Units = _____

Arterial Blood
Gases



pH = _____

PO₂ = _____

PCO₂ _____



HCO₃ _____

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

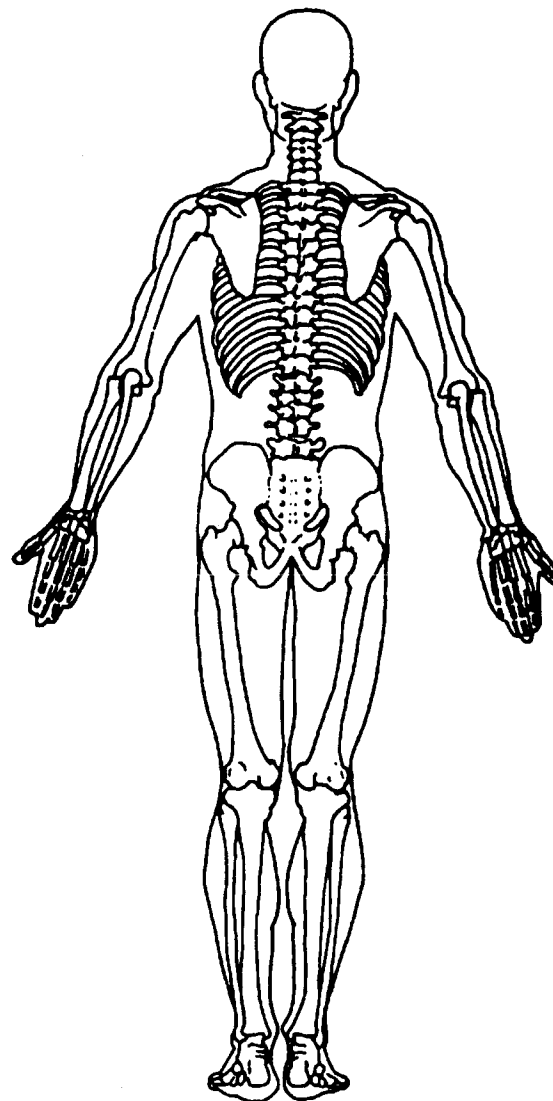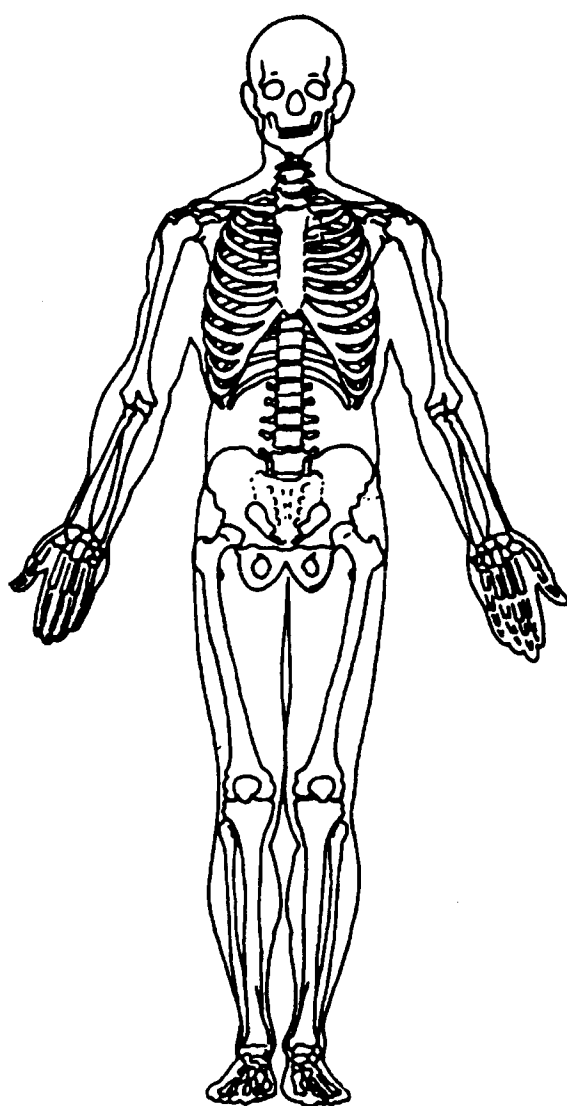

OFFICIAL INJURY DATA — INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

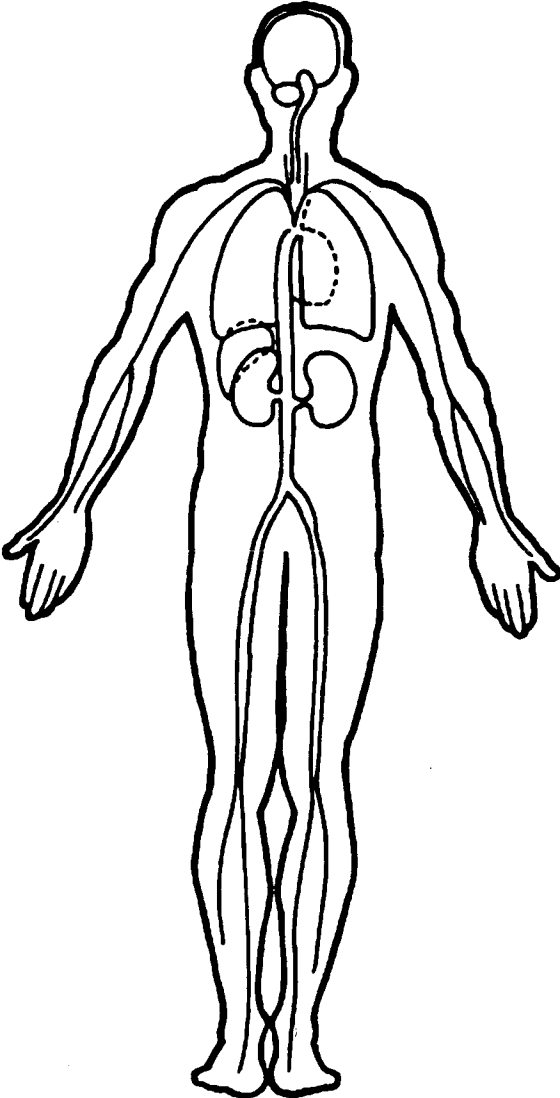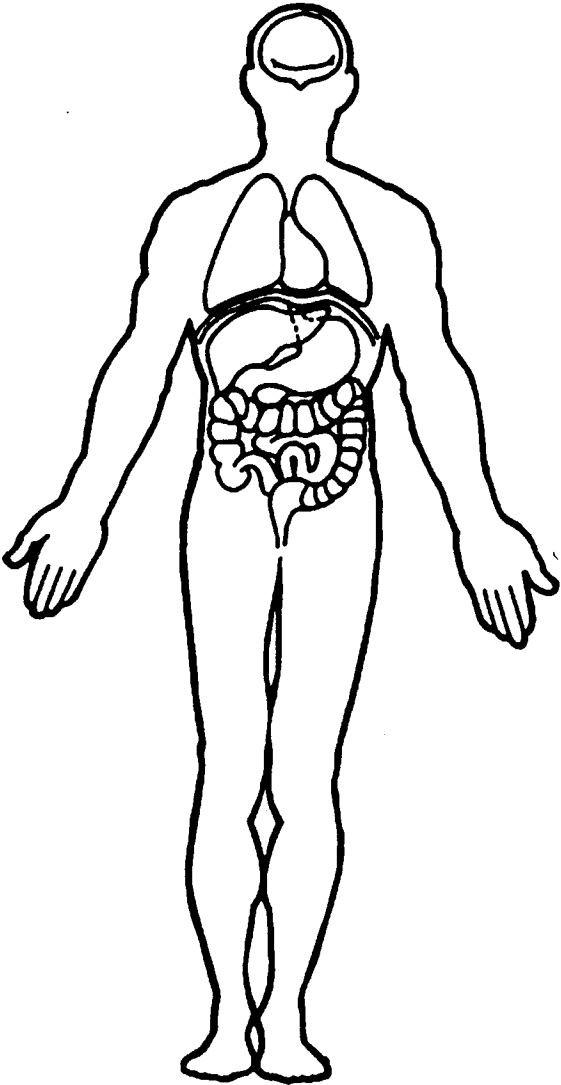

PRECRASH ENVIRONMENTAL DATA

19. Relation To Interchange Or Junction 2
 (0) Non-interchange area and non-junction
 (1) Interchange area related

Non-Interchange junctions

- (2) Intersection related
 (3) Driveway, alley access related
 (4) Other junction (specify) _____

(5) Unknown type of junction

(9) Unknown

20. Trafficway Flow 0
 (0) Not physically divided (two way traffic)
 (1) Divided trafficway-median strip without positive barrier
 (2) Divided trafficway-median strip with positive barrier
 (3) One way traffic
 (9) Unknown

21. Number Of Travel Lanes 2

- (1) One
 (2) Two
 (3) Three
 (4) Four
 (5) Five
 (6) Six
 (7) Seven or more
 (9) Unknown

22. Roadway Alignment 1

- (1) Straight
 (2) Curve right
 (3) Curve left
 (9) Unknown

23. Roadway Profile 1

- (1) Level
 (2) Uphill grade (>2%)
 (3) Hill crest
 (4) Downhill grade (>2%)
 (5) Sag
 (9) Unknown

24. Roadway Surface Type 2

- (1) Concrete
 (2) Bituminous (asphalt)
 (3) Brick or block
 (4) Slag, gravel, or stone
 (5) Dirt
 (8) Other (specify): _____
 (9) Unknown

25. Roadway Surface Condition 1

- (1) Dry
 (2) Wet
 (3) Snow or slush
 (4) Ice
 (5) Sand, dirt, or oil
 (8) Other (specify): _____
 (9) Unknown

26. Light Conditions 1

- (1) Daylight
 (2) Dark
 (3) Dark, but lighted
 (4) Dawn
 (5) Dusk
 (9) Unknown

27. Atmospheric Conditions 0

- (0) No adverse atmospheric-related driving conditions
 (1) Rain
 (2) Sleet/hail
 (3) Snow
 (4) Fog
 (5) Rain and fog
 (6) Sleet and fog
 (7) Other (e.g., smog, smoke, blowing sand or dust, etc.) (specify): _____
 (9) Unknown

28. Traffic Control Device 1

- (0) No traffic control(s)
 (1) Traffic control signal (not RR crossing)

Regulatory
 (2) Stop sign
 (3) Yield sign
 (4) School zone sign
 (5) Other regulatory sign (specify): _____

- (6) Warning sign (not RR crossing)
 (7) Unknown sign
 (8) Miscellaneous/other controls including RR controls (specify): _____
 (9) Unknown

29. Traffic Control Device Functioning 2

- (0) No traffic control device
 (1) Traffic control device not functioning (specify): _____
 (2) Traffic control device functioning properly
 (9) Unknown

OCCUPANT RELATED

- 37. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
- 38. Number of Occupants This Vehicle 01
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
- 39. Number of Occupant Forms Submitted 01

AIR BAG RELATED

- 40. Is this an AOPS Vehicle? 1
 (0) No (includes unknown)
 (1) Yes - researcher determined
 (2) VIN determined air bag system
 (3) VIN determined automatic (passive) belts
 (4) VIN determined air bag and automatic (passive) belts
- 41. Air Bag(s) Deployment, First Seat Frontal 0
 (0) Not equipped or not available
 (1) No air bags deployed
Single Air Bag Vehicle
 (2) Driver air bag deployed
 (3) Driver air bag, unknown if deployed
Multiple Air Bag Vehicle
 (4) Driver side only deployed
 (5) Passenger side only deployed
 (6) Driver and passenger side deployed
 (7) Driver and passenger side unknown if deployed
 (8) Air bag(s) deployed, details unknown
 (9) Unknown
- 42. Air Bag(s) Deployment, Other Than First Seat Frontal 0
 (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

Specify type of "other" air bag present: _____

VEHICLE WEIGHT ITEMS

- 43. Vehicle Curb Weight 1129 1180
 Code weight to nearest 10 kilograms.
 (045) Less than 450 kilograms
 (610) 6,100 kilograms or more
 (999) Unknown
 _____ lbs X .4536 = _____ kgs

Source: _____

- 44. Vehicle Cargo Weight 0000
 Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (450) 4,500 kilograms or more
 (999) Unknown
 _____ lbs X .4536 = _____ kgs

Source: _____

ROLLOVER DATA

- 45. Rollover 00
 (00) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
 (01-16) Code the number of quarter turns
 (17) Rollover, 17 or more quarter turns (specify): _____
 (98) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (99) Rollover (overturn), details unknown
- 46. Rollover Initiation Type 00
 (00) No rollover
 (01) Trip-over
 (02) Flip-over
 (03) Turn-over
 (04) Climb-over
 (05) Fall-over
 (06) Bounce-over
 (07) Collision with another vehicle
 (08) Other rollover initiation type specify): _____
 (98) Rollover--end-over-end
 (99) Unknown rollover initiation type
- 47. Location of Rollover Initiation 0
 (0) No rollover
 (1) On roadway
 (2) On shoulder—paved
 (3) On shoulder—unpaved
 (4) On roadside or divided trafficway median
 (8) Rollover--end-over-end
 (9) Unknown
- 48. Rollover Initiation Object Contacted 00
 (Note: Applicable codes on back of page)
- 49. Location on Vehicle Where Initial Principal Tripping Force Is Applied 0
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (6) Non-contact rollover forces (specify): _____
 (8) Rollover--end-over-end
 (9) Unknown
- 50. Direction of Initial Roll 0
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (8) Rollover--end-over-end
 (9) Unknown roll direction

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

- (00) No rollover
(01-30) — Vehicle Number
- Noncollision**
(31) Turn-over — fall-over
(32) No rollover impact initiation (end-over-end)
(34) Jackknife
- Collision With Fixed Object**
(41) Tree (≤ 10 cm in diameter)
(42) Tree (> 10 cm in diameter)
(43) Shrubbery or bush
(44) Embankment

(45) Breakaway pole or post (any diameter)
- Nonbreakaway Pole or Post**
(50) Pole or post (≤ 10 cm in diameter)
(51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
(52) Pole or post (> 30 cm in diameter)
(53) Pole or post (diameter unknown)

(54) Concrete traffic barrier
(55) Impact attenuator
(56) Other traffic barrier (includes guardrail)
(specify): _____
- (57) Fence
(58) Wall
(59) Building
(60) Ditch or culvert
(61) Ground
(62) Fire hydrant
(63) Curb
(64) Bridge
(68) Other fixed object (specify):

_____ (69) Unknown fixed object
- Collision with Nonfixed Object**
(70) Passenger car, light truck, van, or other vehicle not in-transport
(71) Medium/heavy truck or bus not in-transport
(76) Animal
(77) Train
(78) Trailer, disconnected in transport
(79) Object fell from vehicle in-transport
(88) Other nonfixed object (specify):

_____ (89) Unknown nonfixed object
- (98) Other event (specify):

_____ (99) Unknown event or object


ORIGINAL SPECIFICATIONS WORK SHEET

Wheelbase	<u>99.9</u>	inches	x 2.54	=	<u>254</u>	cm
Overall Length	<u>177.0</u>	inches	x 2.54	=	<u>450</u>	cm
Maximum Width	<u>68.3</u>	inches	x 2.54	=	<u>173</u>	cm
Curb Weight	<u>2600</u>	pounds	x .4536	=	<u>1179</u>	kg
Average Track	<u>56.3</u>	inches	x 2.54	=	<u>143</u>	cm
Front Overhang	<u>34.1</u>	inches	x 2.54	=	<u>87</u>	cm
Rear Overhang	<u>42.7</u>	inches	x 2.54	=	<u>108</u>	cm
Undeformed End Width	_____	inches	x 2.54	=	_____	cm
Engine Size: cyl./displ.	_____	cc	x .001	=	_____	L
	_____	CID	x .0164	=	_____	L

VEHICLE DAMAGE SKETCH

<p>TIRE-WHEEL DAMAGE</p> <p>a. Rotation physically restricted</p> <p>RF <u>2</u> LF <u>2</u> RR <u>2</u> LR <u>2</u></p> <p>b. Tire deflated</p> <p>RF <u>1</u> LF <u>1</u> RR <u>2</u> LR <u>2</u></p> <p>(1) Yes (2) No (8) NA (9) Unk.</p>	<p>ORIGINAL SPECIFICATIONS</p> <p>Wheelbase <u>254</u> cm</p> <p>Overall Length <u>450</u> cm</p> <p>Maximum Width <u>173</u> cm</p> <p>Curb Weight <u>1179</u> kg</p> <p>Average Track <u>143</u> cm</p> <p>Front Overhang <u>87</u> cm</p> <p>Rear Overhang <u>108</u> cm</p> <p>Undeformed End Width <u>161</u> cm</p> <p>Engine Size: cyl./displ. <u>4/2.3</u> L</p>	<p>WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only)</p> <p>RF ± <u> </u> ° LF ± <u> </u> ° RR ± <u> </u> ° LR ± <u> </u> °</p> <p>Within ± 5 degrees</p> <hr/> <p>DRIVE WHEELS</p> <p><input checked="" type="checkbox"/> FWD <input type="checkbox"/> RWD <input type="checkbox"/> 4WD</p> <hr/> <p>Approximate Cargo Weight <u> </u> kg</p>
<p>TYPE OF TRANSMISSION</p> <p><input type="checkbox"/> Manual <input checked="" type="checkbox"/> Automatic</p> <p>END SHIFT ≥ 10 CM</p> <p><input type="checkbox"/> Yes <input checked="" type="checkbox"/> No</p>		

MEASUREMENTS IN CENTIMETERS

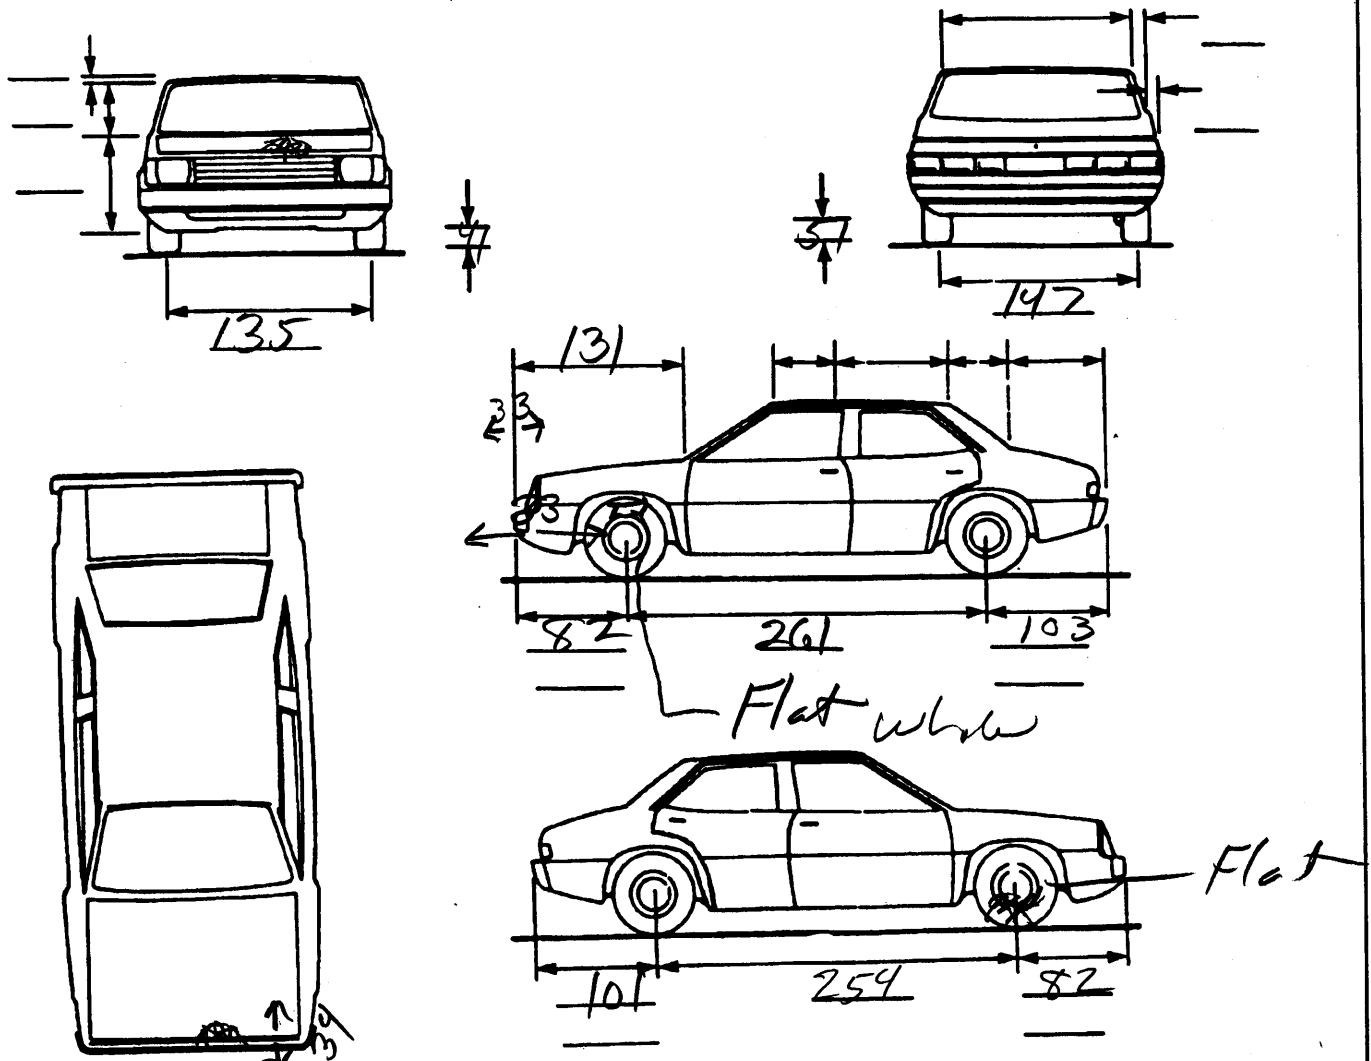

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. 02	5. 79	6. 99 72	7. FE	8. 9 D	9. 9 FE	10. 9 X	11. 99 02

Second Highest Delta "V"

12. _____ 13. _____ 14. _____ 15. _____ 16. _____ 17. _____ 18. _____ 19. _____

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
_____	_____	_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____	_____	_____

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D
_____	_____	_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____	_____	_____

26. Undeformed End Width
(Coded when highest severity impact is an end plane impact.)
Code to the nearest centimeter
(250) 250 centimeters or more
(998) No highest severity end plane impact
(999) Unknown

161

27. Direct Damage Width
(For highest severity impact)
Code to the nearest centimeter
(250) 250 centimeters or more
(999) Unknown

032

28. Original Wheelbase
Code to the nearest centimeter
(650) 650 centimeters or more
(999) Unknown
_____ inches X 2.54 = _____ centimeters

254

29. Original Average Track Width
Code to the nearest centimeter
(185) 185 centimeters or more
(999) Unknown
_____ inches X 2.54 = _____ centimeters

143

FUEL SYSTEM

30. Are CDCs Documented but Not Coded on The Automated File?
 (0) No
 (1) Yes

B

31. Researcher's Assessment of Vehicle Disposition
 (0) Not towed due to vehicle damage
 (1) Towed due to vehicle damage
 (9) Unknown

1

32. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle?
 (0) No post manufacturer modifications
 (1) Yes - post manufacturer modifications (specify): _____

0

(Include photograph of CERTIFICATION PLACARD in case report)
 (9) Unknown if vehicle is modified

35. Location of Fuel Tank-1 Filler Cap

3

36. Location of Fuel Tank-2 Filler Cap

0

- (0) No fuel tank
- (1) On back plane
- (2) Aft of center of the rear wheels (rear axle) on left side plane
- (3) Aft of center of the rear wheels (rear axle) on right side plane
- (4) Forward of center of the rear wheels (rear axle) on left side plane
- (5) Forward of center of the rear wheels (rear axle) on right side plane
- (6) Over the center of the rear wheels (rear axle) on left side plane
- (7) Over the center of the rear wheels (rear axle) on right side plane
- (8) Other (specify): _____
- (9) Unknown

37. Type of Fuel Tank-1

1

38. Type of Fuel Tank-2

- (0) No fuel tank (electrical vehicle)
- (1) Metallic
- (2) Non-metallic
- (9) Unknown

39. Location of Fuel Tank-1

4

40. Location of Fuel Tank-2

- (0) No fuel tank
- (1) Aft of center of the rear wheels (rear axle) centered
- (2) Aft of center of the rear wheels (rear axle) left side
- (3) Aft of center of the rear wheels (rear axle) right side
- (4) Forward of center of the rear wheels (rear axle) centered
- (5) Forward of center of the rear wheels (rear axle) left side
- (6) Forward of center of the rear wheels (rear axle) right side
- (7) Over center of the rear wheels (rear axle)
- (8) Other (specify): _____
- (9) Unknown

FIRE OCCURRENCE

33. Fire Occurrence
 (0) No fire

0

Yes, fire occurred
 (1) Minor
 (2) Major
 (9) Unknown

34. Origin of Fire

0

- (0) No fire
- (1) Vehicle exterior (front, side, back, top)
- (2) Exhaust system
- (3) Fuel tank (and other fuel retention system parts)
- (4) Engine compartment
- (5) Cargo/trunk compartment
- (6) Instrument panel
- (7) Passenger compartment area
- (8) Other location (specify): _____
- (9) Unknown

41. Damage to Fuel Tank-1

1

42. Damage to Fuel Tank-2

- (0) No fuel tank
- (1) No damage to fuel tank
- (2) Deformed, no seam failure
- (3) Deformed, with a seam failure
- (4) Punctured
- (5) Lacerated (ripped)
- (6) Abraded (scraped)
- (7) Filler neck separation from the fuel tank
- (8) Other damage (specify): _____
- (9) Unknown



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 13
 2. Case Number - Stratum 149A
 3. Vehicle Number 03

INTEGRITY

4. Passenger Compartment Integrity 00
 (00) No integrity loss

Yes, Integrity Was Lost Through

(01) Windshield
 (02) Door (side)
 (03) Door/hatch (back door)
 (04) Roof
 (05) Roof glass
 (06) Side window
 (07) Rear window (backlight)
 (08) Roof and roof glass
 (09) Windshield and door (side)
 (10) Windshield and roof
 (11) Side and rear window (side window and backlight)
 (12) Windshield and side window
 (13) Door and side window
 (98) Other combination of above (specify):
 (99) Unknown

Door, Tailgate or Hatch Opening

5. LF 1 6. RF 1 7. LR 1 8. RR 1 9. TG/H 0

(0) No door/gate/hatch
 (1) Door/gate/hatch remained closed and operational
 (2) Door/gate/hatch came open during collision
 (3) Door/gate/hatch jammed shut
 (8) Other (specify):
 (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 0 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

(0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

(1) Door operational (no damage)
 (2) Latch/striker failure due to damage
 (3) Hinge failure due to damage
 (4) Door structure failure due to damage
 (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
 (6) Latch/striker and hinge failure due to damage
 (8) Other failure (specify):
 (9) Unknown

GLAZING

Type of Window/Windshield Glazing

15. WS 1 16. LF 2 17. RF 2 18. LR 2 19. RR 2
 20. BL 2 21. Roof 0 22. Other 2

(0) No glazing
 (1) AS-1 - Laminated
 (2) AS-2 - Tempered
 (3) AS-3 - Tempered-tinted (original)
 (4) AS-2 - Tempered-with after market tint
 (5) AS-3 - Tempered-tinted (with additional after market tint)
 (6) AS-14 - Glass/Plastic
 (7) Glazing removed prior to accident
 (8) Other (specify):
 (9) Unknown

Window Precrash Glazing Status

23. WS 1 24. LF 2 25. RF 2 26. LR 2 27. RR 2
 28. BL 1 29. Roof 0 30. Other 1

(0) No glazing
 (1) Fixed
 (2) Closed
 (3) Partially opened
 (4) Fully opened
 (7) Glazing removed prior to accident
 (9) Unknown

Glazing Damage from Impact Forces

31. WS 1 32. LF 1 33. RF 1 34. LR 1 35. RR 1
 36. BL 1 37. Roof 0 38. Other 1

(0) No glazing
 (1) No glazing damage from impact forces
 (2) Glazing in place and cracked from impact forces
 (3) Glazing in place and holed from impact forces
 (4) Glazing out-of-place (cracked or not) and not holed from impact forces
 (5) Glazing out-of-place and holed from impact forces
 (6) Glazing disintegrated from impact forces
 (7) Glazing removed prior to accident
 (9) Unknown if damaged

Glazing Damage from Occupant Contact

39. WS 1 40. LF 1 41. RF 1 42. LR 1 43. RR 1
 44. BL 1 45. Roof 0 46. Other 1

(0) No glazing
 (1) No occupant contact to glazing
 (2) Glazing contacted by occupant but no glazing damage
 (3) Glazing in place and cracked by occupant contact
 (4) Glazing in place and holed by occupant contact
 (5) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
 (6) Glazing out-of-place by occupant contact and holed by occupant contact
 (7) Glazing removed prior to accident
 (8) Glazing disintegrated by occupant contact
 (9) Unknown if contacted by occupant

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. _____	48. _____	49. _____	50. _____
2nd	51. _____	52. _____	53. _____	54. _____
3rd	55. _____	56. _____	57. _____	58. _____
4th	59. _____	60. _____	61. _____	62. _____
5th	63. _____	64. _____	65. _____	66. _____
6th	67. _____	68. _____	69. _____	70. _____
7th	71. _____	72. _____	73. _____	74. _____
8th	75. _____	76. _____	77. _____	78. _____
9th	79. _____	80. _____	81. _____	82. _____
10th	83. _____	84. _____	85. _____	86. _____

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Side panel - forward of the A1/A2-pillar
- (11) Door panel (side)
- (12) Side panel - rear of the B-pillar
- (13) Roof (or convertible top)
- (14) Roof side rail
- (15) Windshield
- (16) Windshield header
- (17) Window frame
- (18) Floor pan (includes sill)
- (19) Backlight header
- (20) Front seat back
- (21) Second seat back
- (22) Third seat back
- (23) Fourth seat back
- (24) Fifth seat back
- (25) Seat cushion
- (26) Back door/panel (e.g., tailgate)
- (27) Other interior component (specify): _____

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify): _____
- (32) Other exterior object in the environment (specify): _____
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify): _____
- (99) Unknown

LOCATION OF INTRUSION

- | | |
|--|---|
| <p>Front Seat</p> <ul style="list-style-type: none"> (11) Left (12) Middle (13) Right <p>Second Seat</p> <ul style="list-style-type: none"> (21) Left (22) Middle (23) Right <p>Third Seat</p> <ul style="list-style-type: none"> (31) Left (32) Middle (33) Right | <p>Fourth Seat</p> <ul style="list-style-type: none"> (41) Left (42) Middle (43) Right <p>(97) Catastrophic</p> <p>(98) Other enclosed area (specify) _____</p> <p>(99) Unknown</p> |
|--|---|

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)




COMPARISON VALUE	—	DAMAGE VALUE	=	DEFORMATION
------------------	---	--------------	---	-------------

	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--


	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--

STEERING COLUMN	INSTRUMENT PANEL
<p>87. Steering Column Type <u>2</u></p> <p>(1) Fixed column (2) Tilt column (3) Telescoping column (4) Tilt and telescoping column (8) Other column type (specify): _____ (9) Unknown</p> <p>88. Tilt Steering Column Adjustment <u>3</u></p> <p>(0) No tilt steering column (1) Full up (2) Between full up and center (3) Center (4) Between center and full down (5) Full down (9) Unknown</p> <p>89. Telescoping Steering Column Adjustment <u>0</u></p> <p>(0) No telescoping steering column (1) Full back (2) Between full back and midpoint (3) Midpoint (4) Between midpoint and full forward (5) Full forward (9) Unknown</p> <p>90. Steering Rim/Spoke Deformation <u>00</u></p> <p>Code actual measured deformation to the nearest centimeter (00) No steering rim deformation (01-14) Actual measured value in centimeters (15) 15 centimeters or more (98) Observed deformation cannot be measured (99) Unknown</p> <p>91. Location of Steering Rim/Spoke Deformation <u>00</u></p> <p>(00) No steering rim deformation</p> <p><i>Quarter Sections</i></p> <p>(01) Section A (02) Section B (03) Section C (04) Section D</p> <div style="display: flex; align-items: center; gap: 20px;">   </div> <p><i>Half Sections</i></p> <p>(05) Upper half of rim/spoke (06) Lower half of rim/spoke (07) Left half of rim/spoke (08) Right half of rim/spoke</p> <div style="display: flex; align-items: center; gap: 20px;">  </div> <p>(09) Complete steering wheel collapse (10) Undetermined location (99) Unknown</p>	<p>92. Odometer Reading <u>083,000</u></p> <p>_____ kilometers Code to the nearest 1,000 kilometers (000) No odometer (001) Less than 1,500 kilometers (500) 499,500 kilometers or more (999) Unknown <u>51.626</u> miles X 1.6093 = <u>83.082</u> kilometers</p> <p>Source: <u>Vehicle</u></p> <p>93. Instrument Panel Damage from Occupant Contact? <u>0</u></p> <p>(0) No (1) Yes (9) Unknown</p> <p>94. Type of Knee Bolster Covering <u>0</u></p> <p>(0) No knee bolster (1) Padded (2) Rigid plastic (8) Other (specify): _____ (9) Unknown</p> <p>95. Knee Bolsters Deformed from Occupant Contact? <u>0</u></p> <p>(0) No knee bolster (1) No deformation (2) Yes - deformation (9) Unknown</p> <p>96. Did Glove Compartment Door Open During Collision(s)? <u>1</u></p> <p>(0) No glove compartment door (1) No - door did not open (2) Yes - door opened (9) Unknown</p> <p>97. Adaptive (Assistive) Driving Equipment <u>0</u></p> <p>(0) No adaptive driving equipment (1) Adaptive driving equipment installed (Check all that apply.)</p> <p>[] Hand controls for braking/acceleration [] Steering control devices (attached to OEM steering wheel) [] Steering knob attached to steering wheel [] Low effort power steering (unit or device) [] Replacement steering wheel (i.e., reduced diameter) [] Joy-stick steering controls [] Wheelchair tie-downs [] Modification to seat belts (specify): _____</p> <p>[] Additional or relocated switches (specify): _____</p> <p>[] Raised roof [] Wall-mounted head rest (used behind wheelchair) [] Other adaptive device (specify): _____</p> <p>(9) Unknown</p>

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

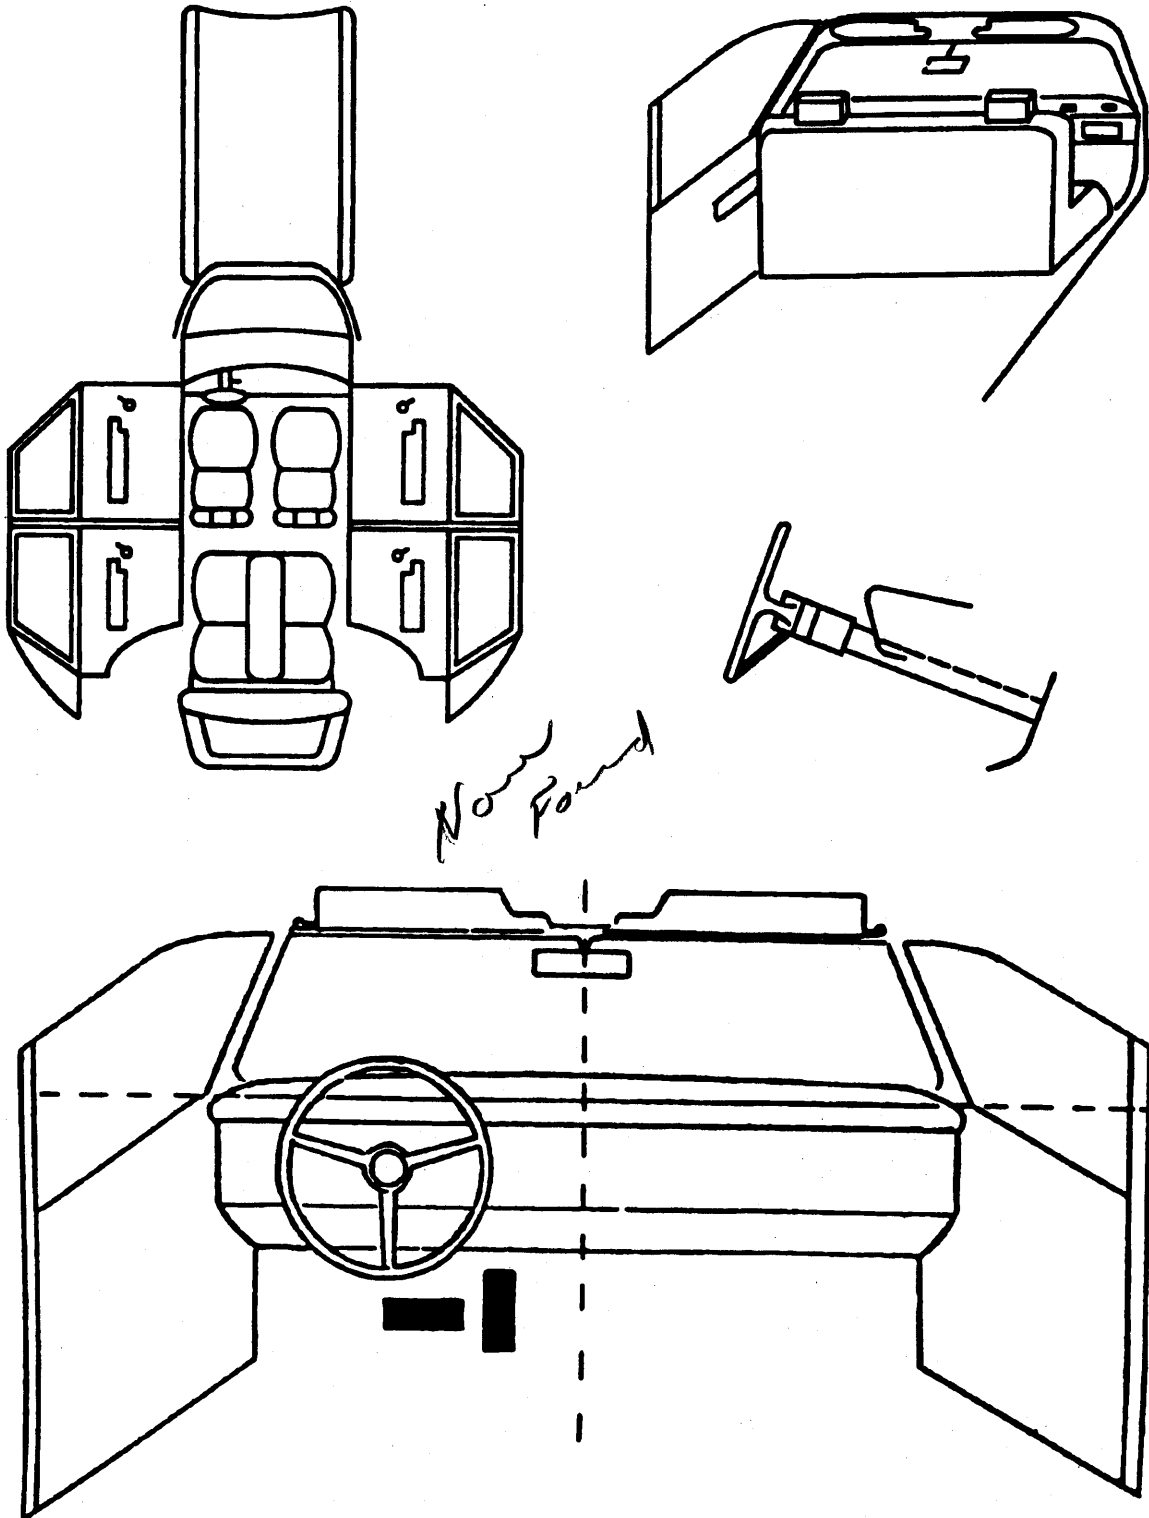

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).
Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.
Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A					
B					
C					
D					
E					
F					
G					
H					
I					
J					
K					
L					
M					
N					

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object, (specify): _____
- (019) Other front object (specify): _____

CODES FOR INTERIOR COMPONENTS

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests
- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (175) Air bag compartment cover-driver side
- (180) Air bag-passenger side
- (185) Air bag compartment cover-passenger side
- (190) Other air bag (specify): _____
- (195) Other air bag compartment cover (specify): _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof
- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form. If a Child safety seat is present, encode the data on the back of this page. If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous page.

		Left	Center	Right
FIRST	Availability	3	 	3
	Evidence of usage	03		03
	Used in this crash?	1		0
	Proper Use	1		0
	Failure Modes	1		0
	Anchorage Adjustment	1		1
SECOND	Availability	4	3	4
	Evidence of usage	04	03	04
	Used in this crash?	0	0	0
	Proper Use	0	0	0
	Failure Modes	0	0	0
	Anchorage Adjustment	1	0	1
OTHER	Availability			
	Evidence of usage	 	 	
	Used in this crash?			
	Proper Use			
	Failure Modes			
	Anchorage Adjustment			

Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

- (9) Unknown

Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of manual belt system (specify): _____
- (9) Unknown

Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other manual belt failure (specify): _____
- (9) Unknown

Shoulder Belt Upper Anchorage Adjustment

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Left Front	Right Front	Other
FIRST	Availability/Function	 	 	
	Deployment	 	 	
	Failure	 	 	

<p>Air Bag System Availability/Function</p> <p>(0) Not equipped/not available (1) Air bag</p> <p><i>Non-functional</i></p> <p>(2) Air bag disconnected (specify): _____</p> <p>(3) Air bag not reinstalled</p> <p>(9) Unknown</p> <p>Are There Indications of Air Bag System Failure? (This Occupant Position)</p> <p>(0) Not equipped/not available (1) No (2) Yes (specify): _____</p> <p>(9) Unknown</p>	<p>Frontal Air Bag System Deployment (This Occupant Position)</p> <p>(0) Not equipped/not available (1) Deployed during accident (as a result of impact) (2) Deployed inadvertently just prior to accident (3) Deployed, accident sequence undetermined (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (5) Unknown if deployed (7) Nondeployed (9) Unknown</p>	<p>Air Bag(s) Deployment, <u>Other</u> Than First Seat Frontal (This Occupant Position)</p> <p>(0) Not equipped with an "other" air bag (1) Deployed during accident (as a result of impact) (2) Deployed inadvertently just prior to accident (3) Deployed, details unknown (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (5) Unknown if deployed (7) Nondeployed (9) Unknown</p>
---	--	---


AUTOMATIC BELTS

		Left	Right
FIRST	Availability/Function	1	1
	Use	1	
	Type	2	2
	Proper Use	1	
	Failure Modes	1	


<p>Automatic (Passive) Belt System Availability/Function</p> <p>(0) Not equipped/not available (1) 2 point automatic belts (2) 3 point automatic belts (3) Automatic belts - type unknown</p> <p><i>Non-functional</i></p> <p>(4) Automatic belts destroyed or rendered inoperative (9) Unknown</p> <p>Automatic (Passive) Belt System Use</p> <p>(0) Not equipped/not available/destroyed or rendered inoperative (1) Automatic belt in use (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (3) Automatic belt use unknown (9) Unknown</p> <p>Automatic (Passive) Belt System Type</p> <p>(0) Not equipped/not available (1) Non-motorized system (2) Motorized system (9) Unknown</p>	<p>Proper Use of Automatic (Passive) Belt System</p> <p>(0) Not equipped/not available/not used (1) Automatic belt used properly (2) Automatic belt used properly with child safety seat</p> <p><i>Automatic Belt Used Improperly</i></p> <p>(3) Automatic shoulder belt worn under arm (4) Automatic shoulder belt worn behind back (5) Automatic belt worn around more than one person (6) Lap portion of automatic belt worn on abdomen (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____</p> <p>(8) Other improper use of automatic belt system (specify): _____</p> <p>(9) Unknown</p>	<p>Automatic (Passive) Belt Failure Modes During Accident</p> <p>(0) Not equipped/not available/not in use (1) No automatic belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): _____</p> <p>(6) Broken retractor (7) Combination of above (specify): _____</p> <p>(8) Other automatic belt failure (specify): _____</p> <p>(9) Unknown</p>
---	---	---

DRIVER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Front)

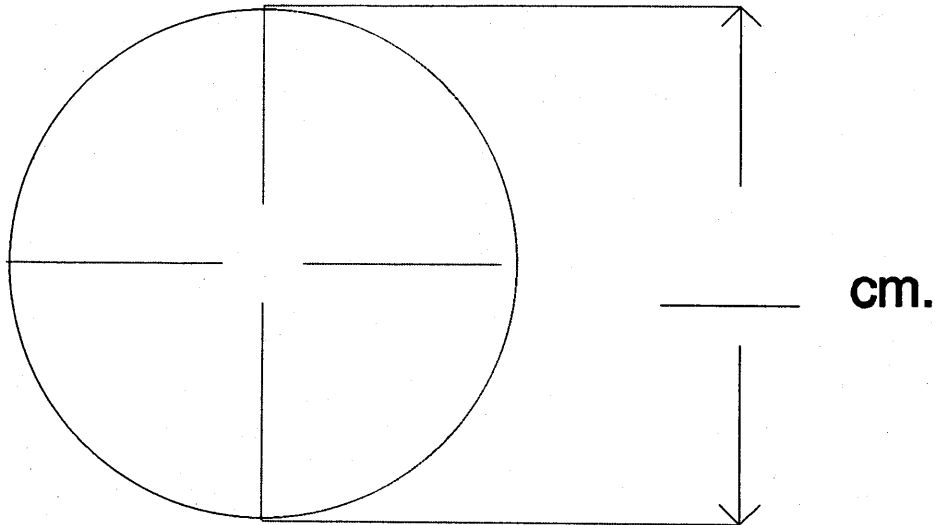


2. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Back)

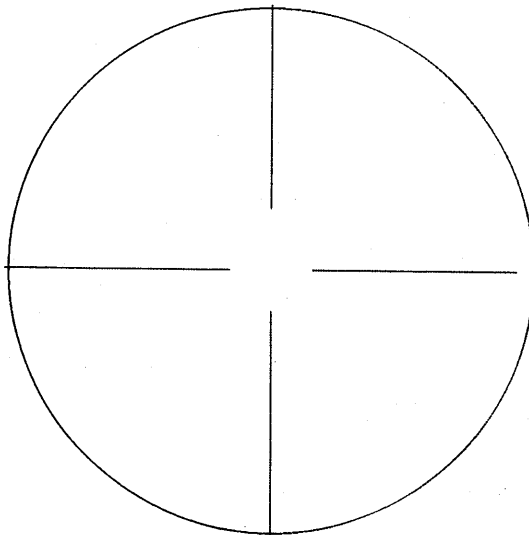

DRIVER AIR BAG SKETCHES (Cont'd)

3. DRIVER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)


- a. Upper Flap b. Lower Flap
- width (W_U) _____ width (W_L) _____
- height (H_U) _____ height (H_L) _____

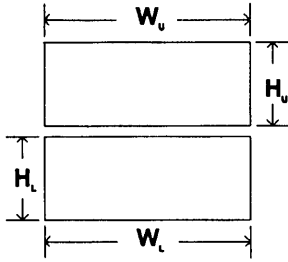

4. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE


5. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

6. SKETCH LOCATION OF CIRCULAR AIR BAG VENT PORTS

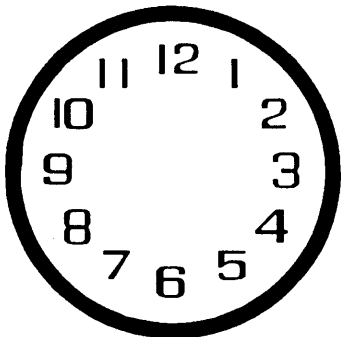


PASSENGER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Front)

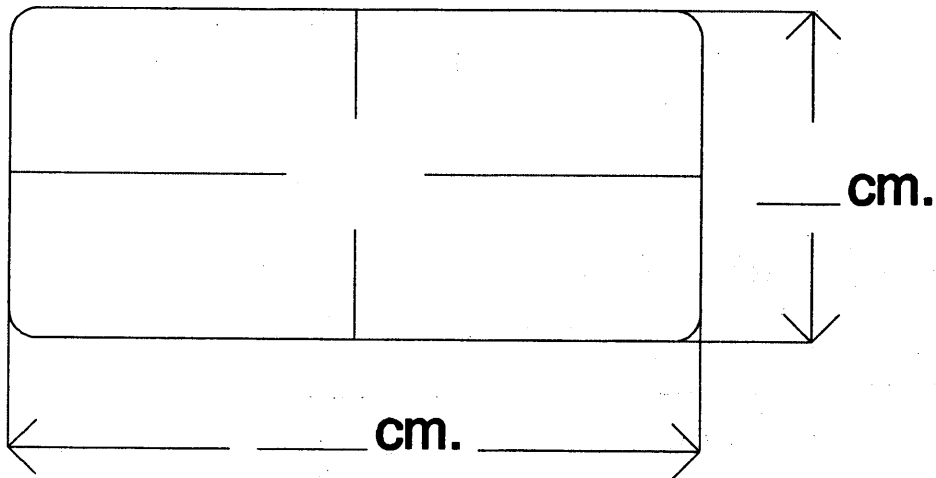

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Back)

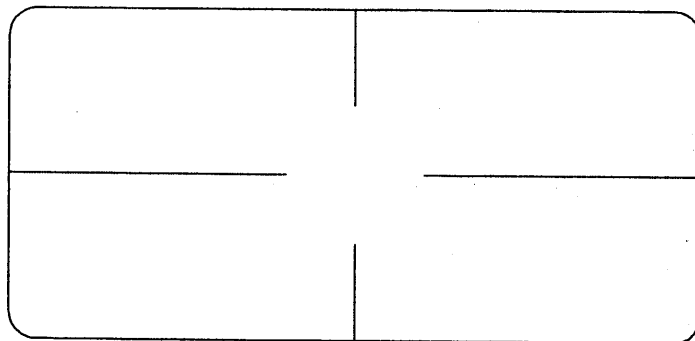


PASSENGER AIR BAG SKETCHES (Cont'd)

3. PASSENGER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

a. Flap

width (W) _____

height (H) _____

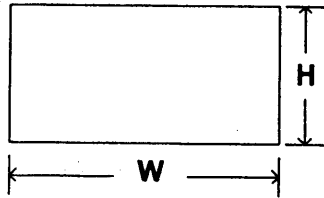

4. PASSENGER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap


b. Lower Flap

width (W_U) _____

width (W_L) _____

height (H_U) _____


height (H_L) _____

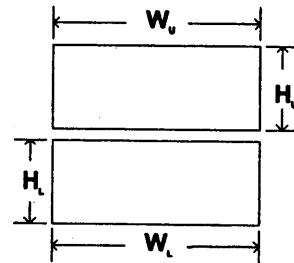

5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE

6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

7. SKETCH LOCATION OF RECTANGULAR AIR BAG VENT PORTS

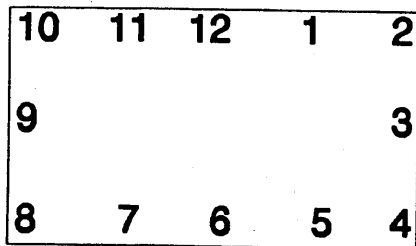

"OTHER" AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Front)

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Back)

"OTHER" AIR BAG SKETCHES (Cont'd)

3. SKETCH AIR BAG MODULE FLAP AND SIZE OR OPENING FOR AIRBAG

4. SKETCH AIR BAG VENT PORTS

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
F I R S T	Head Restraint Type/Damage	3	3	3
	Seat Type	01	01	01
	Seat Performance	1	1	1
	Seat Orientation	1	1	1
	Seat Track Position	2	2	4
	Seat Back Incline Pre/Post Impact	14	14	14
S E C O N D	Head Restraint Type/Damage	0	0	0
	Seat Type	03	03	03
	Seat Performance	1	1	1
	Seat Orientation	1	1	1
	Seat Track Position	1	1	1
	Seat Back Incline Pre/Post Impact	01	01	01
T H I R D	Head Restraint Type/Damage	X	X	X
	Seat Type	X	X	X
	Seat Performance	X	X	X
	Seat Orientation	X	X	X
	Seat Track Position	X	X	X
	Seat Back Incline Pre/Post Impact	X	X	X
O T H E R	Head Restraint Type/Damage	X	X	X
	Seat Type	X	X	X
	Seat Performance	X	X	X
	Seat Orientation	X	X	X
	Seat Track Position	X	X	X
	Seat Back Incline Pre/Post Impact	X	X	X

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

HEAD RESTRAINTS/SEAT EVALUATION

Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral — no damage
- (2) Integral — damaged during accident
- (3) Adjustable — no damage
- (4) Adjustable — damaged during accident
- (5) Add-on — no damage
- (6) Add-on — damaged during accident
- (8) Other
Specify: _____
- (9) Unknown

Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

Seat Track Adjusted Position Prior To Impact

- (0) Occupant not seated or no seat
 - (1) Non-adjustable seat track
- Adjustable Seat Track*
- (2) Seat at forward most track position
 - (3) Seat between forward most and middle track positions
 - (4) Seat at middle track position
 - (5) Seat between middle and rear most track positions
 - (6) Seat at rear most track position
 - (9) Unknown

Seat Back Incline Prior and Post Impact

- (00) Occupant not seated or no seat
- (01) Not adjustable

Upright prior to impact




- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position
- (99) Unknown

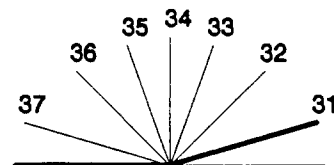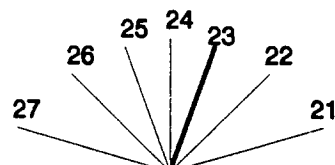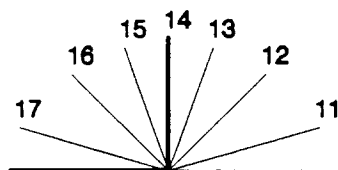

Coding diagrams for *Seat Back Incline Position Prior and Post Impact*

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

MAX

1. Type of Child Safety Seat
 - (0) No child safety seat
 - (1) Infant seat
 - (2) Toddler seat
 - (3) Convertible seat
 - (4) Booster seat
 - (7) Other type child safety seat (specify): _____
 - (8) Unknown child safety seat type
 - (9) Unknown if child safety seat used

2. Child Safety Seat Orientation
 - (00) No child safety seat
 - Designed for Rear Facing for This Age/Weight
 - (01) Rear facing
 - (02) Forward facing
 - (08) Other orientation (specify): _____
 - (09) Unknown orientation
 - Designed for Forward Facing for This Age/Weight
 - (11) Rear facing
 - (12) Forward facing
 - (18) Other orientation (specify): _____
 - (19) Unknown orientation
 - Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
 - (21) Rear facing
 - (22) Forward facing
 - (28) Other orientation (specify): _____
 - (29) Unknown orientation
 - (99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage

4. Child Safety Seat Shield Usage

5. Child Safety Seat Tether Usage
 - Note: Options Below Are Used for Variables 3-5.
 - (00) No child safety seat
 - Not Designed with Harness/Shield/Tether
 - (01) After market harness/shield/tether added, not used
 - (02) After market harness/shield/tether used
 - (03) Child safety seat used, but no after market harness/shield/tether added
 - (09) Unknown if harness/shield/tether added or used
 - Designed With Harness/Shield/Tether
 - (11) Harness/shield/tether not used
 - (12) Harness/shield/tether used
 - (19) Unknown if harness/shield/tether used
 - Unknown If Designed With Harness/Shield/Tether
 - (21) Harness/shield/tether not used
 - (22) Harness/shield/tether used
 - (29) Unknown if harness/shield/tether used
 - (99) Unknown if child safety seat used

6. Child Safety Seat Make/Model
 - (Specify make/model and occupant number)
 - _____
 - _____
 - _____
 - _____

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No [] Yes []

Describe indications of ejection and body parts involved in partial ejection(s):

Occupant Number						
Ejection						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						

Ejection

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

Ejection Area

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

- (8) Other area (e.g., back of pickup, etc.) (specify):

(9) Unknown

Ejection Medium

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

(5) Integral structure

- (8) Other medium (specify):

(9) Unknown

Medium Status (Immediately Prior to Impact)

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

ENTRAPMENT No [] Yes []

Describe entrapment mechanism: _____

Component(s): _____

(Note in vehicle interior diagram)

OCCUPANT ASSESSMENT FORM

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number 13
2. Case Number - Stratum 149A
3. Vehicle Number 03
4. Occupant Number 01

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 41
Code actual age at time of accident.
(00) Less than one year old (specify by month):

(97) 97 years and older
(99) Unknown

6. Occupant's Sex 2
(1) Male
(2) Female-not reported pregnant
(3) Female-pregnant-1st trimester(1st-3rd month)
(4) Female-pregnant-2nd trimester(4th-6th month)
(5) Female-pregnant-3rd trimester(7th-9th month)
(6) Female-pregnant-term unknown
(9) Unknown

7. Occupant's Height 155
Code actual height to the nearest centimeter.
(999) Unknown
61 inches X 2.54 = _____ centimeters

8. Occupant's Weight 049
Code actual weight to the nearest kilogram.
(999)Unknown
108 pounds X .4536 = _____ kilograms

9. Occupant's Role 1
(1) Driver
(2) Passenger
(9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
(11) Left side
(12) Middle
(13) Right side
(14) Other (specify): _____
(15) On or in the lap of another occupant

Second Seat
(21) Left side
(22) Middle
(23) Right side
(24) Other (specify): _____
(25) On or in the lap of another occupant

Third Seat
(31) Left side
(32) Middle
(33) Right side
(34) Other (specify): _____
(35) On or in the lap of another occupant

Fourth Seat
(41) Left side
(42) Middle
(43) Right side
(44) Other (specify): _____
(45) On or in the lap of another occupant

(97) In or on unenclosed area
(98) Other seat (specify): _____
(99) Unknown

11. Occupant's Posture 0
(0) Normal posture

Abnormal posture
(1) Kneeling or standing on seat
(2) Lying on or across seat
(3) Kneeling, standing or sitting in front of seat
(4) Sitting sideways or turned to talk with another occupant or to look out a rear window
(5) Sitting on a console
(6) Lying back in a reclined seat position
(7) Bracing with feet or hands on a surface in front of seat
(8) Other abnormal posture (specify): _____
(9) Unknown

EJECTION/ENTRAPMENT

12. Ejection

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

0

13. Ejection Area

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

0

14. Ejection Medium

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____

0

(5) Integral structure

(8) Other medium (specify): _____

(9) Unknown

15. Medium Status (Immediately Prior To Impact)

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

0

16. Entrapment

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

0

17. Occupant Mobility

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or disoriented
- (2) Removed from vehicle due to injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (9) Unknown

4

BELT SYSTEM FUNCTION

18. Manual (Active) Belt System Availability 3

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

(9) Unknown

19. Manual (Active) Belt System Use 03

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

20. Proper Use of Manual (Active) Belts 1

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown

21. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown

22. Shoulder Belt Upper Anchorage Adjustment 0

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

23. Automatic (Passive) Belt System Availability/Function 1

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

24. Automatic (Passive) Belt System Use 1

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
- (3) Automatic belt use unknown
- (9) Unknown

25. Automatic (Passive) Belt System Type 2

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

26. Proper Use of Automatic (Passive) Belt System 1

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of automatic belt system (specify): _____

(9) Unknown

27. Automatic (Passive) Belt Failure Modes During Accident 1

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor

(7) Combination of above (specify): _____

(8) Other automatic belt failure (specify): _____

(9) Unknown

POLICE REPORTED RESTRAINT USE	AIR BAG SYSTEM FUNCTION
<p>28. Police Reported Belt Use <u>4</u></p> <p>(0) None used</p> <p>(1) Police did not indicate belt use</p> <p>(2) Shoulder belt</p> <p>(3) Lap belt</p> <p>(4) Lap and shoulder belt</p> <p>(5) Belt used, type not specified</p> <p>(6) Child safety seat.</p> <p>(7) Automatic belt</p> <p>(8) Other type belt, (specify): _____</p> <p>(9) Police indicated "unknown" _____</p>	<p>30. Frontal Air Bag System Availability/Function (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available</p> <p>(1) Air bag</p> <p><i>Non-functional</i></p> <p>(2) Air bag disconnected (specify): _____</p> <p>(3) Air bag not reinstalled</p> <p>(9) Unknown</p>
<p>29. Police Reported Air Bag Availability/Function <u>0</u></p> <p>(0) No air bag available</p> <p>(1) Police did not indicate air bag availability/function</p> <p>(2) Deployed</p> <p>(3) Not deployed</p> <p>(4) Unknown if deployed</p> <p>(9) Police indicated "unknown"</p>	<p>31. Frontal Air Bag System Deployment (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available</p> <p>(1) Deployed during accident (as a result of impact)</p> <p>(2) Deployed inadvertently just prior to accident</p> <p>(3) Deployed, details unknown</p> <p>(4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)</p> <p>(5) Unknown if deployed</p> <p>(7) Nondeployed</p> <p>(9) Unknown</p>
<p>Check the Primary Source Used In Determining Belt Use.</p> <p><input type="checkbox"/> Not equipped/not available/destroyed or rendered inoperative</p> <p><input type="checkbox"/> Vehicle inspection</p> <p><input type="checkbox"/> Official injury data</p> <p><input checked="" type="checkbox"/> Driver/occupant interview</p> <p><input type="checkbox"/> Other (specify): _____</p> <p><input type="checkbox"/> Unknown if belt used _____</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>	<p>32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available</p> <p>(1) Air bag</p> <p><i>Non-functional</i></p> <p>(2) Air bag disconnected (specify): _____</p> <p>(3) Air bag not reinstalled</p> <p>(9) Unknown</p> <p><i>Specify type of "other" air bag present:</i></p> <p>_____</p>
	<p>33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) <u>0</u></p> <p>(0) Not equipped with an "other" air bag</p> <p>(1) Deployed during accident (as a result of impact)</p> <p>(2) Deployed inadvertently just prior to accident</p> <p>(3) Deployed, details unknown</p> <p>(4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)</p> <p>(5) Unknown if deployed</p> <p>(7) Nondeployed</p> <p>(9) Unknown</p>
	<p>34. Are There Indications of Air Bag System Failure? (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available</p> <p>(1) No</p> <p>(2) Yes (specify): _____</p> <p>(9) Unknown _____</p>

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 0

- (0) Not equipped/not available
- (1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
- (3) One previous accident with deployment
- (4) More than one previous accident with at least one deployment
- (8) Previous accidents, unknown deployment status
- (9) Unknown

36. Type of Air Bag 0

- (0) Not equipped/not available
- (1) Original manufacturer installed system
- (2) Retrofitted air bag
- (3) Replacement air bag
- (8) Unknown type of air bag
- (9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 0

- (0) Not equipped/not available
- (1) No prior maintenance
- (2) Yes, prior maintenance (specify): _____

(9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 00

- (00) Not equipped/not available
- _____ Code the accident event sequence number that initiated the air bag deployment
- (96) Deployed, unknown event
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

39. CDC For Air Bag Deployment Impact 0

- (0) Not equipped/not available
- (1) Highest delta V
- (2) Second highest delta V
- (3) Other non-coded delta V (specify): _____

- (6) Deployed, unknown event
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact + 000

- (_000) Not equipped/not available
- Code the value of the delta V for the impact that initiated the air bag deployment*
- (_996) Deployment, unknown longitudinal Delta V
- (_997) Not deployed
- (_998) Unknown if deployed
- (_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes
- (3) Deployed, unknown if flap(s) opened at designated tear points
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____
- (3) Deployed, unknown if air bag module cover flap(s) damaged
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

43. Was There Damage To The Air Bag? 00

- (00) Not equipped/not available
- (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
- (03) Cut
- (04) Torn
- (05) Holed
- (06) Burned
- (07) Abraded
- (88) Other damage (specify): _____

- (95) Damaged, details unknown
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*
HEAD RESTRAINT AND SEAT EVALUATION

44. Source of Air Bag Damage 00
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (88) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):

 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):

 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 0
 (0) Not equipped/not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

49. Head Restraint Type/Damage by Occupant at This Occupant Position 1
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 01
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):

 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 2
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track
Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown


HEAD RESTRAINT AND SEAT EVALUATION *continued*

53. Seat Back Incline Prior and Post Impact 14

- (00) Occupant not seated or no seat
- (01) Not adjustable


Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

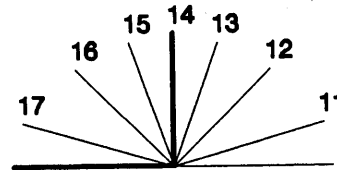


Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

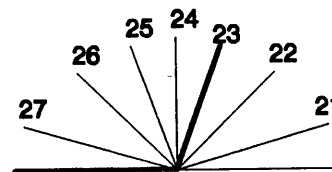

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

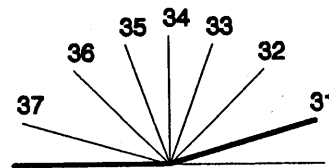

(99) Unknown

54. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion, (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

56. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat - with shield
 (5) Booster seat - without shield
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00
 (00) No child safety seat

Designed for Rear Facing for This Age/Weight
 (01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight
 (11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
 (21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 00

59. Child Safety Seat Shield Usage 00

60. Child Safety Seat Tether Usage 00

Note: Options below applicable to
 Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
 added, not used

(02) After market harness/shield/tether used

(03) Child safety seat used, but no after market
 harness/shield/tether added

(09) Unknown if harness/shield/tether
 added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used

(12) Harness/shield/tether used

(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used

(22) Harness/shield/tether used

(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES61. Injury Severity (Police Rating) 0

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 0

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 00

- (00) Not Hospitalized
_____ Code the number of days (up through 60)
that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 00

- _____ Code the number of days
(up through 60) that the occupant
lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP WORK HERE**VARIABLES 66-74****TO BE CODED BY THE ZONE CENTER**

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES****TRAUMA DATA**66. Time to Death 00

Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)

- (00) Not fatal
(96) Fatal - ruled disease
(99) Unknown

67. 1st Medically Reported Cause of Death 0068. 2nd Medically Reported Cause of Death 0069. 3rd Medically Reported Cause of Death 00
Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death

- (00) Not fatal or no additional causes
(96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown

70. Number of Recorded Injuries for This Occupant 00

Code the actual number of injuries recorded for this occupant.

- (00) No recorded injuries
(97) Injured, details unknown
(99) Unknown if injured

71. Glasgow Coma Scale (GCS) Score (at Medical Facility) 00

- (00) Not injured
(01) Injured - not treated at medical facility
(02) No GCS Score at medical facility
(03-15) Code the actual value of the initial GCS Score recorded at medical facility.
(97) Injured, details unknown
(99) Unknown if injured

72. Was the Occupant Given Blood? 1

- (1) No - blood not given
(2) Yes - blood given
(specify units): _____
(9) Unknown if blood given

73. Arterial Blood Gases (ABG) - HCO₃ 00

- (00) Not injured
(01) Injured, ABGs not measured or reported
(02-50) Code the actual value of the HCO₃
(96) ABGs reported, HCO₃ unknown
(97) Injured, details unknown
(99) Unknown if injured

BELT USE DETERMINATION74. Primary Source of Belt Use Determination 1

- (0) Not equipped/not available/destroyed or rendered inoperative
(1) Vehicle inspection
(2) Official injury data
(3) Driver/occupant interview
(8) Other (specify): _____
(9) Unknown if belt used

PSU NUMBER	<u>13</u>
CASE NUMBER	<u>149A</u>
VEHICLE NUMBER	<u>03</u>
OCCUPANT NUMBER	<u>01</u>

OCCUPANT INJURY FORM

THE FOLLOWING DATA IS NOT INCLUDED IN THIS CASE:

ENTIRE FORM

PAGE NUMBER (S) _____



U.S. Department of Transportation
National Highway Traffic Safety
Administration

CRASHPC PROGRAM SUMMARY

(All Measurements In Metric)

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

Identifying Title
13 Primary Sampling Unit
149A Case No.-Stratum
01 Accident Event Sequence No.
[REDACTED] [REDACTED] 95 Date (Month, day, year) of Run

CRASHPC Vehicle Identification

Vehicle 1	<u>1992</u>	<u>Dodge</u>	<u>Coravon SE</u>	<u>1</u>
Vehicle 2	<u>1995</u>	<u>Ford</u>	<u>F-350 Diesel</u>	<u>2</u>
	Year	Make	Model	NASS Veh. No.

GENERAL INFORMATION

VEHICLE 1			VEHICLE 2		
Size	<u>5</u>		Size	<u>6</u>	
Weight	<u>1547 + 120 + 0 = 1667</u> kg		Weight	<u>2132 + 82 + 1397 = 3611</u> kg	
	Curb	Occupant(s)	Cargo	Curb	Occupant(s)
CDC	<u>10 F D A W 9</u>		CDC	<u>01 R D E W 3</u>	
PDOF (-180 to +180)	<u>0 60</u> °		PDOF (-180 to +180)	<u>0 40</u> °	
Stiffness	<u>7</u>		Stiffness	<u>6</u>	

SCENE INFORMATION

Rest and Impact Positions No, Go To Damage Information Yes

VEHICLE 1			VEHICLE 2		
Rest Position	X	_____ m	Rest Position	X	_____ m
	Y	_____ m		Y	_____ m
	PSI	_____ °		PSI	_____ °
Impact Position	X	_____ m	Impact Position	X	_____ m
	Y	_____ m		Y	_____ m
	PSI	_____ °		PSI	_____ °
Slip Angle (-180 to +180)	_____ °		Slip Angle (-180 to +180)	_____ °	

VEHICLE MOTION

Sustained Contact No Yes

VEHICLE 1			VEHICLE 2		
Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes		Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes	
Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes		Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes	
End of Rotation Position	X	_____ m	End of Rotation Position	X	_____ m
	Y	_____ m		Y	_____ m
	PSI	_____ °		PSI	_____ °
Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes		Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes	
Point on Path	X	_____ m	Point on Path	X	_____ m
	Y	_____ m		Y	_____ m
Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW		Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW	
Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes		Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes	

FRICTION INFORMATION

TRAJECTORY INFORMATION

Coefficient of Friction _____
 Rolling Resistance Option _____

Vehicle 1 Rolling Resistance

LF _____ RF _____
 LR _____ RR _____

Vehicle 2 Rolling Resistance

LF _____ RF _____
 LR _____ RR _____

Trajectory Data [] No [] Yes
 If No, Go To Damage Information

Vehicle 1 Steer Angles

LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Vehicle 2 Steer Angles

LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Terrain Boundary [] No [] Yes

First Point

X _____ m Y _____ m

Second Point

X _____ m Y _____ m

Secondary Coefficient of Friction _____

DAMAGE INFORMATION

VEHICLE 1

VEHICLE 2

Damage Length L 173 cm

Damage Length L 390 cm

Crush Depths
 C₁ 49 cm
 C₂ 39 cm
 C₃ 24 cm
 C₄ 37 cm
 C₅ 53 cm
 C₆ 53 cm

Crush Depths
 C₁ 0 cm
 C₂ 0 cm
 C₃ 38 cm
 C₄ 42 cm
 C₅ 15 cm
 C₆ 27 cm

Damage Offset D 0 cm

Damage Offset D 5 cm

IF THIS COMMON IMPACT WAS WITH A MOTOR VEHICLE NOT IN TRANSPORT, FILL IN THE INFORMATION BELOW.

Model Year: _____
 Make: _____
 Model: _____
 VIN: _____

The Weight, CDC, Scene Data and Damage Information for this vehicle should be recorded above.

Complete and ATTACH the appropriate vehicle damage sketch and dimensions to the Form.



CRASHPC PROGRAM SUMMARY

(All Measurements In Metric)

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

Identifying Title <u>13</u> Primary Sampling Unit	<u>149A</u> Case No.-Stratum	<u>01</u> Accident Event Sequence No.	<u>95</u> Date (Month, day, year) of Run
---	---------------------------------	--	---

CRASHPC Vehicle Identification				
Vehicle 1	<u>1992</u>	<u>Dodge</u>	<u>Carovon SE</u>	<u>1</u>
Vehicle 2				
	Year	Make	Model	NASS Veh. No.

GENERAL INFORMATION

VEHICLE 1		VEHICLE 2	
Size	<u>5</u>	Size	<u>11</u>
Weight	<u>1547 + 120 + 0 = 1667</u> kg	Weight	_____ kg
	<small>Curb Occupant(s) Cargo</small>		<small>Curb Occupant(s) Cargo</small>
CDC	<u>10FDAW9</u>	CDC	_____
PDOF (-180 to +180)	<u>0 60</u> °	PDOF (-180 to +180)	_____ °
Stiffness	<u>7</u>	Stiffness	_____

SCENE INFORMATION

Rest and Impact Positions No, Go To Damage Information Yes

VEHICLE 1		VEHICLE 2	
Rest Position	X _____ m Y _____ m PSI _____ °	Rest Position	X _____ m Y _____ m PSI _____ °
Impact Position	X _____ m Y _____ m PSI _____ °	Impact Position	X _____ m Y _____ m PSI _____ °
Slip Angle(-180 to +180)	_____ °	Slip Angle (-180 to +180)	_____ °

VEHICLE MOTION

Sustained Contact No Yes

VEHICLE 1		VEHICLE 2	
Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes	Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes
Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes	Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes
End of Rotation Position	X _____ m Y _____ m PSI _____ °	End of Rotation Position	X _____ m Y _____ m PSI _____ °
Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes	Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes
Point on Path	X _____ m Y _____ m	Point on Path	X _____ m Y _____ m
Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW	Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW
Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes	Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes

FRICITION INFORMATION **TRAJECTORY INFORMATION**

Coefficient of Friction _____
 Rolling Resistance Option _____

Vehicle 1 Rolling Resistance
 LF _____ RF _____
 LR _____ RR _____

Vehicle 2 Rolling Resistance
 LF _____ RF _____
 LR _____ RR _____

Trajectory Data No Yes
If No, Go To Damage Information

Vehicle 1 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Vehicle 2 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Terrain Boundary No Yes

First Point
 X _____ m Y _____ m

Second Point
 X _____ m Y _____ m

Secondary Coefficient of Friction _____

DAMAGE INFORMATION

VEHICLE 1	VEHICLE 2
Damage Length L <u>173</u> cm	Damage Length L _____ cm
Crush Depths C ₁ <u>47</u> cm C ₂ <u>39</u> cm C ₃ <u>27</u> cm C ₄ <u>37</u> cm C ₅ <u>53</u> cm C ₆ <u>53</u> cm	Crush Depths C ₁ _____ cm C ₂ _____ cm C ₃ _____ cm C ₄ _____ cm C ₅ _____ cm C ₆ _____ cm
Damage Offset D ± <u>0</u> cm	Damage Offset D ± _____ cm

IF THIS COMMON IMPACT WAS WITH A MOTOR VEHICLE NOT IN TRANSPORT, FILL IN THE INFORMATION BELOW.

Model Year: _____
 Make: _____
 Model: _____
 VIN: _____

The Weight, CDC, Scene Data and Damage Information for this vehicle should be recorded above.

Complete and ATTACH the appropriate vehicle damage sketch and dimensions to the Form.



U.S. Department of Transportation
National Highway Traffic Safety
Administration

CRASHPC PROGRAM SUMMARY

(All Measurements In Metric)

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

Identifying Title
13 Primary Sampling Unit
149A Case No.-Stratum
01 Accident Event Sequence No.
95 Date (Month, day, year) of Run

CRASHPC Vehicle Identification

Vehicle 1
 Vehicle 2 1995 Year Ford Make F-350 Diesel Model 2 NASS Veh. No.

GENERAL INFORMATION

VEHICLE 1		VEHICLE 2	
Size	<u>11</u>	Size	<u>6</u>
Weight		Weight	
<u> </u> + <u> </u> + <u> </u> = <u> </u> kg		<u>2132</u> + <u>82</u> + <u>1397</u> = <u>3611</u> kg	
Curb Occupant(s) Cargo		Curb Occupant(s) Cargo	
CDC		CDC	<u>ALRDFW3</u>
PDOF (-180 to +180) <u> </u> °		PDOF (-180 to +180) <u>40</u> °	
Stiffness		Stiffness	<u>6</u>

SCENE INFORMATION

Rest and Impact Positions No, Go To Damage Information Yes

VEHICLE 1		VEHICLE 2	
Rest Position	X <u> </u> m Y <u> </u> m PSI <u> </u> °	Rest Position	X <u> </u> m Y <u> </u> m PSI <u> </u> °
Impact Position	X <u> </u> m Y <u> </u> m PSI <u> </u> °	Impact Position	X <u> </u> m Y <u> </u> m PSI <u> </u> °
Slip Angle(-180 to +180) <u> </u> °		Slip Angle (-180 to +180) <u> </u> °	

VEHICLE MOTION

Sustained Contact No Yes

VEHICLE 1		VEHICLE 2	
Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes	Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes
Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes	Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes
End of Rotation Position	X <u> </u> m Y <u> </u> m PSI <u> </u> °	End of Rotation Position	X <u> </u> m Y <u> </u> m PSI <u> </u> °
Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes	Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes
Point on Path	X <u> </u> m Y <u> </u> m	Point on Path	X <u> </u> m Y <u> </u> m
Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW	Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW
Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes	Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes

FRICITION INFORMATION

Coefficient of Friction _____
 Rolling Resistance Option _____

Vehicle 1 Rolling Resistance
 LF ____ . ____ RF ____ . ____
 LR ____ . ____ RR ____ . ____

Vehicle 2 Rolling Resistance
 LF ____ . ____ RF ____ . ____
 LR ____ . ____ RR ____ . ____

TRAJECTORY INFORMATION

Trajectory Data No Yes
 If No, Go To Damage Information

Vehicle 1 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Vehicle 2 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Terrain Boundary No Yes

First Point
 X _____ . ____ m Y _____ . ____ m

Second Point
 X _____ . ____ m Y _____ . ____ m

Secondary Coefficient of Friction _____

DAMAGE INFORMATION

VEHICLE 1
 Damage Length L _____ cm
 Crush Depths C₁ _____ cm
 C₂ _____ cm
 C₃ _____ cm
 C₄ _____ cm
 C₅ _____ cm
 C₆ _____ cm
 Damage Offset D ⁺ _____ cm

VEHICLE 2
 Damage Length L 390 cm
 Crush Depths C₁ 0 cm
 C₂ 0 cm
 C₃ 38 cm
 C₄ 42 cm
 C₅ 15 cm
 C₆ 27 cm
 Damage Offset D ⁺ 5 cm

IF THIS COMMON IMPACT WAS WITH A MOTOR VEHICLE NOT IN TRANSPORT, FILL IN THE INFORMATION BELOW.

Model Year: _____
 Make: _____
 Model: _____
 VIN: _____

The Weight, CDC, Scene Data and Damage Information for this vehicle should be recorded above.

Complete and ATTACH the appropriate vehicle damage sketch and dimensions to the Form.


13 - 149A

100'clock

$$V-1 \quad 1667 \times 50 = 83350 \div 20000 = 4.2$$

$$V-2 \quad 3611 \times 50 = 180550 \div 20000 = 9.0$$

100'clock

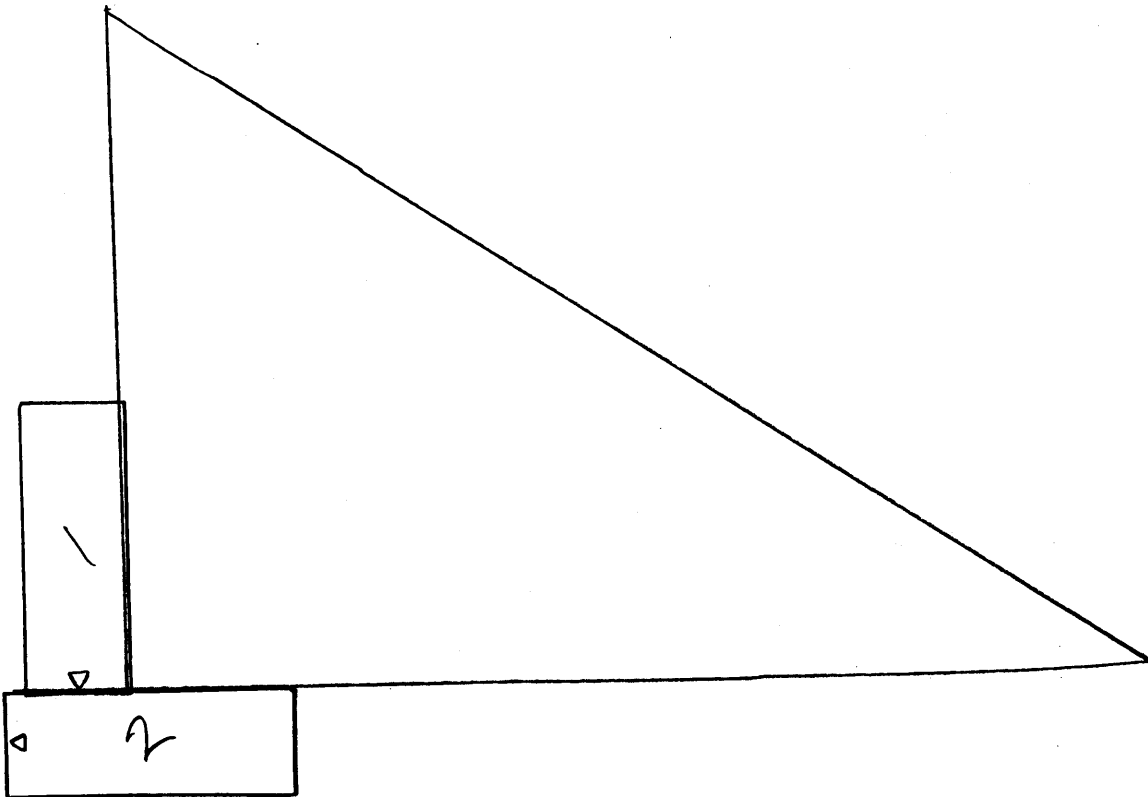

INPUT

CALCULATE

TRAJECTORY

OUTPUT

GRAPHICS

EXIT

TITLE

CRASH3 RECONSTRUCTION

GENERAL INFORMATION

VEHICLE #1	
SIZE	5
WEIGHT	1667.
CDC	10FDAW9
PDOF	-60.00
STIFFNESS	7
CANCEL	ACCEPT

VEHICLE #2	
SIZE	6
WEIGHT	3611.
CDC	01RDEW3
PDOF	40.00
STIFFNESS	6
CANCEL	ACCEPT

METRIC INPUT

INPUT

CALCULATE

TRAJECTORY

OUTPUT

GRAPHICS

EXIT

DAMAGE INFORMATION

VEHICLE #1	
DAMAGE LENGTH	173.0
CRUSH DEPTHS	
C1	49.00
C2	39.00
C3	24.00
C4	37.00
C5	53.00
C6	53.00
DAMAGE OFFSET	.000
CANCEL	ACCEPT

VEHICLE #2	
DAMAGE LENGTH	390.0
CRUSH DEPTHS	
C1	.000
C2	.000
C3	38.00
C4	42.00
C5	15.00
C6	27.00
DAMAGE OFFSET	5.000
CANCEL	ACCEPT

SUMMARY OF CRASHPC RESULTS USING DAMAGE

CRASH3 RECONSTRUCTION

SPEED CHANGE
(DAMAGE)

VEHICLE #1

TOTAL	50 KPH (31 MPH)
LONGITUDINAL	-25 KPH (-16 MPH)
LATITUDINAL	44 KPH (27 MPH)
PDOF ANGLE	-60 DEGREES
ENERGY DISSIPATED =	366824 JOULES (270519 FT-LB)

VEHICLE #2

TOTAL	23 KPH (14 MPH)
LONGITUDINAL	-18 KPH (-11 MPH)
LATITUDINAL	-15 KPH (-9 MPH)
PDOF ANGLE	40 DEGREES
ENERGY DISSIPATED =	150157 JOULES (110735 FT-LB)

PRESS ANY KEY TO CONTINUE

DAMAGE DATA

	VEHICLE #1	VEHICLE #2
SIZE CATEGORY	5	6
STIFFNESS CATEGORY	7	6
VEHICLE WEIGHT	1667 KGS (3675 LBS)	3611 KGS (7961 LBS)
CDC	10FDAW9	01RDEW3
PDOF ANGLE	-60 DEGREES	40 DEGREES
CRUSH LENGTH	173 CM. (68 IN.)	390 CM. (154 IN.)
C1	49 CM. (19 IN.)	0 CM. (0 IN.)
C2	39 CM. (15 IN.)	0 CM. (0 IN.)
C3	24 CM. (9 IN.)	38 CM. (15 IN.)
C4	37 CM. (15 IN.)	42 CM. (17 IN.)
C5	53 CM. (21 IN.)	15 CM. (6 IN.)
C6	53 CM. (21 IN.)	27 CM. (11 IN.)
D	0 CM. (0 IN.)	5 CM. (2 IN.)
D'	5 CM. (2 IN.)	44 CM. (17 IN.)

(* INDICATES DEFAULT VALUE)
PRESS ANY KEY TO CONTINUE


INPUT	CALCULATE	TRAJECTORY	OUTPUT	GRAPHICS	EXIT
-------	-----------	------------	--------	----------	------

DIMENSIONS AND INERTIAL PROPERTIES

	VEHICLE #1	VEHICLE #2
CG TO FRONT AXLE	142 CM. (56 IN.)	153 CM. (60 IN.)
CG TO REAR AXLE	160 CM. (63 IN.)	165 CM. (65 IN.)
TRACK	162 CM. (64 IN.)	162 CM. (64 IN.)
CG TO FRONT OF VEH	259 CM. (102 IN.)	265 CM. (104 IN.)
CG TO REAR OF VEH	-310 CM. (-122 IN.)	-318 CM. (-125 IN.)
CG TO SIDE OF VEH	101 CM. (40 IN.)	101 CM. (40 IN.)
MOMENT OF INERTIA	17511 KGS (38604 LBS)	39706 KGS (87535 LBS)
VEHICLE MASS	4 KGS (10 LBS)	9 KGS (21 LBS)

Printing Picture:

CRASH

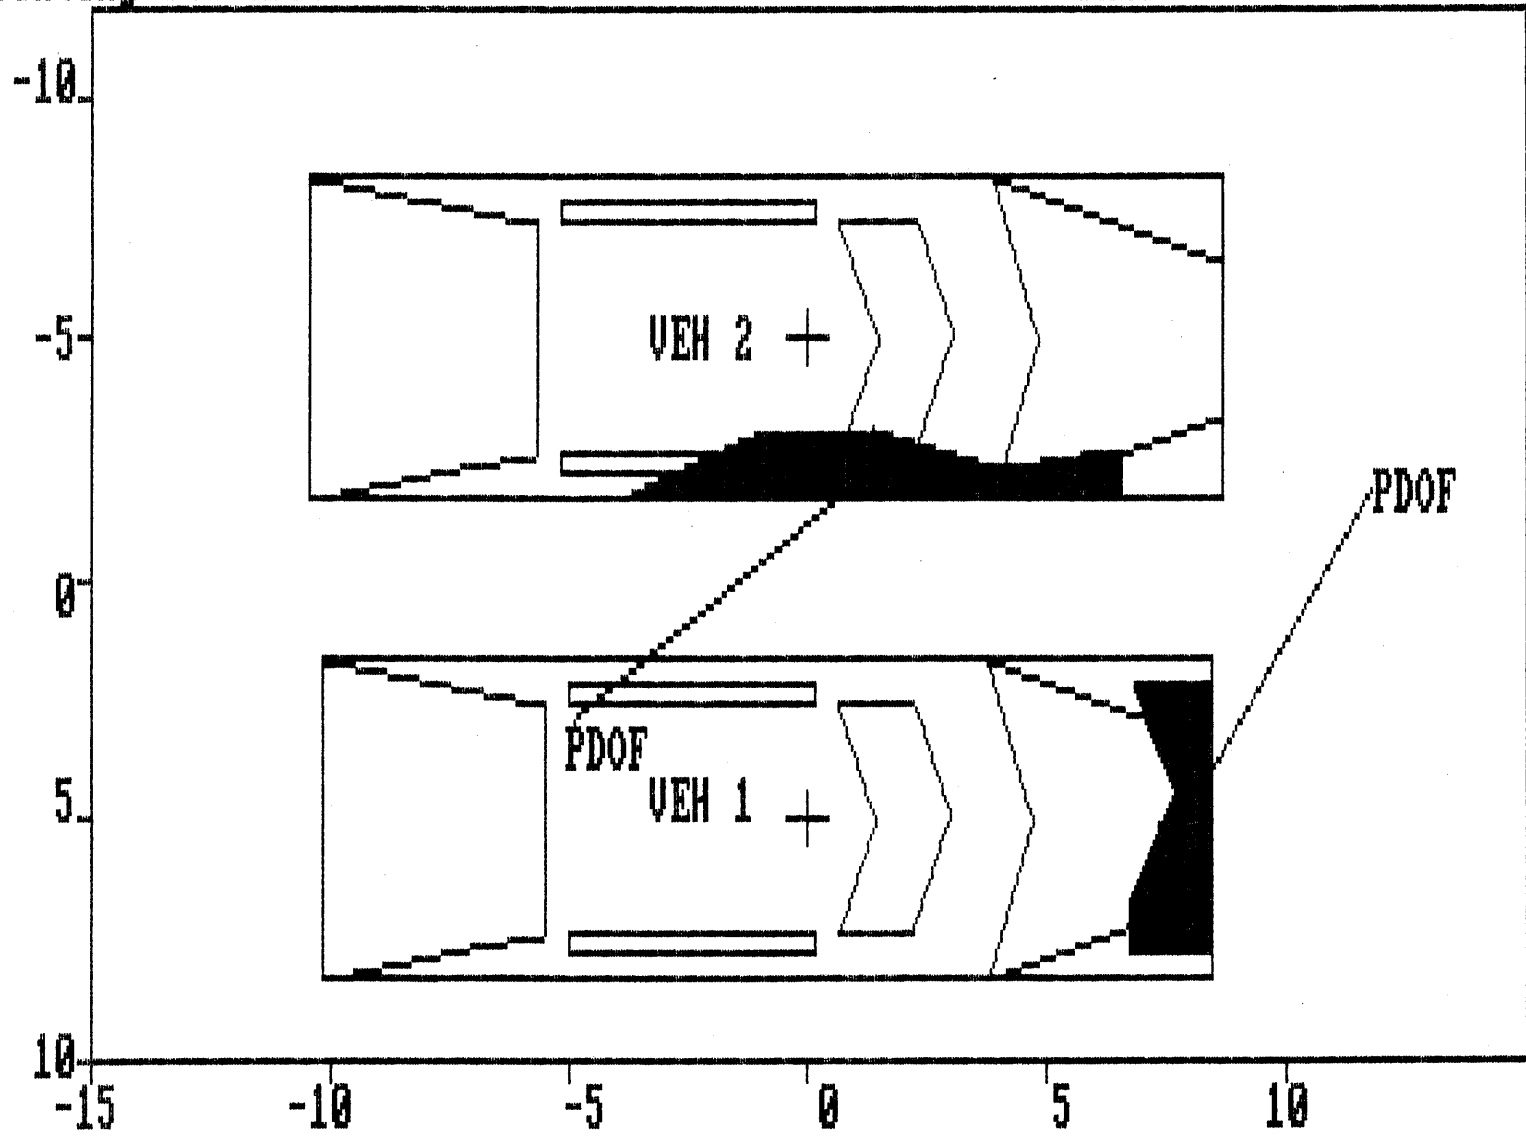


DAMAGE DESCRIPTION

PRESS ANY KEY TO CONTINUE

Printing Picture:

CRASH

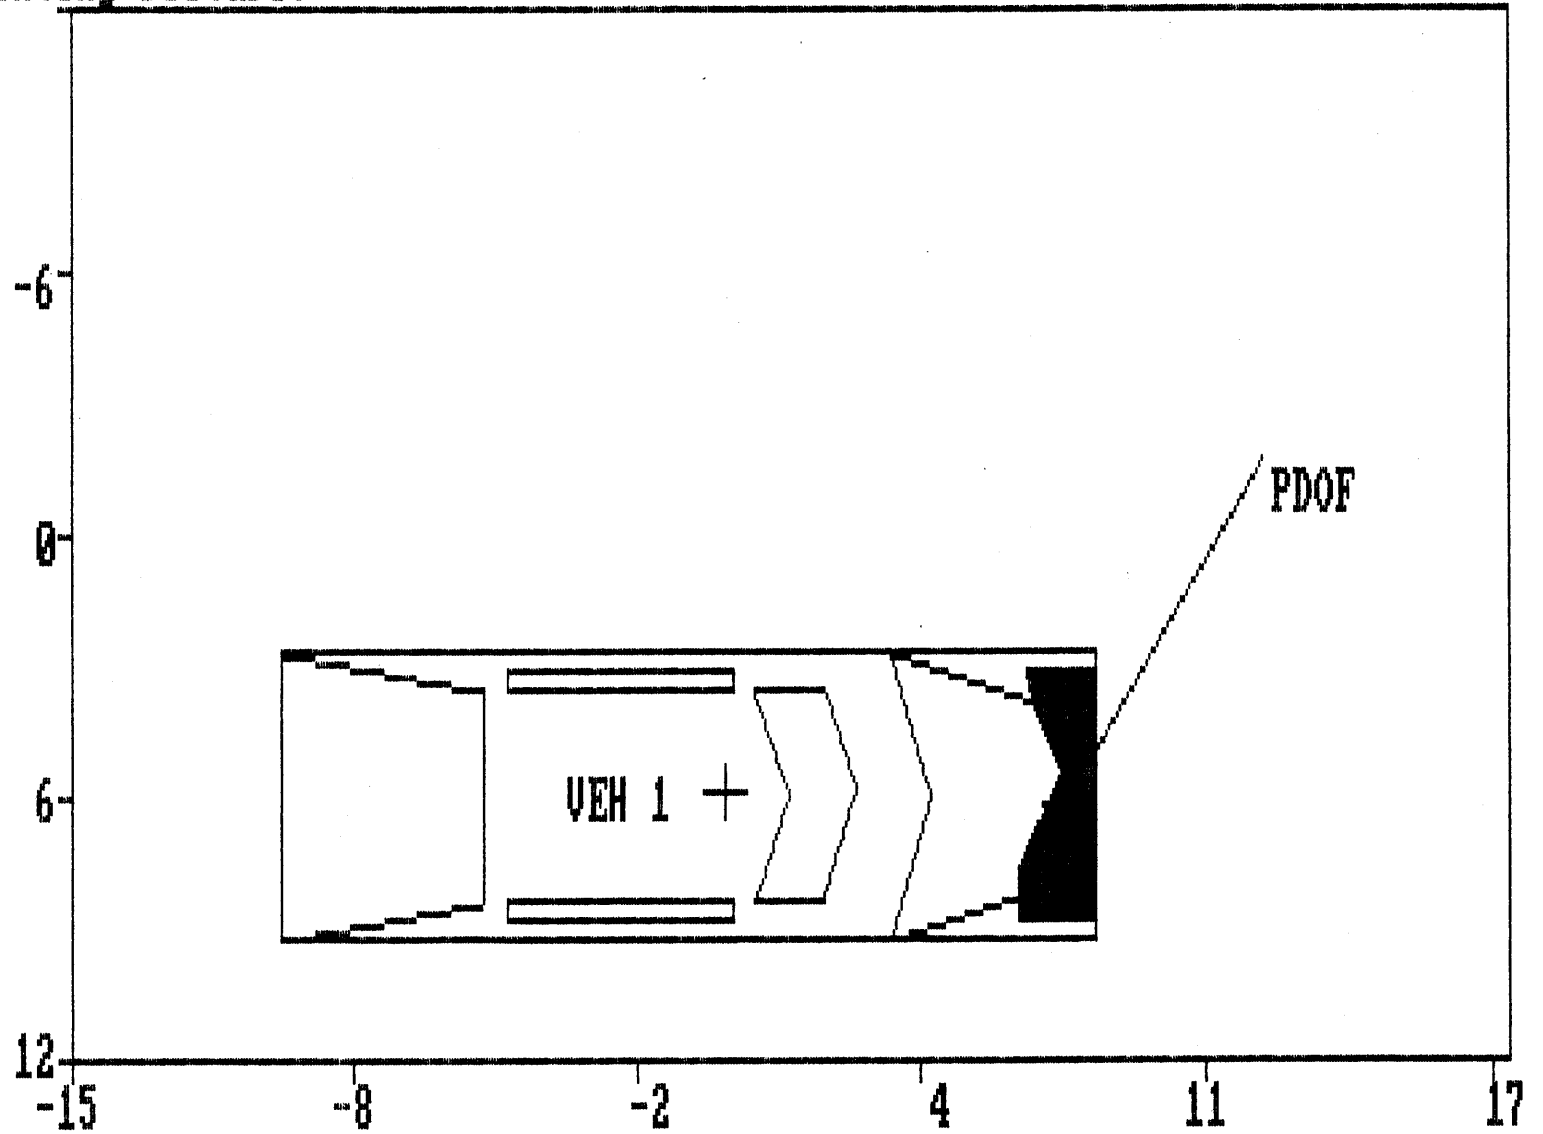

DAMAGE DESCRIPTION

INPUT CALCULATE TRAJECTORY OUTPUT GRAPHICS EXIT

TITLE

CRASH3 RECONSTRUCTION

GENERAL INFORMATION

VEHICLE #1	
SIZE	11
WEIGHT	1000000.
CDC	
PDOF	
STIFFNESS	
CANCEL	ACCEPT

VEHICLE #2	
SIZE	6
WEIGHT	3611.
CDC	01RDEW3
PDOF	40.00
STIFFNESS	6
CANCEL	ACCEPT

METRIC INPUT

INPUT CALCULATE TRAJECTORY OUTPUT GRAPHICS EXIT

DAMAGE INFORMATION

VEHICLE #2	
DAMAGE LENGTH	390.0
CRUSH DEPTHS	
C1	.000
C2	.000
C3	38.00
C4	42.00
C5	15.00
C6	27.00
DAMAGE OFFSET	5.000
CANCEL	ACCEPT

METRIC INPUT

INPUT CALCULATE TRAJECTORY OUTPUT GRAPHICS EXIT

SUMMARY OF CRASHPC RESULTS USING DAMAGE

CRASH3 RECONSTRUCTION

SPEED CHANGE
(DAMAGE)

VEHICLE #1

TOTAL 0 KPH (0 MPH)
LONGITUDINAL 0 KPH (0 MPH)
LATITUDINAL 0 KPH (0 MPH)
PDOF ANGLE 0 DEGREES
ENERGY DISSIPATED = 0 JOULES (0 FT-LB)

VEHICLE #2

TOTAL 32 KPH (20 MPH)
LONGITUDINAL -24 KPH (-15 MPH)
LATITUDINAL -21 KPH (-13 MPH)
PDOF ANGLE 40 DEGREES
ENERGY DISSIPATED = 150157 JOULES (110735 FT-LB)

PRESS ANY KEY TO CONTINUE

|| INPUT CALCULATE TRAJECTORY OUTPUT GRAPHICS EXIT ||

INPUT

CALCULATE

TRAJECTORY

OUTPUT

GRAPHICS

EXIT

TITLE

CRASH3 RECONSTRUCTION

GENERAL INFORMATION

VEHICLE #1	
SIZE	5
WEIGHT	1667.
CDC	10FDAW9
PDOF	-60.00
STIFFNESS	7
CANCEL	ACCEPT

VEHICLE #2	
SIZE	11
WEIGHT	1000000.
CDC	
PDOF	
STIFFNESS	
CANCEL	ACCEPT

METRIC INPUT

INPUT

CALCULATE

TRAJECTORY

OUTPUT

GRAPHICS

EXIT

DAMAGE INFORMATION

VEHICLE #1	
DAMAGE LENGTH	173.0
CRUSH DEPTHS	
C1	47.00
C2	39.00
C3	24.00
C4	37.00
C5	53.00
C6	53.00
DAMAGE OFFSET	.000
CANCEL	ACCEPT

METRIC INPUT

INPUT

CALCULATE

TRAJECTORY

OUTPUT

GRAPHICS

EXIT

SUMMARY OF CRASHPC RESULTS USING DAMAGE

CRASH3 RECONSTRUCTION

SPEED CHANGE
(DAMAGE)

VEHICLE #1

TOTAL 46 KPH (29 MPH)
LONGITUDINAL -23 KPH (-14 MPH)
LATITUDINAL 40 KPH (25 MPH)
PDOF ANGLE -60 DEGREES
ENERGY DISSIPATED = 363654 JOULES (268181 FT-LB)

VEHICLE #2

TOTAL 0 KPH (0 MPH)
LONGITUDINAL 0 KPH (0 MPH)
LATITUDINAL 0 KPH (0 MPH)
PDOF ANGLE 0 DEGREES
ENERGY DISSIPATED = 0 JOULES (0 FT-LB)

PRESS ANY KEY TO CONTINUE

INPUT CALCULATE TRAJECTORY OUTPUT GRAPHICS EXIT

DAMAGE DATA

	VEHICLE #1	VEHICLE #2
SIZE CATEGORY	5	11
STIFFNESS CATEGORY	7	-0
VEHICLE WEIGHT	1667 KGS (3675 LBS)	***** KGS (2204586 LBS) *
CDC	10FDAW9	BARRIER
PDOF ANGLE	-60 DEGREES	0 DEGREES *
CRUSH LENGTH	173 CM. (68 IN.)	0 CM. (0 IN.) *
C1	47 CM. (19 IN.)	0 CM. (0 IN.) *
C2	39 CM. (15 IN.)	0 CM. (0 IN.) *
C3	24 CM. (9 IN.)	0 CM. (0 IN.) *
C4	37 CM. (15 IN.)	0 CM. (0 IN.) *
C5	53 CM. (21 IN.)	0 CM. (0 IN.) *
C6	53 CM. (21 IN.)	0 CM. (0 IN.) *
D	0 CM. (0 IN.)	0 CM. (0 IN.) *
D'	6 CM. (2 IN.)	44 CM. (17 IN.) *

(* INDICATES DEFAULT VALUE)
PRESS ANY KEY TO CONTINUE

INPUT CALCULATE TRAJECTORY OUTPUT GRAPHICS EXIT

DIMENSIONS AND INERTIAL PROPERTIES

	VEHICLE #1	VEHICLE #2
CG TO FRONT AXLE	142 CM. (56 IN.)	127 CM. (50 IN.)
CG TO REAR AXLE	160 CM. (63 IN.)	127 CM. (50 IN.)
TRACK	162 CM. (64 IN.)	127 CM. (50 IN.)
CG TO FRONT OF VEH	259 CM. (102 IN.)	127 CM. (50 IN.)
CG TO REAR OF VEH	-310 CM. (-122 IN.)	-127 CM. (-50 IN.)
CG TO SIDE OF VEH	101 CM. (40 IN.)	127 CM. (50 IN.)
MOMENT OF INERTIA	17511 KGS (38604 LBS)	***** KGS (***** LBS)
VEHICLE MASS	4 KGS (10 LBS)	2600 KGS (5732 LBS)

PRESS ANY KEY TO CONTINUE

DAMAGE DATA

	VEHICLE #1	VEHICLE #2
SIZE CATEGORY	11	6
STIFFNESS CATEGORY	0	6
VEHICLE WEIGHT	***** KGS (2204586 LBS) *	3611 KGS (7961 LBS)
CDC	BARRIER	01RDEW3
PDOF ANGLE	0 DEGREES *	40 DEGREES
CRUSH LENGTH	0 CM. (0 IN.) *	390 CM. (154 IN.)
C1	0 CM. (0 IN.) *	0 CM. (0 IN.)
C2	0 CM. (0 IN.) *	0 CM. (0 IN.)
C3	0 CM. (0 IN.) *	38 CM. (15 IN.)
C4	0 CM. (0 IN.) *	42 CM. (17 IN.)
C5	0 CM. (0 IN.) *	15 CM. (6 IN.)
C6	0 CM. (0 IN.) *	27 CM. (11 IN.)
D	0 CM. (0 IN.) *	5 CM. (2 IN.)
D'	6 CM. (2 IN.) *	44 CM. (17 IN.)

(* INDICATES DEFAULT VALUE)
PRESS ANY KEY TO CONTINUE

INPUT	CALCULATE	TRAJECTORY	OUTPUT	GRAPHICS	EXIT
-------	-----------	------------	--------	----------	------


DIMENSIONS AND INERTIAL PROPERTIES

	VEHICLE #1	VEHICLE #2
CG TO FRONT AXLE	127 CM. (50 IN.)	153 CM. (60 IN.)
CG TO REAR AXLE	127 CM. (50 IN.)	165 CM. (65 IN.)
TRACK	127 CM. (50 IN.)	162 CM. (64 IN.)
CG TO FRONT OF VEH	127 CM. (50 IN.)	265 CM. (104 IN.)
CG TO REAR OF VEH	-127 CM. (-50 IN.)	-318 CM. (-125 IN.)
CG TO SIDE OF VEH	127 CM. (50 IN.)	101 CM. (40 IN.)
MOMENT OF INERTIA	***** KGS (***** LBS)	39706 KGS (87535 LBS)
VEHICLE MASS	2600 KGS (5732 LBS)	9 KGS (21 LBS)

PRESS ANY KEY TO CONTINUE

Printing Picture:

CRASH

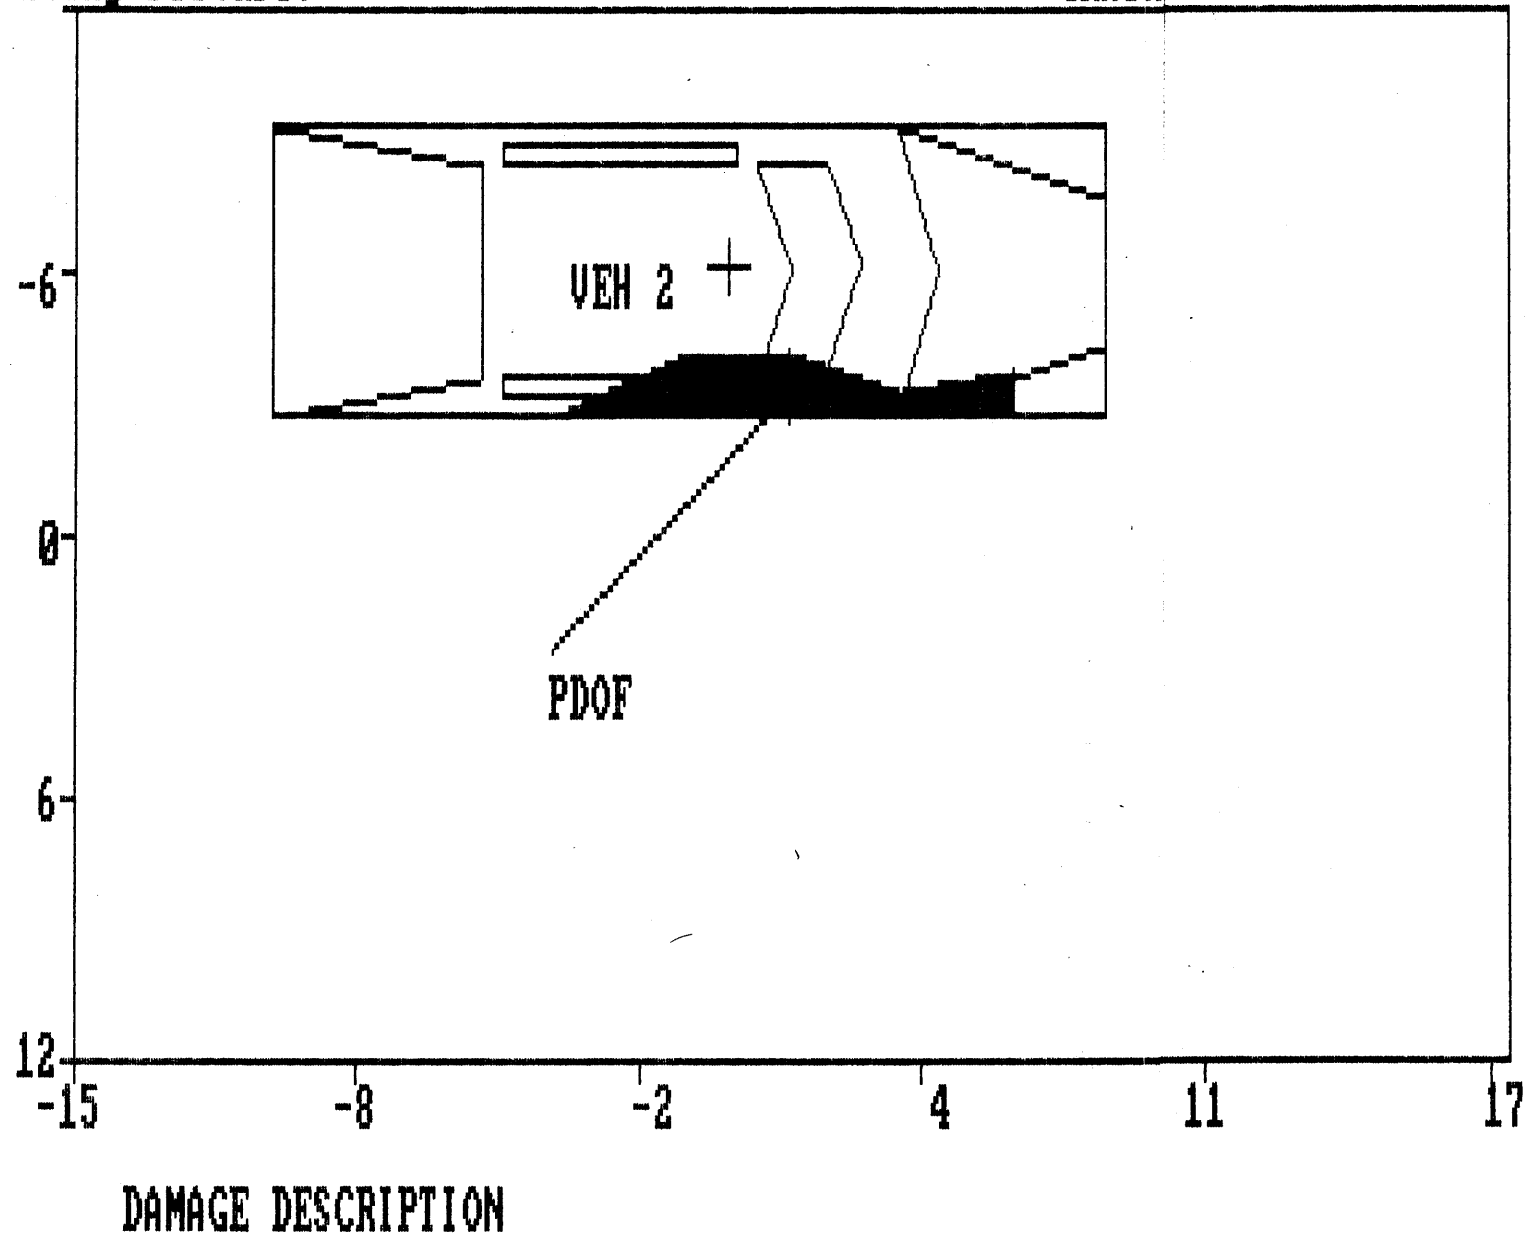

13149A00000011 958.05000000000003170000000040 950 950224960 95067357000
00100000006735705 0306
13149A000100120 958.0510000000000120F0245R
13149A000200120 958.0510000000000120L0245R
13149A000300120 958.0510000000000302F79000
13149A000400120 958.0510000000000245T3100N
13149A01000021 8.05 0000000009207442201B46H44R8N 01999089000714941292
0211211022990117991186
13149A01000022 8.05 00000000010303120155000000000000000008001001050-025+04
43668998404602
13149A01000031 8.05 000000000010210FDAW09020299999999173049039024037053053
000 17314230315201000201040101001000
13149A01000041 8.05 000000000123303300000012222202122221022666610611111101
13149A01000042 8.05 000000000111442110643120133110733111133211232211432
290150999912210
13149A01010051 8.05 0000000003021780611119224200404911000004211001999011-02
521010122211091423100000000000041000620199000014011011
13149A01010161 8.05 0000000001150206485073100
13149A01010261 8.05 0000000001140682395073100
13149A01010361 8.05 0000000001140684395073100
13149A01010461 8.05 0000000001250800295073100
13149A01010561 8.05 0000000001441410430513105
13149A01010661 8.05 0000000001751800220512105
13149A01010761 8.05 0000000001751800210103100
13149A01010861 8.05 0000000001450220220512105
13149A01010961 8.05 0000000001290202186022300
13149A01011061 8.05 0000000001490402120512105
13149A01011161 8.05 0000000001790602120512105
13149A01011261 8.05 0000000001890402120512105
13149A01011361 8.05 0000000001890402110072100
13149A01011461 8.05 0000000001752600220511105
13149A01020051 8.05 0000000000729999992139000002400001000000200000000000 00
000000000001091423100000000000033299970000000017149011
13149A01020161 8.05 0000000002150200380153102
13149A01020261 8.05 0000000003140684390153102
13149A01020361 8.05 0000000003160606200153102
13149A01020461 8.05 0000000002251004240153102
13149A01020561 8.05 0000000002250800220153102
13149A01020661 8.05 0000000003290402170153102
13149A01020761 8.05 0000000003290602120153102
13149A01020861 8.05 0000000002752804320113100
13149A01020961 8.05 0000000002753202220113100
13149A01021061 8.05 0000000003490202100043103
13149A01021161 8.05 0000000003490402100043103
13149A01021261 8.05 0000000003590202170043103
13149A01021361 8.05 0000000003590402170043103
13149A01021461 8.05 0000000002544426470043103
13149A01021561 8.05 0000000002541028570043103
13149A01021661 8.05 0000000002542832570043103
13149A01021761 8.05 0000000002541810210043103
13149A01030051 8.05 0000000001019999992229000002400001000000200000000000 00
0000000000003110110000000000033202970000000005159011
13149A01030161 8.05 0000000002140670321512100
13149A01030261 8.05 0000000002160410201512100
13149A01030361 8.05 0000000002290202121512100
13149A01030461 8.05 0000000003290402171512100
13149A01030561 8.05 0000000003297402121512100
13149A02000021 8.05 0000000009512481401FDKF38F2SE 01999089000704944112
0211211012010166061287
13149A02000022 8.05 000000000101010002131400507401220008000001001023-018-01

INTRA ERRORS

HH1271 2 ***** THIS CASE SHOWS EJECTION WITH RESTRAINT USAGE. *****
 HH1272 ***** CHECK YOUR DATA AND IF CORRECT, NOTIFY YOUR ZONE *****
 HH1273 EJECTION OA12 is equal to 1-3 and ((MANUAL BELT USE OA19 does
 HH1274 not equal 00, 01 or 99) or
 HH1275 (FRONTAL AIR BAG SYSTEM DEPLOYMENT OA31 does not equal 0, 7 or
 HH1276 9) or (AUTOMATIC BELT USE OA24 does not equal 0, 2 or 9)).

GENERAL VEHICLE Vehicle: 2

INTRA ERRORS

GG0421 2 If ROLLOVER GV45 equals 01-17 or 98, then BASIS FOR DELTA V GV58
 GG0422 should equal 04-10.

INTER ERRORS

GE0641 2 If OBJECT CONTACTED EV05(p) is less than 31 and EV05(p) equals
 GE0642 GV03(q) and BODY TYPE GV07(q) equals 22-25 or 40-49, then BASIS
 GE0643 FOR DELTA V GV58(p) should equal 04. GV=01

PSU13
 CASE 149A
 CURRENT VERSION: 8.05

ERROR SUMMARY SCREEN

11/18/96

FORM NAME	NUMBER OF DOLLAR SIGNS	NUMBER OF LEVEL 1 ERRORS	NUMBER OF LEVEL 2 ERRORS	VERSION NUMBER CONSISTENT
Accident	0	0	0	Y
General Vehicle	0	0	1	Y
Vehicle Exterior	0	0	0	Y
Vehicle Interior	0	0	0	Y
Occupant Assessment	0	0	1	Y
Occupant Injury	0	0	0	Y
Total Inter Errors		0	1	
Total Case Errors	0	0	3	



SLIDE INDEX

Primary Sampling Unit Number <u>13</u>		Case Number - Stratum <u>149A</u>	
Slide No.	Vehicle No.	Direction of Picture	Description of Slide Subject Matter
1-9	1	North	Looking at Approach to PoI & FRP
10			
11	1	South	Looking back at FRP to PoI to Approach
12-26	2	East	Looking at approach to PoI & FRP
27	2	West	Looking back at Approach
28	2	West	Looking back from FRP to PoI to Approach
29-32	3	West	Looking at Approach to PoI & FRP
33-35	1		Front
36	1		Front & Left
37-38	1		Front & Right
39-40	1		Front & Left
41-42	1		Left
43	1		Gas Tank
44-45	1		Left & Rear
46	1		Rear
47-48	1		Rear & Right
49	1		Right
50	1		Right & Front
51-52	1		Right door Interior
53-58	1		Steering wheel
59-64	1		Instrument Panel Area
65-68	1		Left door Interior
69-70	1		Second Seat Area
71-72	1		Third seat Area
73-77	1		Front Seat backs
78-79	1		2nd seat backs
80-81	1		3rd seat backs

Slide No.	Vehicle No.	Direction of Picture	Description of Slide Subject Matter
82-83	2		Front & Left
84-87	2		Left
88-89	2		Fuel Tanks
90-91	2		Left & Rear
92-	2		Rear
93-94	2		Rear & Right
95-100	2		Right
101-102	2		Right & Front
103-104	2		Right door Interior
105-107	2		Steering wheel
108-110	2		Instrument Panel Area
111-112	2		Left door Interior
113-114	2		Seat backs
115-116	3		Front
117-118	3		Front & Left
119-	3		Left
120-121	3		Left & Rear
122	3		Rear
123-124	3		Rear & Right
125-126	3		Right
127-128	3		Right & Front
129-130	3		Right Door Interior
131-133	3		Steering wheel
134-136	3		Instrument Panel Area
137-138	3		Left door Interior
139-140	3		Rear Seat Area
141-143	3		Front Seat backs
144-145	3		Rear Seat Area



PSU 13-149A (1995) #1



PSU 13-149A (1995) #2



PSU 13-149A (1995) #3



PSU 13-149A (1995) #4



PSU 13-149A (1995) #5



PSU 13-149A (1995) #6



PSU 13-149A (1995) #7



PSU 13-149A (1995) #8



PSU 13-149A (1995) #9



PSU 13-149A (1995) #10



PSU 13-149A (1995) #11



PSU 13-149A (1995) #12



PSU 13-149A (1995) #13



PSU 13-149A (1995) #14



PSU 13-149A (1995) #15



PSU 13-149A (1995) #16



PSU 13-149A (1995) #17



PSU 13-149A (1995) #18



PSU 13-149A (1995) #19



PSU 13-149A (1995) #20



PSU 13-149A (1995) #21



PSU 13-149A (1995) #22



PSU 13-149A (1995) #23



PSU 13-149A (1996) #24



PSU 13-149A (1995) #25



PSU 13-149A (1995) #26



PSU 13-149A (1995) #27



PSU 13-149A (1995) #28



PSU 13-149A (1995) #29



PSU 13-149A (1995) #30



PSU 13-149A (1995) #31



PSU 13-149A (1995) #32



PSU 19-149A (1995) #33
Best Available



PSU 13-149A (1995) #33A
Best Available



PSU 13-149A (1995) #33B
Best Available




PSU 13-149A (1995) #34A
Best Available



PSU 13-149A (1995) #34B
Best Available



PSU 13-149A (1995) #35
Best Available

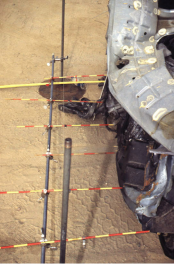

PSU 13-149A (1995) #36
Best Available



PSU 13-149A (1995) #37
Best Available



PSU 13-149A (1995) #38
Best Available



PSU 13-149A (1995) #39
Best Available



PSU 13-149A (1995) #40A
Best Available



PSU 13-149A (1995) #40B
Best Available



PSU 13-149A (1995) #41
Best Available



PSU 13-149A (1995) #42
Best Available



PSU 13-149A (1995) #43
Best Available



PSU 13-148A (1995) #44
Best Available



**PSU 13-149A (1995) #45
Best Available**



PSU 13-149A (1995) #46
Best Available



**PSU 13-149A (1995) #47
Best Available**



PSU 13-149A (1995) #48
Best Available



PSU 13-149A (1995) #49
Best Available



PSU 13-149A (1995) #50
Best Available



PSU 13-149A (1995) #51
Best Available



PSU 13-149A (1995) #52
Best Available



PSU 13-149A (1995) #53
Best Available



PSU 13-149A (1995) #54
Best Available



PSU 13-149A (1995) #55
Best Available



PSU 13-149A (1995) #56
Best Available



PSU 13-149A (1995) #57
Best Available



PSU 13-148A (1995) #58
Best Available



PSU 13-149A (1995) #59
Best Available



PSU 13-149A (1995) #60
Best Available



PSU 13-149A (1995) #61
Best Available



PSU 13-149A (1995) #62
Best Available



PSU 13-149A (1995) #63
Best Available



**PSU 13-149A (1995) #64
Best Available**



PSU 13-149A (1995) #65
Best Available



PSU 13-149A (1995) #66
Best Available



PSU 13-149A (1995) #67
Best Available



PSU 13-149A (1995) #68
Best Available



PSU 13-149A (1995) #69
Best Available



PSU 13-149A (1995) #70
Best Available



PSU 13-149A (1995) #71
Best Available



PSU 13-149A (1995) #72
Best Available



PSU 13-149A (1995) #73
Best Available



PSU 13-149A (1995) #74
Best Available



PSU 13-149A (1995) #75
Best Available



PSU 13-149A (1985) #78
Best Available



FSU 13-149A (1995) #77
Best Available



PSU 13-149A (1995) #78
Best Available



PSU 13-149A (1995) #79
Best Available



PSU 13-149A (1995) #80



PSU 13-149A (1995) #81



PSU 13-149A (1995) #82
Best Available



PSU 13-149A (1995) #83
Best Available



PSU 13-149A (1995) #84
Best Available



PSU 13-149A (1995) #85



PSU 13-149A (1995) #86



PSU 13-149A (1995) #87



PSU 13-149A (1995) #88
Best Available



PSU 13-149A (1995) #89
Best Available



PSU 13-149A (1995) #90
Best Available



PSU 13-149A (1995) #91
Best Available



PSU 13-149A (1995) #92
Best Available



PSU 13-149A (1995) #93
Best Available




PSU 13-149A (1995) #94
Best Available



PSU 13-149A (1995) #95
Best Available



PSU 13-149A (1995) #98
Best Available

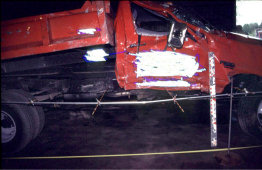

PSU 13-149A (1995) #97
Best Available



PSU 13-149A (1995) #98
Best Available



PSU 13-149A (1995) #99
Best Available



PSU 13-149A (1995) #100
Best Available



PSU 13-148A (1995) #101
Best Available



PSU 13-149A (1995) #102
Best Available



PSU 13-149A (1995) #103
Best Available



PSU 13-149A (1995) #104
Best Available



PSU 13-149A (1995) #105



PSU 13-149A (1995) #106



PSU 13-149A (1995) #107



PSU 13-149A (1995) #108
Best Available



PSU 13-149A (1995) #109



PSU 13-148A (1995) #110



PSU 13-149A (1995) #111



PSU 13-149A (1995) #112



PSU 13-149A (1995) #114



PSU 13-149A (1995) #114



FSU 13-149A (1995) #115



PSU 13-149A (1995) #116



PSU 13-149A (1995) #117



PSU 13-149A (1995) #118



PSU 13-149A (1995) #119



PSU 13-149A (1995) #120



PSU 13-149A (1995) #121



PSU 13-149A (1995) #122



PSU 13-149A (1995) #123



PSU 13-149A (1995) #124



PSU 13-149A (1995) #125



PSU 13-149A (1995) #126



PSU 13-149A (1995) #127



PSU 13-149A (1995) #128



PSU 13-149A (1995) #129



PSU 13-149A (1995) #130



PSU 13-149A (1995) #131



PSU 13-149A (1995) #132



PSU 13-149A (1995) #133



PSU 13-149A (1995) #134



PSU 13-149A (1995) #135



PSU 13-149A (1995) #136



PSU 13-149A (1995) #137



PSU 13-149A (1995) #138



PSU 13-149A (1995) #139



PSU 13-149A (1995) #140



PSU 13-149A (1995) #141



PSU 13-149A (1995) #142



PSU 13-149A (1995) #143



PSU 13-149A (1995) #144



PSU 13-149A (1995) #145